

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. SE 078040  
Unit E/2 Sec. 10

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 25, 19 60


Well No. Delhi-Mudge #1 is located 920 ft. from N line and 1650 ft. from E line of sec. 10  
X  
Y. E./4 Sec. 10 31-N 11-W NMPM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Undes, Dakota San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the Surface above sea level is 5902 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 9-7/8" hole from 205' to 2770'. Ran 83 Jts. of 7-5/8" 26.40# J-55 casing set at 2770' w/250 sks. cement, 4% Sol. casing pressured to 800# for 30 min. After cement set, plug was drilled and hole was blown dry w/gas and remained dry. Drilling resumed w/gas.

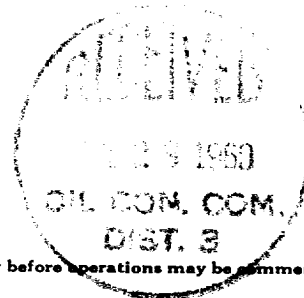

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Delhi-Taylor Oil Corporation

Address P. O. Drawer 1198

Farmington, New Mexico

By J. B. Howell  
Title Dist. Supt.