


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency Navajo
Allottee _____
Lease No. 14-00-000-0000

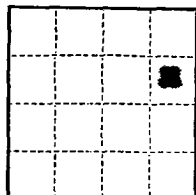

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Supplementary Report of Redrilling and Pumping Treatment</u>	<input checked="" type="checkbox"/>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Navajo Tribe Farmlington Salt Mines June 4, 1959

Well No. 22 is located 1000 ft. from [N] line and 660 ft. from [E] line of sec. 9

SE 1/4 of SW 1/4 Sec. 9 31-2 23-4 107W

(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Ordway Rock Saline San Juan New Mexico

(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5057 ft. Gr.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 9" hole 5/11/59. Set 7-1/2" casing at 45' w/10 casing seg. cement. Drilled while to 920' & mudded up. To 970', 720' 920'. Run class. logs. Set 5" casing at 970' w/10 casing 15 casing cement. Run down log & casing logs. Perforated from 971' to 974' w/10 jet down per Sect. Sand/oil from w/20,000 Gals. loc. grade and 20,000 and a 120 gals. 5-10. Ave. inj. rate 10.5 bbls./min. at 974'. Cleaned out mud from 970' to 974'. Set 2" tubing at 974'. Run rods & pump and installed pumping unit. On check 24 hour potential test on 10-50" API pump 120 bbls. over 710. Over. Cr. 70-2. Flow now oil to tank 6/1/59.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Double Oil & Refining Company

Address Box 1000

Farmlington, Salt Mines

COPY ORIGINAL
SIGNED: R. M. LILLY
By Robert H. Lilly
Title District Superintendent