

(SUBMIT IN TRIPLICATE)

X		
	7	

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency _____

Navajo Tribal

Allottee _____

Lease No. _____

Contr. #14-20-600-3530

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	<input checked="" type="checkbox"/>	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL		SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 26, 1963

Chimney Rock
Well No. 11-7 is located 890 ft. from ^[N]_[S] line and 500 ft. from ^[W]_[E] line of sec. 7


NE 1/4 Sec. 7 31N 16W 10PM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated Gallup San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

KE
The elevation of the ~~drill hole~~ above sea level is 6371 ft. Final gnd. 5361'

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

6/23/63 Spud 4 pm. Drilled 12 1/2" hole to 125'. Ran 121' (5 joints) 9-5/8" H-40 casing. Shoes at 116' & C.I. Baffle plate at 93'. Cement with 61 max Class "C" cement and 2% CaCl2. Circulated cement to surface. Tested with 600 psi for 30 min., after 8 hrs, held ok.

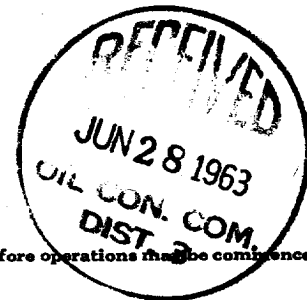

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shoney Mobil Oil Co., Inc.

Address P. O. Box 3371

Durango, Colorado

By M. J. Meyer
M. J. Meyer
Title Sr. Production Foreman