

NEW MEXICO OIL CONSERVATION COMMISSION
MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

COMPANY El Paso Natural Gas Company - Box 997, Farmington, New Mexico
(Address)

LEASE Rosa Unit WELL NO. 29-32 UNIT H S 32 T 32N R 6W

DATE WORK PERFORMED 6-22-58 POOL Blanco M. V.

This is a Report of: (Check appropriate block) ☒ Results of Test of Casing Shut-off

☐ Beginning Drilling Operations

☐ Remedial Work

☐ Plugging

☐ Other _____


Detailed account of work done, nature and quantity of materials used and results obtained.

Total depth 3732'.

Ran 112 joints 7 5/8", 26.40#, J-55 casing (3721.12') set at 3731.12' w/100 sacks regular cement, 100 sacks Pozmix, 50# Flocele & 2% Gel, followed by 50 sacks regular cement w/ 2% CaCl.

Held 1000#/30 minutes.

Top of cement by temperature survey at 2465'.

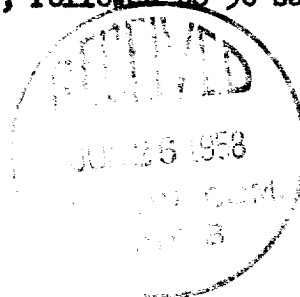

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

Original Well Data:

DF Elev. _____ TD _____ PBD _____ Prod. Int. _____ Compl Date _____

Tbng. Dia _____ Tbng Depth _____ Oil String Dia _____ Oil String Depth _____

Perf Interval (s) _____

Open Hole Interval _____ Producing Formation (s) _____

RESULTS OF WORKOVER:

BEFORE

AFTER

Date of Test

Oil Production, bbls. per day

Gas Production, Mcf per day

Water Production, bbls. per day

Gas-Oil Ratio, cu. ft. per bbl.

Gas Well Potential, Mcf per day

Witnessed by