

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget/Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF-078215

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

VANDERSLICE

9. WELL NO.

#1-A

10. FIELD AND POOL, OR WILDCAT
Blanco Mesa Verde
Blanco Pictured Cliffs11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Section 19, T32N, R10W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1.

OIL ☐ GAS ☒ OTHER ☐
WELL WELL

2. NAME OF OPERATOR

SOUTHLAND ROYALTY COMPANY

3. ADDRESS OF OPERATOR

P. O. Drawer 570, Farmington, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

800' FSL & 1820' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6162' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) Squeeze off water zone ☒PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

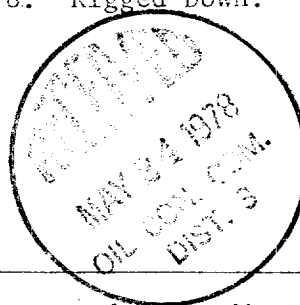
WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☒REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

3-23-78 MIRU-Well Service Unit. Pull both tubing springs.

3-24-78 Squeezed perfs from 2958', 2966', 2974' with 10 sacks Class "B" and 2% CaCl.
Resqueezed perfs with 10 sacks Class "B" and 2% CaCl. Final squeeze pressure
To 1600#. Pressure tested squeeze 800# for 15 minutes-OK. Pressure up to
1000# for 5 minutes - OK. Cleaned out to liner top with 6-1/4" Bit. Trip
in hole with 3-7/8" Bit. Cleaned out to Bridge Plug to 2990'.

3-27-78 Cleaned out to 3129'. Retrieved D-1 plug. Circulate well on bottom

3-28-78 Reran 2-3/8" (Mesa Verde) production string set at 5547'. Reran 1-1/2"
(Pictured Cliffs) production string set at 2962'. Nipple up wellhead.
Pumped out plug at 12:30 AM 3-29-78. Rigged Down.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE District Production Manager DATE May 19, 1978

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side