

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐  
well ☒ well ☐ other ☐

2. NAME OF OPERATOR  
Energetics, Inc.

3. ADDRESS OF OPERATOR  
102 Inverness Terrace East, Englewood, CO 80111

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 2100' FNL & 1940' FEL  
AT TOP PROD. INTERVAL: same  
AT TOTAL DEPTH: same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF	<input type="checkbox"/>		<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>		<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>		<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>		<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>		<input type="checkbox"/>
MULTIPLE COMPLETE	<input type="checkbox"/>		<input type="checkbox"/>
CHANGE ZONES	<input type="checkbox"/>		<input type="checkbox"/>
ABANDON*	<input type="checkbox"/>		<input checked="" type="checkbox"/>
(other)			

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

6-9-80: Rig up mast pole. Perforate 100' with 2 jets. 6-13-80 MIRUPU Farmington Well Service. Ran 76 joints 2 3/8" tubing to 2160'. Pull tubing Dump 3500# 20-40 mesh sand down casing. Run 2 3/8" tubing. Hit bridge at 700' and 1150'. Wash out same. Tag sand fill at 2070'. Spot 40 sacks class "B" cement plug from 2065-1865'. Lay down tubing. 6-14-80 Load hole with water. Cement 5 1/2" casing and 5 1/2" x 8 5/8" annulus with 30 sacks class "B". Circulate estimate 1 barrel cement. 6-18-80 Install dry hole marker. 6-23-80 Clean up location. Well plugged and abandoned.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Jack D. Cook TITLE Agent DATE 8-28-80

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

State

5. LEASE  
mod NOO-C-1420-1719

6. IF INDIAN, ALLOTTEE OR TRIBE NAME  
Mountain Ute

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Ute 13

9. WELL NO.  
32

10. FIELD OR WILDCAT NAME  
Verde Gallup


11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec 13, T31N, R15W

12. COUNTY OR PARISH San Juan 13. STATE New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
5640 GL

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

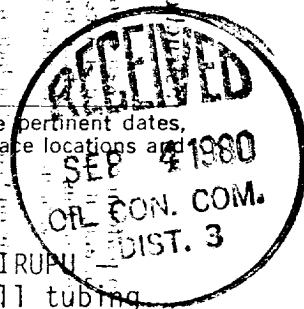

RECEIVED

SEP 2 1980

U. S. GEOLOGICAL SURVEY  
DURANGO, COLO.