

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well
GAS

2. Name of Operator
BURLINGTON RESOURCES OIL & GAS COMPANY

3. Address & Phone No. of Operator
PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M
1880' FNL, 1165' FWL, Sec. 7, T-32-N, R-6-W, NMPM, San Juan County

API # (assigned by OCD)
30-045-29629

5. Lease Number
Fee


6. State Oil&Gas Lease #

7. Lease Name/Unit Name
Allison Unit

8. Well No.
#61M

9. Pool Name or Wildcat
Blanco MV/Basin DK

10. Elevation:

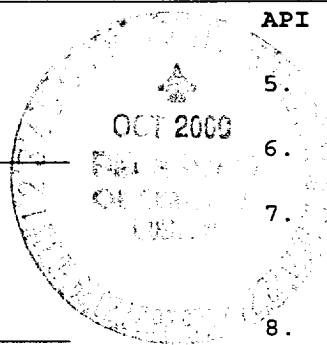

Type of Submission	Type of Action
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment <input type="checkbox"/> Change of Plans
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion <input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back <input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair <input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Altering Casing <input type="checkbox"/> Conversion to Injection
	<input checked="" type="checkbox"/> Other - Tubing repair

13. Describe Proposed or Completed Operations

9-20-00 MIRU. ND WH. NU BOP. TOO H w/2 3/8" tbg. SDON.

9-21-00 TIH w/2 3/8" tbg. PT tbg to 3500 psi, locate holes in tbg. Replace bad jts. Land tbg @ 7690'. TIH w/sandline to fish stdg valve. Obstruction in tbg above stdg valve. TOO H w/sandline. Swab tbg. Hose to sandline control broke, repair rig. SDON.

9-22/26-00 Repair sandline clutches.

9-27-00 TOO H w/2 3/8" tbg. TIH, CO to PBTD @ 7817'. Land 246 jts 2 3/8" 4.7# J-55 tbg @ 7686'. ND BOP. NU WH. RD. Rig released.

SIGNATURE *Regina Cole* Regulatory Supervisor October 2, 2000

TLW

(This space for State Use)

Approved by ORIGINAL SIGNED BY CHARLIE T. PERPIN Title DEPUTY OIL & GAS INSPECTOR, DIST. #3 Date OCT 10 2000