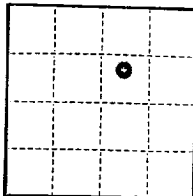


(SUBMIT IN TRIPLICATE)

Indian Agency Ute-IndianUNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____

Lease No. 14-20-151-46

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL		SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		Subsequent Report of Re-Fracing	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 17, 1957

2-4 Ute-Indian

Well No. 1 is located 1900 ft. from [N] line and 1900 ft. from [E] line of sec. 16SW/NE, Section 16

(1/4 Sec. and Sec. No.)

T-31-N, R-15-W

(Twp.)

(Range)

N.H.P.M.

(Meridian)

Verde-Gallup

(Field)

San Juan

(County or Subdivision)

New Mexico

(State or Territory)

The elevation of the derrick floor above sea level is 5760 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Pulled tubing and rods. Sand-oil fraced with 38,500 gallons oil and 37,000 lbs. sand, 4000 lbs. adomite, Breakdown pressure 1500, Treating 1500, Final Zero, I.R. 11.5 bpm. Re-ran tubing and rods - landed 61 jts. of 2 3/8" tubing at 1927', perforated joint at 1917'. Installed pump.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company AZTEC OIL & GAS COMPANYAddress P O Box 786Farmington, New MexicoBy Joe C. Salmon

Joe C. Salmon

Title District Superintendent

