

UNITED STATES  
 DEPARTMENT OF THE INTERIOR  
 GEOLOGICAL SURVEY

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well  gas well  other  Recomplete

2. NAME OF OPERATOR  
 Amoco Production Company

3. ADDRESS OF OPERATOR  
 P. O. Box 68, Hobbs, NM 88240

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
 AT SURFACE: 1980' FSL X 1980' FEL, Sec. 12  
 AT TOP PROD. INTERVAL: (Unit J, NW/4, SE/4)  
 AT TOTAL DEPTH:

5. LEASE  
 NM-01235-D

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
 Bondurant Federal

9. WELL NO.  
 5

10. FIELD OR WILDCAT NAME  
 West Tonto Wolfcamp

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
 12-19-32

12. COUNTY OR PARISH  
 Lea

13. STATE  
 NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
 3674.5 RDB

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:      SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF      

FRACTURE TREAT      

SHOOT OR ACIDIZE      

REPAIR WELL      


PULL OR ALTER CASING      

MULTIPLE COMPLETE      

CHANGE ZONES      

ABANDON\*      

(other) \_\_\_\_\_

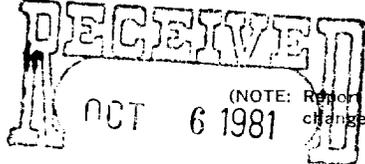

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

OIL & GAS  
 U.S. GEOLOGICAL SURVEY  
 ROSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Moved in service unit (X-Pert #21) on 9-17-81. Pulled tubing and packer. Set cast iron bridge plug at 13000' and capped with 50' cement. Perforated intervals 10887-91 and 10914'-26' with 2 JSPF. Ran tailpipe and packer back in hole. Set tailpipe at 10832 and packer at 10768. Swabbed 3 hrs. and recovered 32 BLW, no oil, and no show of gas. Currently preparing to acidize.

0+6-USGS, R      1-Hou      1-Susp      1-W. Stafford, Hou      1-MDR

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Mark Randolph TITLE Ast. Adm. Analyst DATE 9-30-81

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD  
 OCT 6 1981  
 O.A.L.  
 U.S. GEOLOGICAL SURVEY  
 ROSWELL, NEW MEXICO

\*See Instructions on Reverse Side