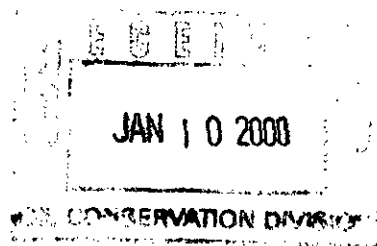


RELEASE REPORT

EOTT ENERGY Pipeline Limited Partnership

P.O. BOX 1660
5805 E. BUSINESS 20
MIDLAND, TEXAS 79702
(915) 682-3761



January 5, 2000

State of New Mexico
Oil Conservation Division
2040 S. Pacheco
Santa Fe, NM 87505
Attn: William Olson

RE: **UL I - Sec. 19, T-19-S, R-37-E**
Monument 6" gathering line

Dear Mr. Olson:

Attached please find the final C-141 for the above captioned spill. Approximately 2000 cubic yards of crude oil contaminated soil was removed and disposed of at C&C Landfarm. The remaining contaminated soil was stockpiled and treated in-situ using Environmental Technology Group, Inc.'s Deep Remediation Injection System (DRIS). Using the NMOCD Guidelines for Leaks, Spills and Releases, EOTT has successfully reached TPH, BTEX and Benzene levels of <100 ppm, <50 ppm and < 10 ppm, respectively for all sampling (bottomhole and stockpiled soil).

At the time EOTT took the last soil sample from the bottom of the excavation, a water sample was also taken from the site. This sample meets WQCC guidelines for BTEX (analysis attached). EOTT Energy believes that we have adequately cleaned up the source (contaminated soil) causing groundwater contamination at the site. The clean water was immediately packed off with a clay seal approximately 5' thick to prevent further contamination.

Based on the attached laboratory analysis EOTT proposes closure on soil and groundwater at the site. I hope all meets with OCD approval but if you have any questions, please don't hesitate to call.

Sincerely,

Lennah Frost
Sr. Environmental Engineer

/attachments

cc: NMOCD - Hobbs
State Land Office - Hobbs *Lunta Fe*

ENVIRONMENTAL LAB OF , INC.

"Don't Treat Your Soil Like Dirt!"

ALLSTATE SERVICES ENVIRONMENTAL
ATTN: MR. CLAYTON Mc DONALD
P.O. BOX 11322
MIDLAND, TEXAS 79702
FAX: 915-682-4182
FAX: 505-397-5125
FAX: 915-887-2713 (Lennah Frost)

Receiving Date: 06/11/99
Sample Type: Soil
Project #: EOTT 6" Gathering Line
Project Name: None Given
Project Location: 3.5 mi. NW of Monument

Analysis Date: 06/14/99
Sampling Date: 06/11/99
Sample Condition: Intact/Iced

ELT#	FIELD CODE	TPH (DRO)					
		BENZENE (mg/kg)	TOLUENE (mg/kg)	ETHYLBENZENE (mg/kg)	m,p-XYLENE (mg/kg)	o-XYLENE (mg/kg)	C10-C28 (mg/kg)
18328	Sec. A-1 Bottom Hole	<0.100	<0.100	<0.100	<0.100	<0.100	<10
18329	Sec. A-2 Bottom Hole	<0.100	0.232	<0.100	0.307	0.110	<10

%IA	96	91	89	96	94	103
%EA	94	89	86	86	88	94
BLANK	<0.100	<0.100	<0.100	<0.100	<0.100	<10

METHODS: EPA SW 846-8020.5030, 8015M DRO

Raland K. Tuttle
Raland K. Tuttle

6-15-99
Date

[illegible]

"Don't Treat Your Soil Like Dirt!"

EOTT ENERGY
ATTN: MRS. LENNAH FROST
P.O. BOX 1660
MIDLAND, TEXAS 79703
FAX: 915-687-2713
FAX: 915-682-4182

Sample Type: Soil
Sample Condition: Intact/fed
Project #: EOTT 6" Gathering Line
Project Name: None Given
Project Location: 3 miles NW Monument

Sampling Date: 07/01/99
Receiving Date: 07/01/99
Analysis Date: 07/02/99

ELT#	FIELD CODE	TPH (DRO)					
		BENZENE (mg/kg)	TOLUENE (mg/kg)	ETHYLBENZENE (mg/kg)	m,p-XYLENE (mg/kg)	o-XYLENE (mg/kg)	C10-C28 (mg/kg)
18476	Sec. A-1 East SW	<0.100	0.106	<0.100	<0.100	<0.100	11
18477	Sec. A-3 BH	<0.100	<0.100	<0.100	0.108	<0.100	<10
18478	Sec. A-3 West SW	<0.100	<0.100	<0.100	<0.100	<0.100	<10
18479	Sec. A-4 East SW	<0.100	<0.100	<0.100	<0.100	<0.100	<10
18480	Sec. A-4 BH	<0.100	<0.100	<0.100	<0.100	<0.100	<10
18483	Cont. Soil I Sec. A3-4	*	*	*	*	*	40
18484	Cont. Soil II Sec. A3-4	*	*	*	*	*	359

Stackpiled Soil

%IA	93	91	89	88	89	102
%EA	102	96	91	90	95	95
BLANK	<0.100	<0.100	<0.100	<0.100	<0.100	<10

METHODS: EPA SW 846-8020.5030, 8015M DRO

Roland K. Tuttle

7-6-99
Date

ENVIRONMENTAL LAB OF , INC.

"Don't Treat Your Soil Like Dirt!"

EOTT ENERGY
ATTN: MRS. LENNAH FROST
P.O. BOX 1660
MIDLAND, TEXAS 79703
FAX: 915-687-2713
FAX: 915-682-4182

Sample Type: Water
Sample Condition: Intact/Iced
Project #: EOTT 6" Gathering Line
Project Name: None Given
Project Location: 3 miles NW Monument

Sampling Date: 07/01/99
Receiving Date: 07/01/99
Analysis Date: 07/02/99

ELT#	FIELD CODE	BENZENE (mg/L)	TOLUENE (mg/L)	ETHYLBENZENE (mg/L)	m,p-XYLENE (mg/L)	o-XYLENE (mg/L)
18481	Sec. A-3 Water	<0.001	0.002	<0.001	0.004	0.002
18482	Sec. A-4 Water	0.002	<0.001	<0.001	<0.001	0.001

%IA	93	91	89	88	89
%EA	96	92	90	87	89
BLANK	<0.001	<0.001	<0.001	<0.001	<0.001

METHODS: EPA SW 846-8020.5030


Raland K. Tuttle

7-6-99
Date

ENVIRONMENTAL
LAB OF , INC.

"Don't Treat Your Soil Like Dirt!"

ENVIRONMENTAL TECHNOLOGY GROUP, INC.
ATTN: MR. RONNIE NICKELL
P.O. BOX 4845
MIDLAND, TEXAS 79704
FAX: 915-520-4310


Sample Type: Soil
Sample Condition: Intact
Project #: EOT1008R
Project Name: LF 37 - *Stockpile*
Project Location: Monument, N.M.

Sampling Date: 12/17/99
Receiving Date: 12/17/99
Analysis Date: 12/17/99

ELT#	FIELD CODE	GRO	DRO
		C6-C10 mg/kg	>C10-C25 mg/kg
22397	EOT1008R	<10	73

%INSTRUMENT ACCURACY	113	108
% EXTRACTION ACCURACY	111	114
BLANK	<10	<10

Methods: EPA SW 846-8015M GRO/DRO


Raland K. Tuttle

12-21-99
Date

ENVIRONMENTAL LAB OF , INC.

"Don't Treat Your Soil Like Dirt!"

ENVIRONMENTAL TECHNOLOGY GROUP, INC.
ATTN: MR. RONNIE NICKELL
P.O. BOX 4845
MIDLAND, TEXAS 79704
FAX: 915-520-4310


Sample Type: Soil
Sample Condition: Intact
Project #: EOT1008R
Project Name: LF 37 - *Stockpile*
Project Location: Monument, N.M.

Sampling Date: 12/17/99
Receiving Date: 12/17/99
Analysis Date: 01/04/00

ELT#	FIELD CODE	BENZENE mg/kg	TOLUENE mg/kg	ETHYLBENZENE mg/kg	m,p-XYLENE mg/kg	o-XYLENE mg/kg
22397	EOT1008R	<0.100	<0.100	<0.100	<0.100	<0.100

% IA	94	96	91	94	92
% EA	83	87	87	87	86
BLANK	<0.100	<0.100	<0.100	<0.100	<0.100

METHODS: EPA SW 846-8021B.5030


Raland K. Tuttle

1-5-00
Date

ENVIRONMENTAL
LAB OF , INC.

"Don't Treat Your Soil Like Dirt!"

ENVIRONMENTAL TECHNOLOGY GROUP, INC.
ATTN: MR. RONNIE NICKELL
P.O. BOX 4845
MIDLAND, TEXAS 79704
FAX: 915-520-4310


Sample Type: Soil
Sample Condition: Intact
Project #: EOT1008R
Project Name: LF 37 - *Stockpile*
Project Location: Monument, N.M.

Sampling Date: 11/15/99
Receiving Date: 11/17/99
Analysis Date: 11/17/99

ELT#	FIELD CODE	GRO	DRO
		C6-C10 mg/kg	>C10-C25 mg/kg
21646	1008R 5'	<10	132

%INSTRUMENT ACCURACY	107	93
% EXTRACTION ACCURACY	113	95
BLANK	<10	<10

Methods: EPA SW 846-8015M GRO/DRO


Raland K. Tuttle

11-18-99
Date

ENVIRONMENTAL
LAB OF , INC.

"Don't Treat Your Soil Like Dirt!"

ENVIRONMENTAL TECHNOLOGY GROUP, INC.
ATTN: MR. RONNIE W. NICKELL
P.O. BOX 4845
MIDLAND, TEXAS 79704
FAX: 915-520-4310


Sample Type: Soil
Sample Condition: Intact
Project #: EOT1008R
Project Name: EOTT - LF-37- *Stackpile*
Project Location: Monument, New Mexico

Sampling Date: 08/23/99
Receiving Date: 08/23/99
Analysis Date: 08/23/99

ELT#	FIELD CODE	DRO C10-C28 mg/kg
19397	EOT1008R	550

BLANK	<10
QUALITY CONTROL	575
TRUE VALUE	500
% PRECISION	115

Methods: SW-846 8015M DRO


Raland K. Tuttle

8-24-99
Date

ENVIRONMENTAL LAB OF , INC.

"Don't Treat Your Soil Like Dirt"

ALLSTATE SERVICES
ATTN: MR. CLAYTON McDONALD
P.O. BOX 11322
MIDLAND, TEXAS 79702
FAX: 505-397-5125
FAX: 915-682-4182
FAX: 915-687-2713 (Lennah Frost)
FAX: 505-392-2946 (Frank Hernandez)


Receiving Date: 06/02/99
Sample Type: Soil
Project #: 6" Gathering Line
Project Name: ~~None Given~~ LF-37- *Stackpile*
Project Location: 3.5 mi. NW Monument

Analysis Date: 06/02/99
Sampling Date: 06/02/99
Sample Condition: Intact/Iced

ELT#	FIELD CODE	DRO
		C10-C28 (mg/kg)
18069	Contaminated Soil Pile #1	661
18070	Contaminated Soil Pile #2	280
18071	Contaminated Soil Pile #3	903
18072	Line Site 18 Ft. BH Comp.	296

% INSTRUMENT ACCURACY 103
% EXTRACTION ACCURACY 100
BLANK <10

METHODS: EPA SW 846-8015M DRO


Roland K. Tuttle

6-3-99
Date

12600 West I-20 East • Odessa, Texas 79765 • (915) 563-1800 • Fax (915) 563-1713

** TOTAL PAGE. 01 **

Mountain N.M.

Stockpile

