

# Closure Report

## Site Description

Site Name:	Admiral Federal #2
Company:	COG Operating, LLC
Legal Description:	U/L O, Section 28, T25S, R29E
County:	Eddy County, NM
GPS Coordinates:	N 32.09448 W-103.98685

## Release Data

Date of Release:	03/08/2018
Type of Release:	Produced water
Source of Release:	Flow line
Volume of Release:	80 bbls
Volume Recovered:	18 bbls

## Remediation Specifications

Remediation Parameters:	Excavated the spill areas of T1 and T2 to a depth of 3 feet. Excavated the spill areas of T3 and T4 to a depth of 4 feet. Excavated the area of T5 to a depth of 2 feet. Backfilled the site with clean soil.	
Remediation Activities:	08/08/2018 to 09/13/2018	
Plan Sent to OCD:	06/17/2018	Email from Cliff Brunson to Mike Bratcher
OCD Approval of Plan:	06/20/2018	Email from Mike Bratcher to Cliff Brunson
Plan Sent to BLM:	07/11/2018	Email from Becky Haskell to Henryetta Price
BLM Approval of Plan:	07/11/2018	Email from Henryetta Price to Becky Haskell

## Supporting Documentation

Initial C-141	Signed 03/12//2018
Final C-141	Signed 09/25/2018
Site Diagram	June 2018
Pictures	Initial visit, remediation, and backfill August/September 2018

## Request for Closure

Based on the completion of the remediation plan, BBC International, Inc. requests closure approval from NMOCD.

Cliff Brunson, President, BBC International, Inc.

10/03/2018




# COG, Admiral Fed Com 2H Battery

Leak date: 03/08/2018  
Eddy County, NM  
API# 30-015-42820  
2RP-4664

## Legend

- 2 ft Excavation
- 3 ft Excavation
- 4 ft Excavation
- Cardinal sample points
- Sample points
- Leak Area outside battery
- Lined battery w/ 6 tanks

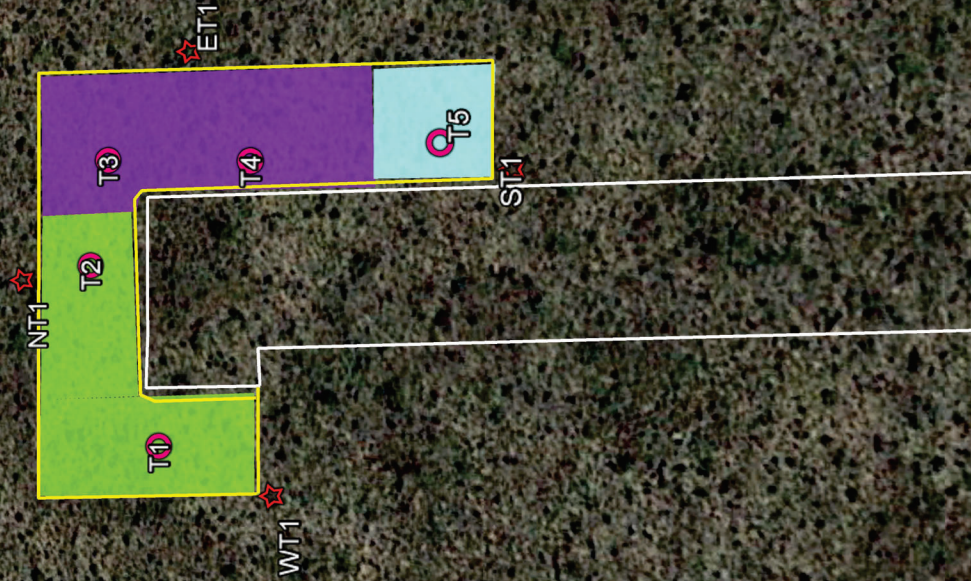



COG, Admiral Fed Com 2H Battery

Sample points

T1, N 32.09443 W-103.98690

T2, N 32.09450 W-103.98673

T3, N 32.09448 W-103.98663

T4, N 32.09435 W-103.98663

T5, N 32.09418 W-103.98661

NT1, N 32.09468 W-103.98671

WT1, N 32.09421 W-103.98708

ET1, N 32.09440 W-103.98641

ST1, N 32.09375 W-103.98676























































Incident ID	
District RP	2RP-4664
Facility ID	
Application ID	

## Closure

The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (electronic submittals in .pdf format are preferred) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.

**Closure Report Attachment Checklist:** *Each of the following items must be included in the closure report.*

- ☒ A scaled site and sampling diagram as described in 19.15.29.11 NMAC
- ☒ Photographs of the remediated site prior to backfill or photos of the liner integrity if applicable (Note: appropriate OCD District office must be notified 2 days prior to liner inspection)
- ☐ Laboratory analyses of final sampling (Note: appropriate ODC District office must be notified 2 days prior to final sampling)
- ☒ Description of remediation activities

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.

Printed Name: Rebecca Haskell

Title: Senior HSE Coordinator

Signature: Rebecca Haskell

Date: 09/25/2018

email: rhaskell@conco.com

Telephone: (432) 818-2372

**OCD Only**

Received by: \_\_\_\_\_

Date: \_\_\_\_\_

Closure approval by the OCD does not relieve the responsible party of liability should their operations have failed to adequately investigate and remediate contamination that poses a threat to groundwater, surface water, human health, or the environment nor does not relieve the responsible party of compliance with any other federal, state, or local laws and/or regulations.

Closure Approved by: Brittany Hall

Date: 11/17/2022

Printed Name: Brittany Hall

Title: Environmental Specialist



**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico  
Energy, Minerals and Natural Resources  
Oil Conservation Division  
1220 S. St Francis Dr.  
Santa Fe, NM 87505

CONDITIONS  
  
Action 159816

CONDITIONS

Operator: COG OPERATING LLC 600 W Illinois Ave Midland, TX 79701	OGRID: 229137
	Action Number: 159816
	Action Type: [IM-SD] Incident File Support Doc (ENV) (IM-BNF)

CONDITIONS

Created By	Condition	Condition Date
bhall	None	11/17/2022