



May 19th, 2026

NMOCD District 2
 1811 S. First St.,
 Artesia, New Mexico 88210

SUBJECT: Liner Inspection Report for the Tater Tot 2 CTB 5 Release (nAPP2522178846), Eddy County, New Mexico

To Whom It May Concern,

On behalf of Devon Energy, BDS Enterprises LLC has prepared this Liner Inspection Report summarizing the liner inspection that occurred due to produced water release related to oil and gas production activities at the Tater Tot 2 CTB 5. The site is in Unit P, Section 02, Township 24S, Range 29E, Eddy County, New Mexico, on state land. Figure 1 illustrates the vicinity and site location on a USGS 7.5-minute quadrangle map.

Table 1: Release Infor/mation and Closure Criteria			
Name	Tater Tot 2 CTB 5	Company	Devon Energy
API Number	fAPP2416935669	Location	32.2424417, -103.9487362
Incident Number	nAPP2522178846		
Estimated Date of Release	8/9/2026	Date Reported to NMOCD	8/9/2026
Land-Owner	State	Reported To	NMOCD, SLO
Source of Release	Corrosion on a water dump line within secondary containment		
Released Volume	94 bbl.	Released Material	Produced Water
Recovered Volume	94 bbl.	Net Release	0 bbl.
NMOCD Closure Criteria	<50 bgs		
BDS Response Dates	10/9/2025; 12/15/2025; 1/9/2026; 5/11/2026		



1.0 Background

On August 9th, 2025, a release was discovered at the Tater Tot 2 CTB 5. A pinhole leak developed on a water dump line, resulting in the release of produced water into the lined, secondary containment. Initial response activities were conducted by the operator, and included source elimination by means of repair, site stabilization, and release recovery. The release consisted of approximately 94 bbl. of produced water with 94 bbl. of produced water recovered. Figures 1 and 2 illustrate the vicinity and site location, Figure 3 illustrates the release location.

2.0 Site Information and Closure Criteria

The Tater Tot 2 CTB 3 is located approximately 27 miles southeast of Carlsbad, New Mexico on state owned land at an elevation of approximately 3,090 feet above mean sea level (amsl).

Based upon the New Mexico Office of the State Engineers (NMOSE) online water well database (Appendix A), depth to groundwater in the area is less than 100 feet below grade surface (bgs). There are no known water sources within ½-mile of the location, according to the NMOSE database.

The nearest significant watercourse is the Pecos River, greater than 2 miles southwest of the location. Figure 2 illustrates the site with 0.5-mile radii to indicate that it does not lie within a sensitive area as described in 19.15.29.12.C(4) NMAC.

Based on the information presented herein, the applicable NMOCD Closure Criteria for this site is for a groundwater depth of less than 50 feet bgs. The site has been restored to meet the standards of Table I of 19.15.29.12 NMAC. Table 2 demonstrates the Closure Criteria applicable to this location. Pertinent well data is attached in Appendix A.

3.0 Liner Integrity

At the request of Devon Energy, on October 9, 2025, BDS conducted a liner integrity inspection per the requirements of 19.15.29.11.A(5)(a) NMAC. NMOCD and SLO were notified on October 7th, 2025, that the liner inspection would occur. BDS was able to perform a thorough visual examination of the liner within the production area of the lined containment, determining it to be in working order with no observable damage or breaches.

However, the culmination of several snow and rain events resulted in precipitation standing within the secondary containment after washing took place. During this time, a second release took place within the same secondary containment (nAPP2528077016). As a result, subsequent site visits were conducted in attempt to document the containment, while a 90-day extension was sent to the Division to communicate reoccurring issues with standing water from inclimate weather events and the request of closing the incidents together. These inspections took place on

PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



12/15/2025, 1/9/2026 and 5/11/2026. A photolog of the final inspection is included in Appendix B. Proof of notification to the Division along with the previously mentioned extension request and liner inspection notification is included in Appendix C.

4.0 Recommendations

As demonstrated by the field inspection of the liner, the liner was intact and retained all fluid that occurred during the release. BDS recommends closure of incident nAPP2522178846.

5.0 Scope and Limitations

The scope of our services included: liner assessment, verifying release stabilizations; regulatory liaison; and preparation of this liner inspection report. All work has been performed in accordance with generally accepted professional environmental consulting practices for oil and gas releases in the Permian Basin in New Mexico.

If there are any questions regarding this report, please contact Lupe Carrasco (575) 725-0787.

Submitted by:

BDS Enterprises, LLC

Melodie Sanjari

Melodie Sanjari
Environmental Scientist



ATTACHMENTS

Figures:

Figure 1: Topographic Site Map

Figure 2: Aerial Site Map

Figure 3: Site Characterization Map

Tables:

Table 2: NMOCD Closure Criteria

Appendices:

Appendix A: NMOSE Wells Report

Appendix B: Photolog & Field Notes


Appendix C: Division Correspondence



FIGURES


Tater Tot 2 CTB 5 - Devon Energy

Figure 1 - Site Diagram

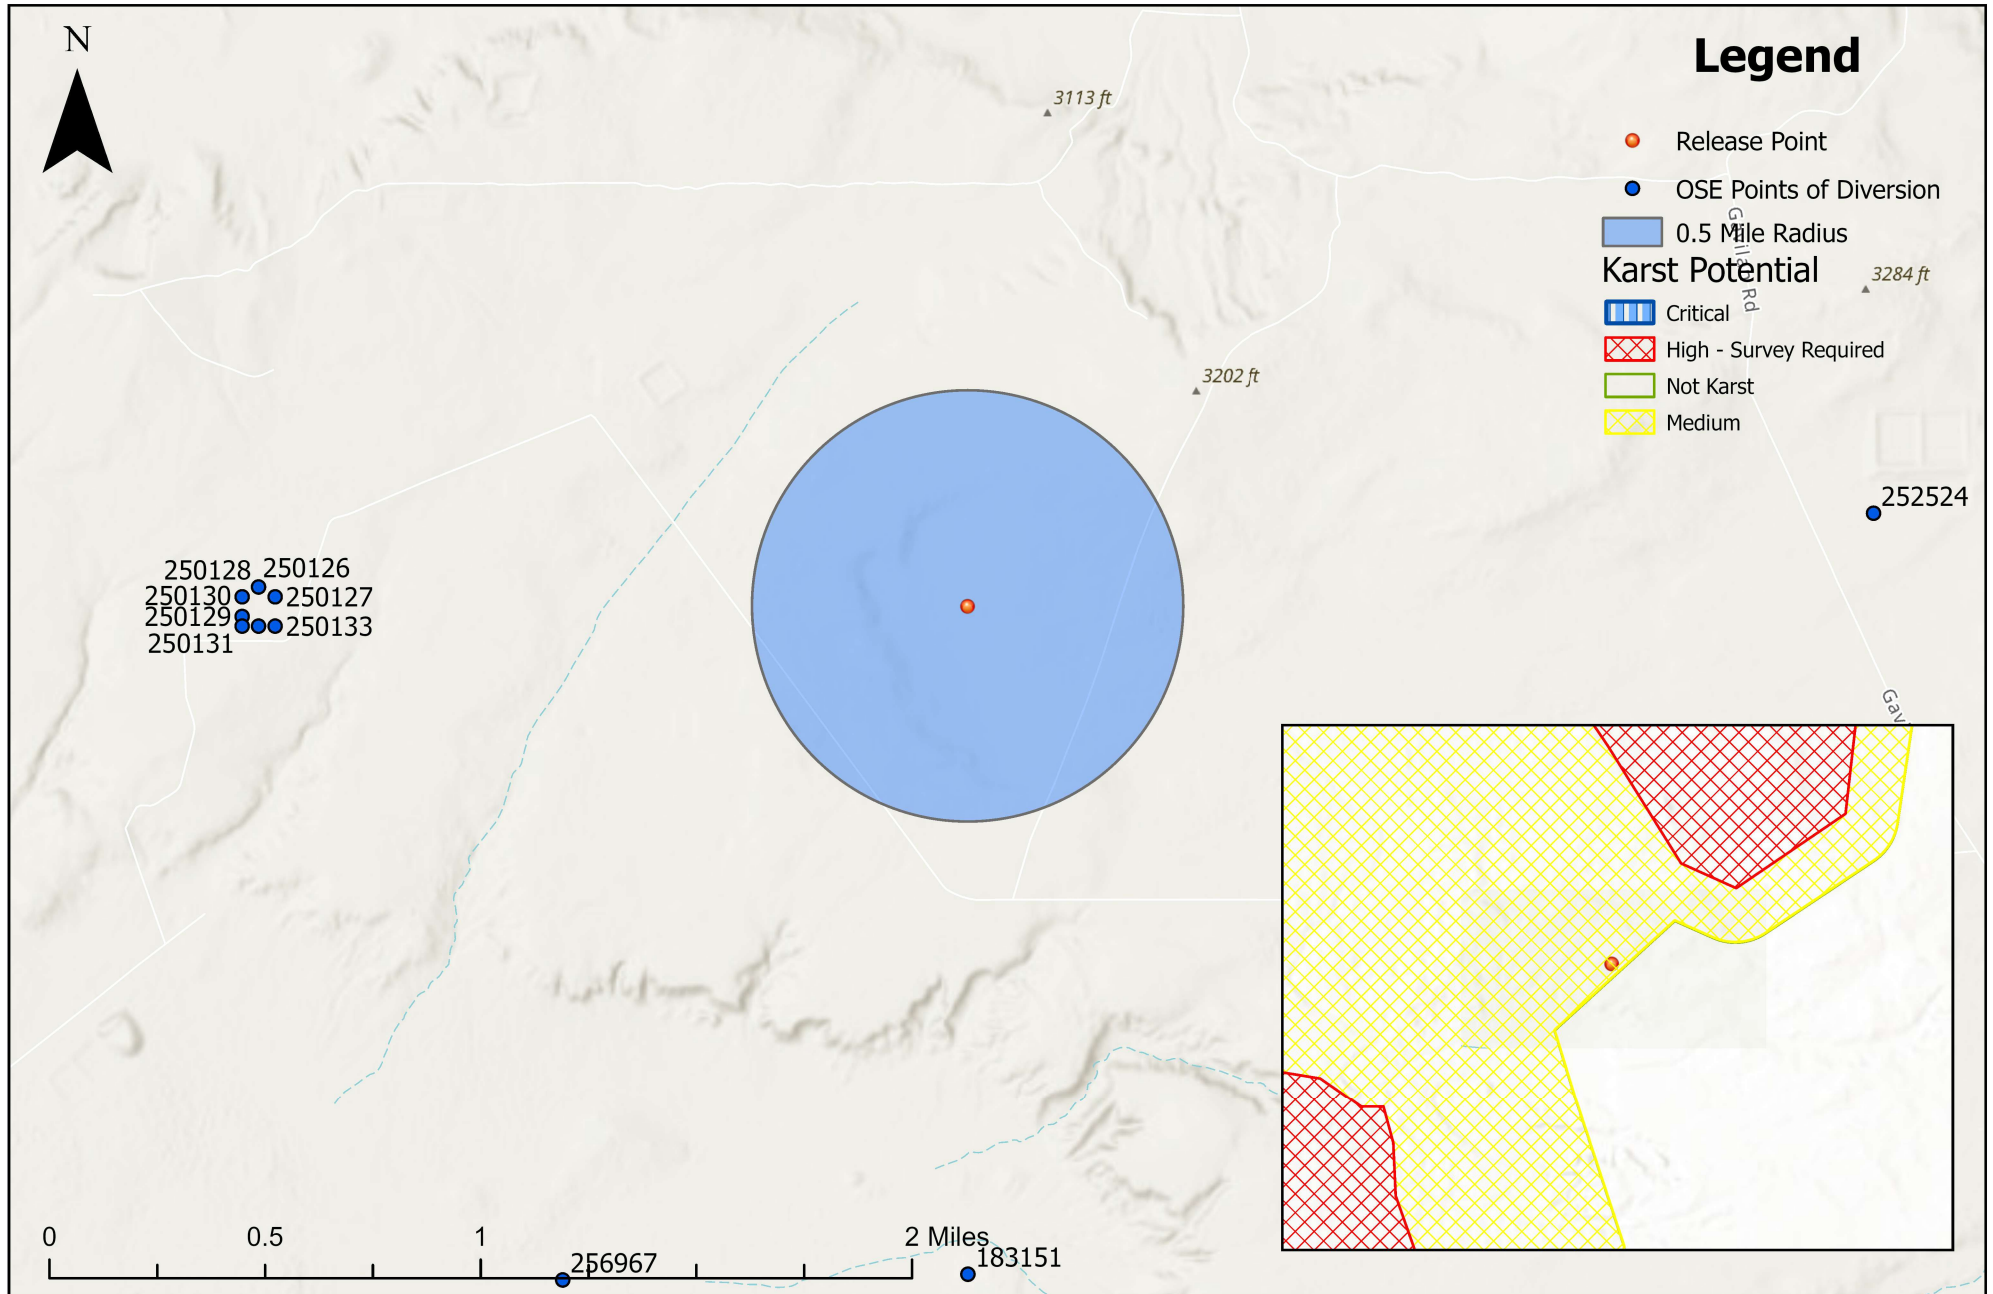


Tater Tot 2 CTB 5 - Devon Energy

Figure 2 - Aerial Site Map

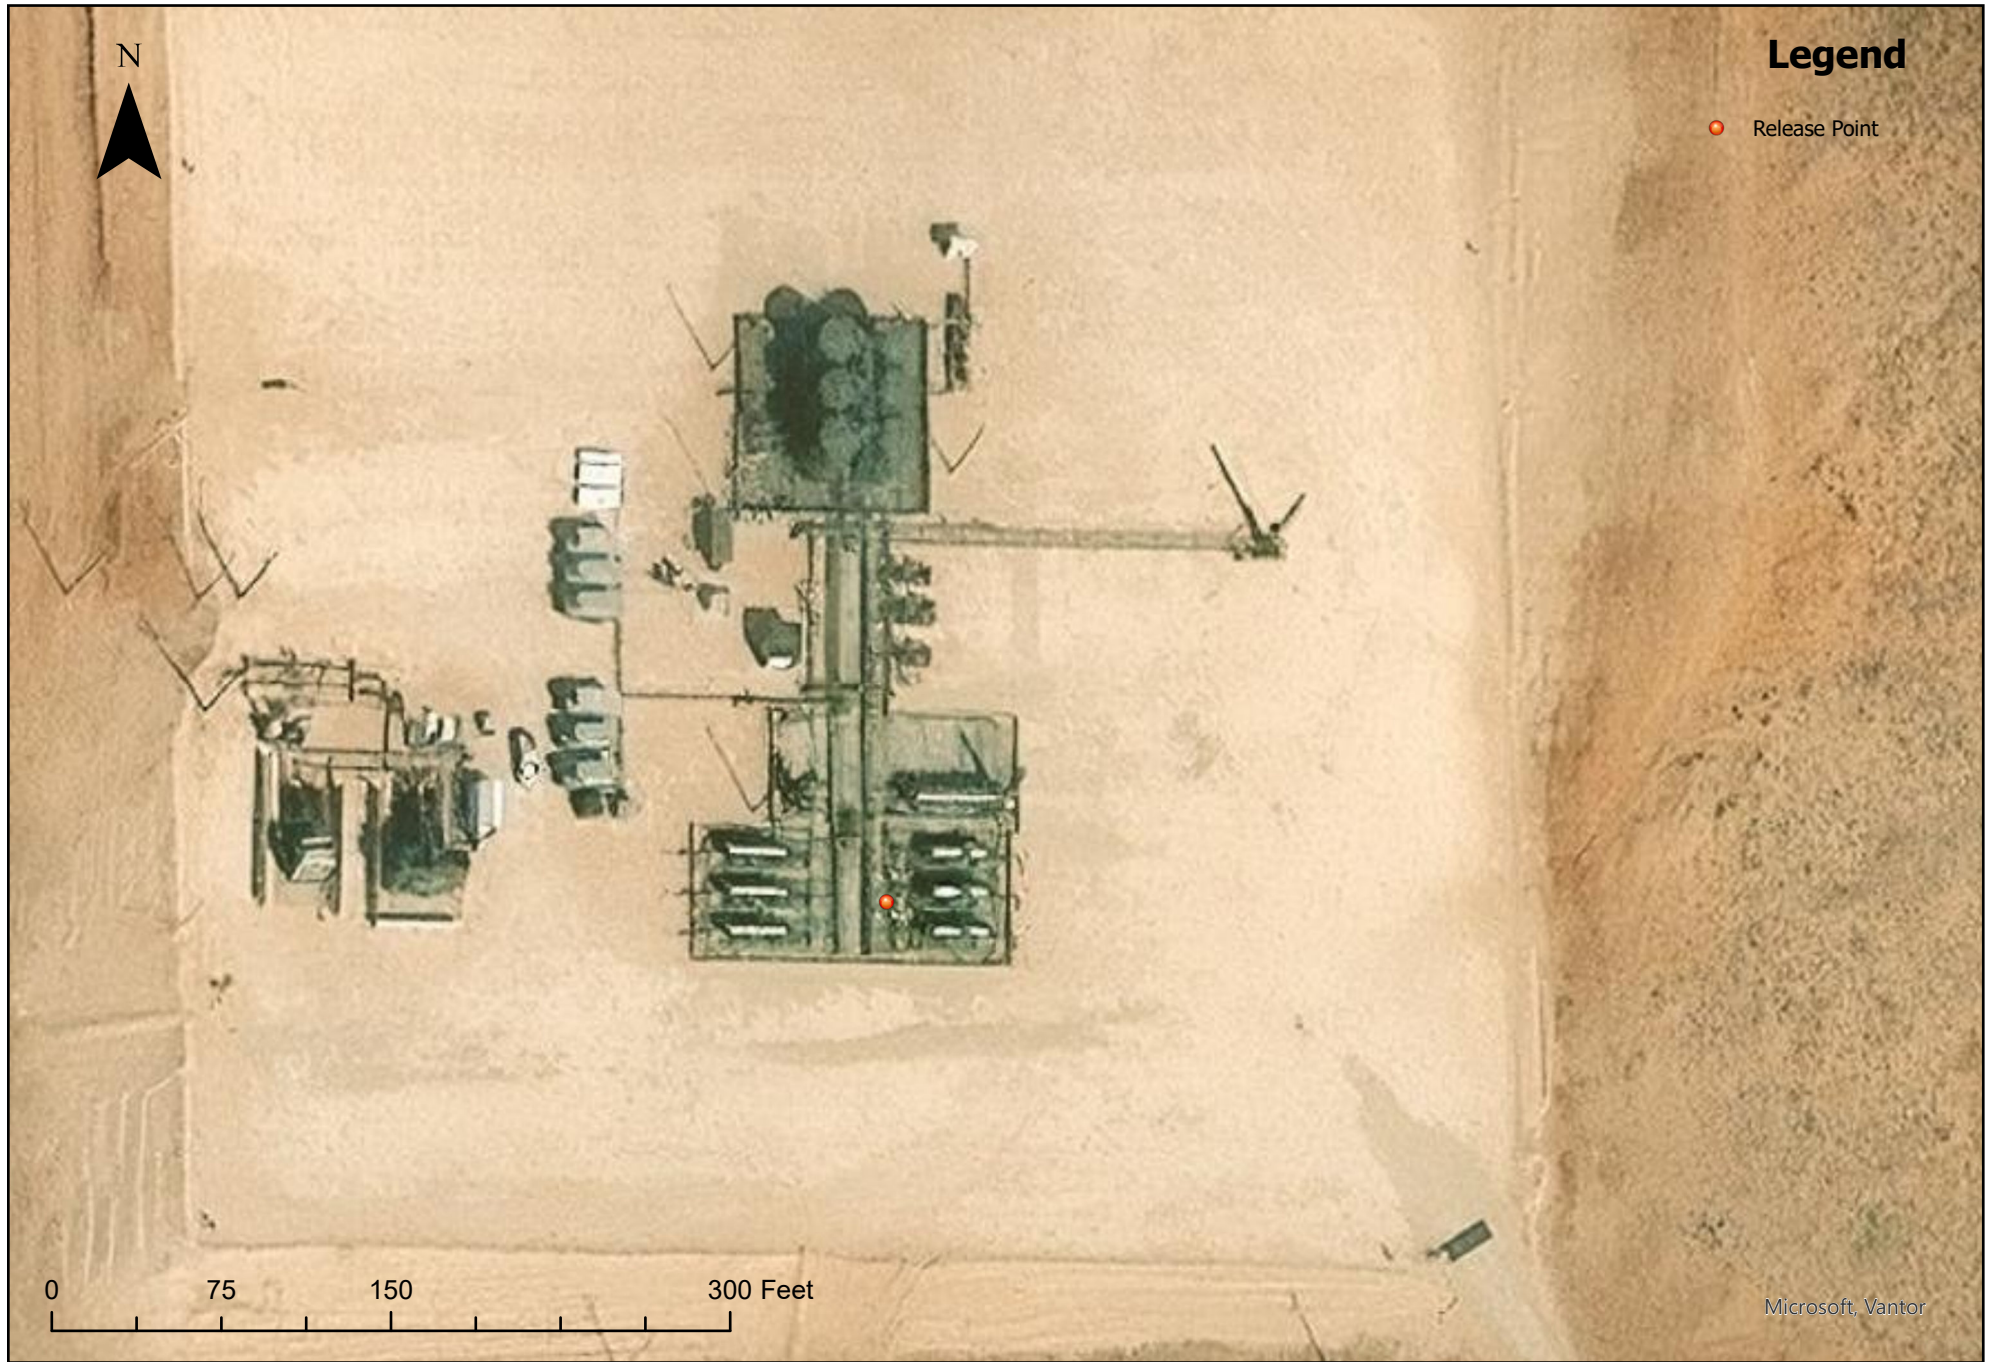

Tater Tot 2 CTB 5 - Devon Energy

Figure 3 - Release Characterization Map

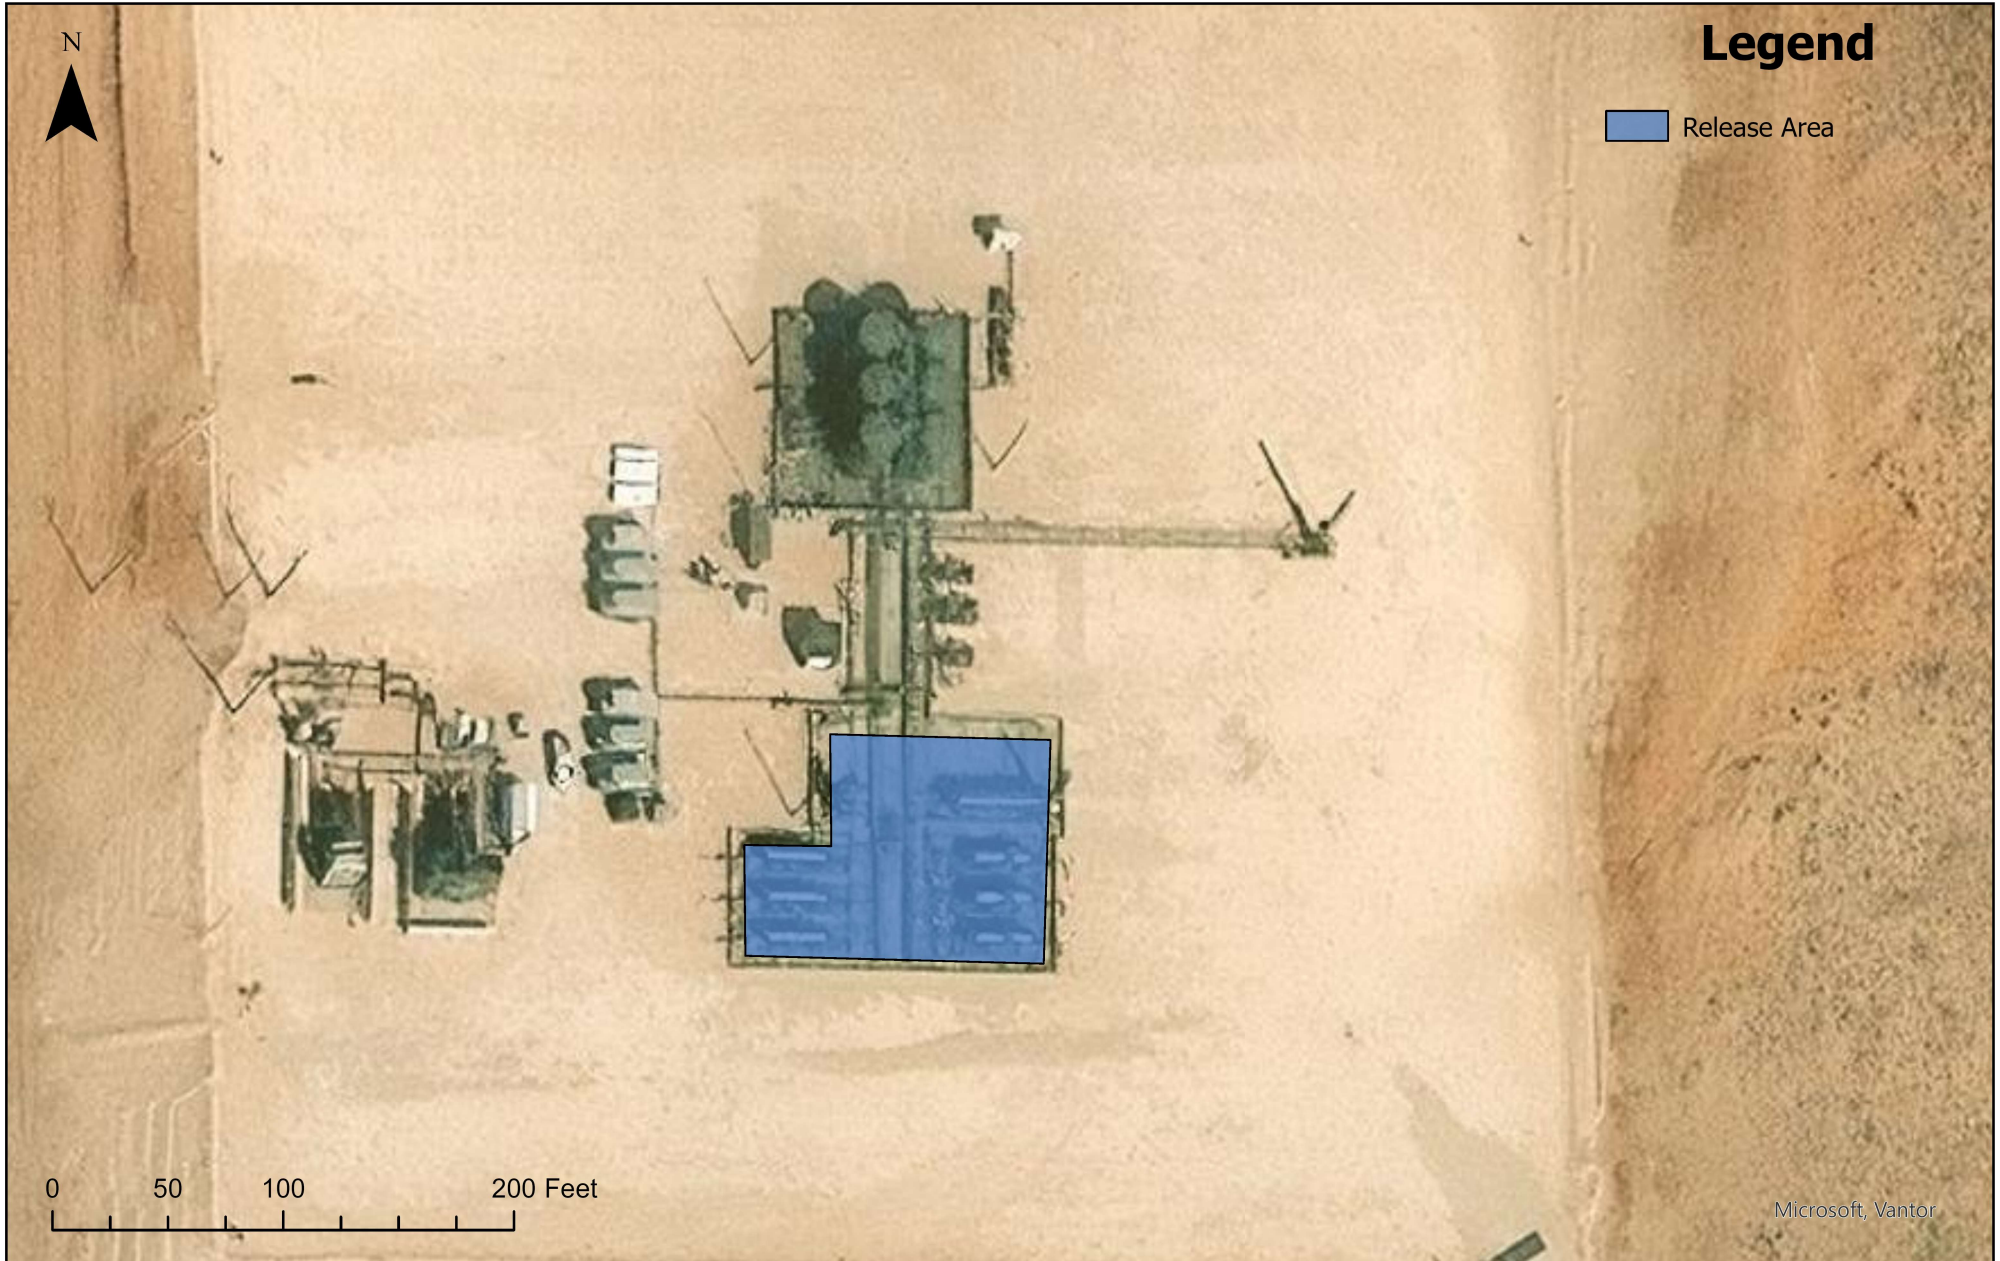



TABLE

		Source/Notes				
Depth to Groundwater (feet bgs)	< 100'	NM OSE				
Horizontal Distance from All Water Sources within 1/2 Mile (ft)	N/A					
Horizontal Distance to Nearest Significant Watercourse (ft)	2.3 Miles	Pecos River				
Closure Criteria (19.15.29.12.B(4)) and Table						
Depth to Groundwater		Closure Criteria (units in mg/kg)				
		Chloride *numerical limit or background whichever is greater	TPH	GRO + DRO	BTEX	Benzene
< 50' BGS	X	600	100		50	10
51' to 100'		10,000	2500	1000	50	10
>100'		20,000	2500	1000	50	10
Surface Water		If yes, then				
<300' from continuously flowig watercourse or other significant watercourse?	No	600	100		50	10
<200' from lakebed, sinkhoe, or playa lake?	No					
Water Well or Water Source						
<500' from spring or a private, domestic fresh water well used by less than 5 households for domestic or stock watering purposes?	No					
<1000' from fresh water well or spring?	No					
Human and Other Areas						
<300" from an occupied permanent residence, school, hospital, institution, or church?	No					
<100' from wetland?	No					
within area overlying a subsurface mine	No					
within an unstable area?	No					
within a 100-year floodplain?	No					



APPENDIX A: NMOSE WELLS REPORT

PO BOX 2286 • CARLSBAD. N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325

Water Column/Average Depth to Water











(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned, C=the file is closed)

(quarters are smallest to largest)

(NAD83 UTM in meters)

(In feet)

POD Number	Code	Sub basin	County	Q64	Q16	Q4	Sec	Tws	Range	X	Y	Map	Distance	Well Depth
C_04481_POD2		CUB	ED	NW	SW	SE	03	24S	29E	596851.5	3567748.3		2185	120
C_04481_POD8		CUB	ED	NW	SW	SE	03	24S	29E	596852.3	3567655.9		2188	125
C_04481_POD1		CUB	ED	NW	SW	SE	03	24S	29E	596798.8	3567778.6		2238	135
C_04481_POD3		CUB	ED	NE	SE	SW	03	24S	29E	596798.8	3567778.6		2238	120
C_04481_POD7		CUB	ED	NE	SE	SW	03	14S	29E	596800.0	3567655.4		2241	110
C_04481_POD5		CUB	ED	NE	SE	SW	03	24S	29E	596746.8	3567747.3		2290	120
C_04481_POD4		CUB	ED	NE	SE	SW	03	24S	29E	596747.4	3567685.7		2292	150
C_04481_POD6		CUB	ED	NE	SE	SW	03	24S	29E	596747.7	3567654.9		2293	120
C_04526_POD1		CUB	ED	SE	NW	SE	06	24S	30E	601898.6	3568060.3		2874	
C_04794_POD1		CUB	ED	NW	NW	SW	13	24S	29E	599335.6	3564889.6		2918	

Average

Minimur

Maximur



Record Count: 10

Basin/County Search:

County: ED

UTM Filters (in meters):

Easting: 599037

Northing: 3567793

Radius: 3000

* UTM location was derived from PLSS - see Help

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of the data.



APPENDIX B: PHOTOLOG & FIELD NOTES

PO BOX 2286 • CARLSBAD. N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325




PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



☉ 6°N (T) ● 32.241906°N, 103.948802°W ±6ft ▲ 3094ft



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325

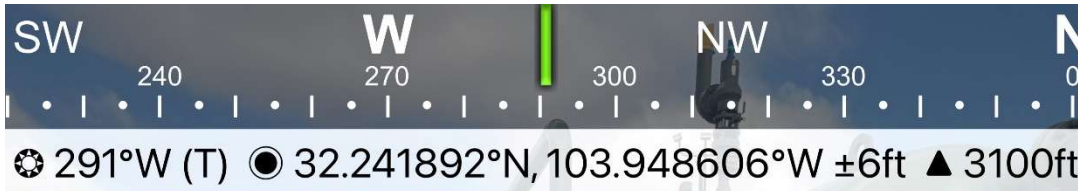

PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



📍 291°W (T) 📍 32.241894°N, 103.948607°W ±6ft ▲ 3099ft



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



☉ 277°W (T) ☉ 32.242085°N, 103.948605°W ±6ft ▲ 3104ft



11 May 2026, 09:13:11

PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



PO BOX 2286 • CARLSBAD, N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325



APPENDIX C: DIVISION CORRESPONDENCE

PO BOX 2286 • CARLSBAD. N M 88220 • OFFICE (575) 689-8324 • FAX (575) 689-8325

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 493995

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 493995
	Action Type: [NOTIFY] Notification Of Release (NOR)

QUESTIONS

Location of Release Source	
<i>Please answer all the questions in this group.</i>	
Site Name	TATER TOT 2 CTB 5
Date Release Discovered	08/09/2025
Surface Owner	State

Incident Details	
<i>Please answer all the questions in this group.</i>	
Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release	
<i>Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.</i>	
Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Corrosion Dump Line Produced Water Released: 94 BBL Recovered: 94 BBL Lost: 0 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Pinhole leak on water leg of separator, allowed produced water to leak to lined secondary containment.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 493995

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 493995
	Action Type: [NOTIFY] Notification Of Release (NOR)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.
<i>With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.</i>	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph 4 of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see 19.15.29.11(A)(5)(a) NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

ACKNOWLEDGMENTS

Action 493995

ACKNOWLEDGMENTS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 493995
	Action Type: [NOTIFY] Notification Of Release (NOR)

ACKNOWLEDGMENTS

<input checked="" type="checkbox"/>	I acknowledge that I am authorized to submit notification of a release on behalf of my operator.
<input checked="" type="checkbox"/>	I acknowledge that upon submitting this application, I will be creating a new incident file (assigned to my operator) to track the notification(s) and corrective action(s) for a release, pursuant to NMAC 19.15.29.
<input checked="" type="checkbox"/>	I acknowledge that creating a new incident file will require my operator to file subsequent submission(s) of form "C-141, Application for administrative approval of a release notification and corrective action", pursuant to NMAC 19.15.29.
<input checked="" type="checkbox"/>	I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment.
<input checked="" type="checkbox"/>	I acknowledge the fact that the acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment.
<input checked="" type="checkbox"/>	I acknowledge the fact that, in addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 493995

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 493995
	Action Type: [NOTIFY] Notification Of Release (NOR)

CONDITIONS

Created By	Condition	Condition Date
jralej	When submitting future reports regarding this release, please submit the calculations used or specific justification for the volumes reported on the initial C-141.	8/9/2025

Spill Volume Calculations

Free Standing Fluid Volume

How do you want to enter area?	Total area from app
Area from app (ft ²)	12657.79
Depth of fluid	0.50 in
Number of Tanks in Fluid Affected Area (if any):	0
Tank Diameter (if needed):	0.0 ft
Volume of Standing Fluid	93.94 bbl

Contaminated Soil Calculations

How do you want to enter area?	Total area from app
Area from app (ft ²)	0.00
Depth of impacted soil	0.75 in
Soil Type	Caliche
Spilled Material	Produced Water
Soil Saturation	Very Wet - Free liquid in soil
Volume of Spill In Soil	0.00 bbls
Total Spill Volume	93.94 bbls

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 495466

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 495466
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2522178846
Incident Name	NAPP2522178846 TATER TOT 2 CTB 5 @ 0
Incident Type	Produced Water Release
Incident Status	Initial C-141 Received
Incident Facility	[fAPP2416935669] TATER TOT 2 CTB 5

Location of Release Source

Please answer all the questions in this group.

Site Name	TATER TOT 2 CTB 5
Date Release Discovered	08/09/2025
Surface Owner	State

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Corrosion Dump Line Produced Water Released: 94 BBL Recovered: 94 BBL Lost: 0 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Pinhole leak on water leg of separator, allowed produced water to leak to lined secondary containment.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS, Page 2

Action 495466

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 495466
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.
<i>With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.</i>	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	<i>Not answered.</i>

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dvn.com Date: 08/13/2025
--	--

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS, Page 3

Action 495466

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 495466
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

QUESTIONS

Site Characterization

Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Not answered.
What method was used to determine the depth to ground water	Not answered.
Did this release impact groundwater or surface water	Not answered.
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Not answered.
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Not answered.
An occupied permanent residence, school, hospital, institution, or church	Not answered.
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Not answered.
Any other fresh water well or spring	Not answered.
Incorporated municipal boundaries or a defined municipal fresh water well field	Not answered.
A wetland	Not answered.
A subsurface mine	Not answered.
An (non-karst) unstable area	Not answered.
Categorize the risk of this well / site being in a karst geology	Not answered.
A 100-year floodplain	Not answered.
Did the release impact areas not on an exploration, development, production, or storage site	Not answered.

Remediation Plan

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

Requesting a remediation plan approval with this submission	No
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 495466

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 495466
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

CONDITIONS

Created By	Condition	Condition Date
scott.rodgers	None	8/13/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 512765

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 512765
	Action Type: [NOTIFY] Notification Of Liner Inspection (C-141L)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2522178846
Incident Name	NAPP2522178846 TATER TOT 2 CTB 5 @ 0
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2416935669] TATER TOT 2 CTB 5

Location of Release Source	
Site Name	TATER TOT 2 CTB 5
Date Release Discovered	08/09/2025
Surface Owner	State

Liner Inspection Event Information	
<i>Please answer all the questions in this group.</i>	
What is the liner inspection surface area in square feet	10,150
Have all the impacted materials been removed from the liner	Yes
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	10/09/2025
Time liner inspection will commence	09:00 AM
Please provide any information necessary for observers to liner inspection	Lupe Carrasco (575) 725-0787
Please provide any information necessary for navigation to liner inspection site	32.2424417,-103.9487362

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 512765

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 512765
	Action Type: [NOTIFY] Notification Of Liner Inspection (C-141L)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of liner inspections including any changes in date/time per the requirements of 19.15.29.11.A(5)(a)(ii) NMAC, may result in the inspection not being accepted.	10/7/2025

From: <Lupe@bdsoilfield.com>
Sent on: Thursday, November 6, 2025 10:04:36 PM
To: ocd.environ@emnrd.nm.gov
CC: Raley, Jim <jim.ralej@dvn.com>
Subject: Tator Tot 2 CTB 5 (nAPP2522178846) Extension Request

On behalf of Devon Energy, we are requesting a 90 day extension for the following incident:

Tator Tot 2 CTB 5
NAPP2522178846
P-02-24S-29E
32.2424417,-103.9487362

The 90 day extension would allow Devon Energy the time to clean the liner and make a liner notification to include another incident that occurred on the same location. The previous liner inspection requested for 10/9/25 was not taken into consideration due to several storms during the notification and throughout the month of October. The initial incident occurred within the secondary containment and will not cause any harm to public health or the environment. We will notify the division with a time and date for the next proposed liner inspection.



Please let me know if you have any questions or concerns.

Lupe Carrasco
(575) 725-0787





Melodie Sanjari <msanjari15@gmail.com>

FW: [EXTERNAL] FW: (Liner Inspection Notification) Devon Energy-Tater Tot 2 CTB 5 (FAPP2416935669 /nAPP2522178846)- 8/09/2025

BDS Lupe Carrasco <lupe@bdsoilfield.com>
To: "NMSLO Environmental Compliance Office (ECO)" <eco@nmslo.gov>
Cc: "Raley, Jim" <jim.rale@dn.com>, msanjari15 <msanjari15@gmail.com>

Wed, May 6, 2026 at 3:14 PM

SLO,

Please see below for the sampling notification submitted to NMOCD.

Thanks!

Lupe Carrasco
(575) 725-0787



From: Raley, Jim <Jim.Raley@dvn.com>
Sent: Wednesday, May 6, 2026 6:55 AM
To: BDS Lupe Carrasco <lupe@bdsoilfield.com>
Subject: RE: [EXTERNAL] FW: (Liner Inspection Notification) Devon Energy-Tater Tot 2 CTB 5 (FAPP2416935669 /nAPP2522178846)- 8/09/2025

Submitted 5/6

Jim Raley | Environmental Professional - Permian Basin

5315 Buena Vista Dr., Carlsbad, NM 88220

C: (575)689-7597 | jim.ralej@dvn.com



From: BDS Lupe Carrasco <lupe@bdsoilfield.com>
Sent: Wednesday, May 6, 2026 6:50 AM
To: Raley, Jim <Jim.Raley@dvn.com>
Subject: [EXTERNAL] FW: (Liner Inspection Notification) Devon Energy-Tater Tot 2 CTB 5 (FAPP2416935669 /nAPP2522178846)- 8/09/2025

Jim,

Would you submit a Liner Inspection Notification for Monday 5/11/26, at 9 am? Redline is scheduled to clean the liner on 5/7/26. I'll submit to SLO later today. Please let me know if you have any questions or if you need to submit for a different date.

Liner Inspection Notification	
Site Name	Tater Tot 2 CTB 5
NMOCD Incident #	nAPP2522178846
What is the liner inspection surface area in square feet	10,150
Have all the impacted materials been removed from the liner	Scheduled for 5/7/26
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	5/11/26
Time liner inspection will commence	9:00 am MST
Please provide any information necessary for observers to liner inspection	
Please provide any information necessary for navigation to liner inspection site	32.2424417,-103.9487362

Thanks!

Lupe Carrasco

(575) 725-0787



Confidentiality Warning: This message and any attachments are intended only for the use of the intended recipient(s), are confidential, and may be privileged. If you are not the intended recipient, you are hereby notified that any review, retransmission, conversion to hard copy, copying, circulation or other use of all or any portion of this message and any attachments is strictly prohibited. If you are not the intended recipient, please notify the sender immediately by return e-mail, and delete this message and any attachments from your system.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 591271

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 591271
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2522178846
Incident Name	NAPP2522178846 TATER TOT 2 CTB 5 @ FAPP2416935669
Incident Type	Produced Water Release
Incident Status	Remediation Closure Report Received
Incident Facility	[fAPP2416935669] TATER TOT 2 CTB 5

Location of Release Source

Please answer all the questions in this group.

Site Name	TATER TOT 2 CTB 5
Date Release Discovered	08/09/2025
Surface Owner	State

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Corrosion Dump Line Produced Water Released: 94 BBL Recovered: 94 BBL Lost: 0 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Pinhole leak on water leg of separator, allowed produced water to leak to lined secondary containment.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 591271

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 591271
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.
<i>With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.</i>	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dvn.com Date: 06/03/2026
--	--

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 591271

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 591271
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Site Characterization

Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Greater than 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Greater than 5 (mi.)
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Greater than 5 (mi.)
Any other fresh water well or spring	Greater than 5 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Greater than 5 (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Greater than 5 (mi.)
Categorize the risk of this well / site being in a karst geology	None
A 100-year floodplain	Greater than 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

Remediation Plan

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	Yes
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
On what estimated date will the remediation commence	10/30/2026
On what date will (or did) the final sampling or liner inspection occur	05/11/2026
On what date will (or was) the remediation complete(d)	05/11/2026
What is the estimated surface area (in square feet) that will be remediated	10150
What is the estimated volume (in cubic yards) that will be remediated	0

These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed. The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 591271

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 591271
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Remediation Plan (continued)	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
<i>(Select all answers below that apply.)</i>	
Is (or was) there affected material present needing to be removed	No
Is (or was) there a power wash of the lined containment area (to be) performed	Yes
OTHER (Non-listed remedial process)	Not answered.
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dvnm.com Date: 06/03/2026
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 591271

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 591271
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Liner Inspection Information	
Last liner inspection notification (C-141L) recorded	582271
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	05/11/2026
Was all the impacted materials removed from the liner	Yes
What was the liner inspection surface area in square feet	10150

Remediation Closure Request	
<i>Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.</i>	
Requesting a remediation closure approval with this submission	Yes
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	Yes
What was the total surface area (in square feet) remediated	10150
What was the total volume (cubic yards) remediated	0
Summarize any additional remediation activities not included by answers (above)	Liner Inspected

The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (in .pdf format) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dmv.com Date: 06/03/2026
--	--

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 591271

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 591271
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

CONDITIONS

Created By	Condition	Condition Date
scott.rodgers	Liner Inspection Report is approved	6/30/2026