

Well Name: OXY 4 FED COM	Well Location: T20S / R28E / SEC 4 / SENW /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMNM83580	Unit or CA Name: OXY 4 FEDERAL COM	Unit or CA Number: NMNM94510
US Well Number: 3001528986	Well Status: Inactive	Operator: OXY USA WTP LP

Notice of Intent

Type of Submission: Notice of Intent

Type of Action: Casing

Date Sundry Submitted: 03/12/2021

Time Sundry Submitted: 08:42

Date proposed operation will begin: 03/14/2021

Procedure Description: Upon rigging up on this well for routine acidizing, casing damage was discovered ~4320'. Below shows the steps already taken, as well as Oxy's proposed casing repair plan. Attached for reference are the current and proposed WBDs, as well as a screenshot of casing damage log. 1) Use a Gauge ring to tag fluid level while tubing is in the hole (complete 2/22/2021) 2) Pull tubing and run gauge ring on full wellbore to determine size of max restriction (complete 3/1/2021) 3) Run camera to get a visual on the nature of the restriction, i.e. is it cement, collapse, parted, etc. (complete 3/4/2021) 4) Run caliper log to determine the extent of milling required to get wellbore back to a uniform ID and verify no other damage exists (complete 3/5/2021) 5) Begin milling operation to remove bulge in 7-15 ft estimated bulge in casing and make it a uniform ID (tentatively scheduled for 3/17) 6) Run gauge ring to verify successful milling operation 7) Run in with Weatherford metalskin casing patch from ~4240 – 4390' and verify patch tests good (tentatively scheduled for 3/19)

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Casing_Damage_Screenshot_20210312084159.pdf

Current_and_Proposed_WBDs_20210312084159.pdf

Well Name: OXY 4 FED COM

Well Location: T20S / R28E / SEC 4 / SENW /

County or Parish/State: EDDY / NM

Well Number: 1

Type of Well: CONVENTIONAL GAS WELL

Allottee or Tribe Name:

Lease Number: NMNM83580

Unit or CA Name: OXY 4 FEDERAL COM

Unit or CA Number: NMNM94510

US Well Number: 3001528986

Well Status: Inactive

Operator: OXY USA WTP LP

Conditions of Approval

Specialist Review

Oxy_4_Federal_Com_1_3001528986_20210312130505.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: EMILY MESSER

Signed on: MAR 12, 2021 08:42 AM

Name: OXY USA WTP LP

Title: REGULATORY LEAD

Street Address: 5 Greenway Plaza, Suite 110

City: Houston

State: TX

Phone: (713) 497-2076

Email address: emily_messer@oxy.com

Field Representative

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: NDUNGU KAMAU

BLM POC Title: Petroleum Engineering Technician


BLM POC Phone: 5752345938

BLM POC Email Address: nkamau@blm.gov

Disposition: Approved

Disposition Date: 03/12/2021

Signature: N. Mandela Kamau

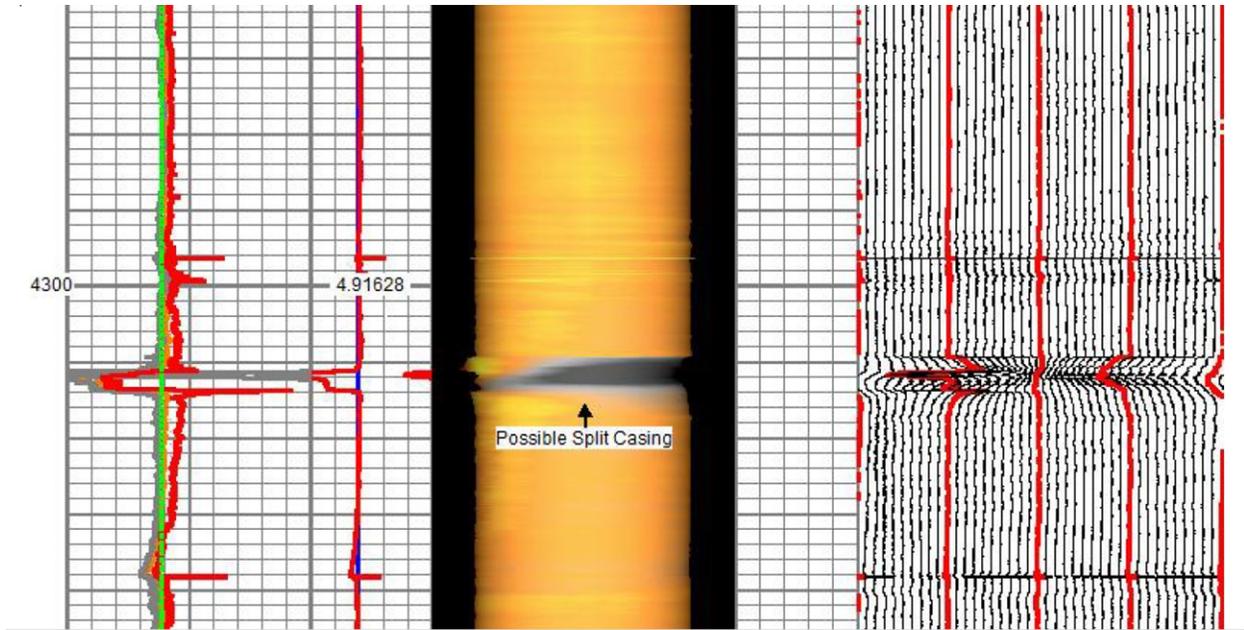

CONDITIONS OF APPROVAL

Sundry dated 03/12/2021


Repair leak

OPERATOR'S NAME:	OXY USA INC
LEASE NO.:	NMNM83580
WELL NAME & NO.:	Oxy 4 Federal Com 1
SURFACE HOLE FOOTAGE:	1980' FNL & 2130' FWL
BOTTOM HOLE FOOTAGE:	
LOCATION:	Section 4, T.20 S., R.28 E., NMPM
COUNTY:	Eddy County, New Mexico

1. Surface disturbance beyond the existing pad shall have prior approval.
2. Functional H₂S monitoring equipment shall be on location.
3. All waste (i.e. trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.
4. Notify BLM 575-200-8901, if there is no response, 575-361-2822 as work begins and provide sufficient time to allow BLM to witness casing integrity test after repairing leak at DV tool. If no answers leave a voice mail or email with the API#, workover purpose, and a call back phone number. Note the contact, time, & date in your subsequent report.
5. **Operator's procedure Step 7: perform a BLM PET witnessed (charted) casing integrity test. Pressure leakoff may require remediation prior to continuing the frac. Include a copy of the chart in the subsequent sundry for this work.**
6. **Operator shall be required to run CBL/VDL/Ultrasonic Bond Log from lowest attainable depth to surface (this CBL shall be ran after the casing repair). Provide BLM with an electronic copy (Adobe Acrobat Document) of CBL.**
7. All other types of pressure testing of casing shall be chart recorded for 30 minutes and submit a copy of the chart in the subsequent sundry for this work.

Work to be completed within 90 days
NMK03122021

OXY USA WTP LP - Current
OXY 4 Federal Com #001
API No. 30-015-28986

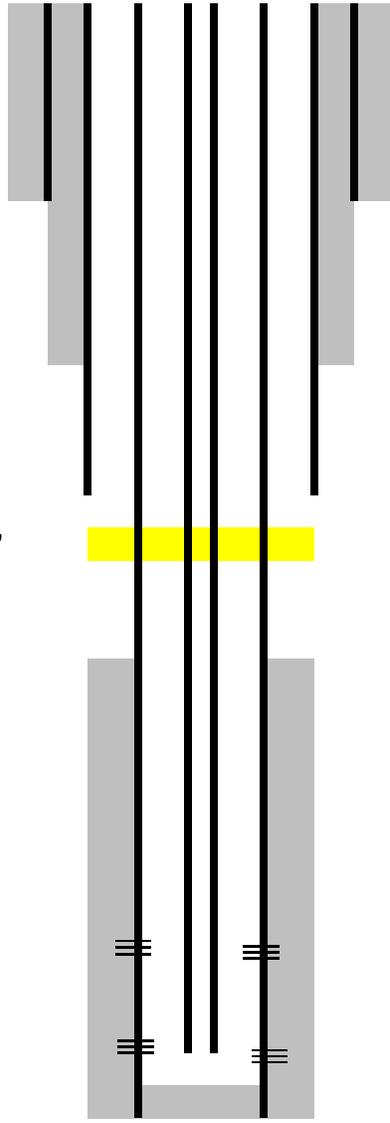

Spud 08/07/1996

17-1/2" hole @ 418'
13-3/8" 48# csg @ 418'
w/ 490 sx-TOC-Surf-Circ.

11" hole @ 3402'
8-5/8" 24# csg @3402'
w/ 1600 sx-TOC-Surf-Circ.

Casing Damage ~ @4320'

7-7/8" hole @ 11251'
5-1/2" 17# csg @ 11251'
w/ 450 sx-TOC-~8420' - CBL


2-3/8" tbg @ 10752'

WC Perfs 8908' - 9302'
Morrow Perfs 10848' - 10980'

PBTD - 11158'

TD - 11251'

OXY USA WTP LP - Proposed
OXY 4 Federal Com #001
API No. 30-015-28986

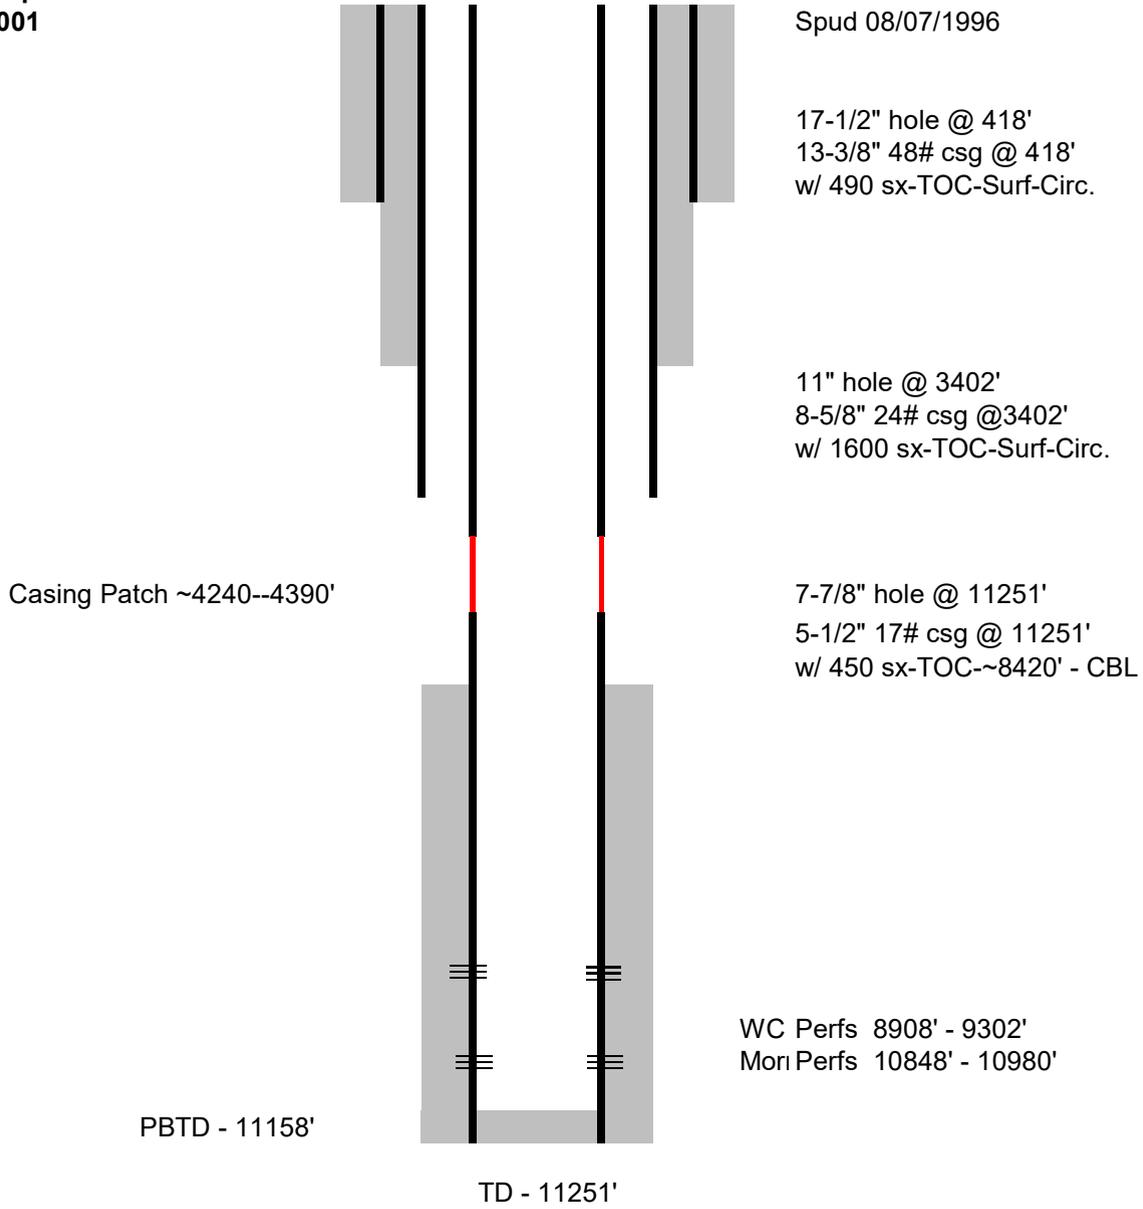

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720

District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

COMMENTS

Action 36456

COMMENTS

Operator: OXY USA WTP LIMITED PARTNERSHIP P.O. Box 4294 Houston, TX 772104294	OGRID: 192463
	Action Number: 36456
	Action Type: [C-103] NOI Workover (C-103G)

COMMENTS

Created By	Comment	Comment Date
jagarcia	Accepted for Record	8/4/2021

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720

District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS
 Action 36456

CONDITIONS

Operator: OXY USA WTP LIMITED PARTNERSHIP P.O. Box 4294 Houston, TX 772104294	OGRID: 192463
	Action Number: 36456
	Action Type: [C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
jagarcia	None	8/4/2021