
Received by Opp Po 2/4/2021 12:18:4	State of New Me	exico	Form C-103		
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Natu	ral Resources _	Revised July 18, 2013		
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.		
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION		30-045-27340		
<u>District III</u> – (505) 334-6178	1220 South St. Fran	ncis Dr.	<ol> <li>Indicate Type of Lease</li> <li>STATE</li></ol>		
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM 87	7505	6. State Oil & Gas Lease No.		
1220 S. St. Francis Dr., Santa Fe, NM	,		o. State on & Gas Lease 110.		
87505 SUNDRY NO	TICES AND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name		
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			7. Lease Ivalie of Oliving regiment Ivalie		
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			NEBU Pump Mesa SWD		
1. Type of Well: Oil Well	Gas Well 🛛 Other		8. Well Number		
2. Name of Operator			9. OGRID Number		
SIMCOE LLC			329736		
3. Address of Operator			10. Pool name or Wildcat		
1199 Main Ave., Suite 101					
Durango, CO 81301			Morrison Bluff Entrada		
4. Well Location		1 1600 0 . 0	4 77 - 1		
	990 _feet from the _South line ar				
Section 36			IPM San Juan County		
	11. Elevation (Show whether DR, 643)				
	043	0			
12. Check	Appropriate Box to Indicate N	ature of Notice. R	eport or Other Data		
	11 1		•		
NOTICE OF I	NTENTION TO:	SUBS	EQUENT REPORT OF:		
PERFORM REMEDIAL WORK	] PLUG AND ABANDON ☐	REMEDIAL WORK	$oxed{oxed}$ ALTERING CASING $oxed{oxed}$		
TEMPORARILY ABANDON	<del>-</del>	COMMENCE DRILL	LING OPNS. P AND A		
PULL OR ALTER CASING		CASING/CEMENT	JOB		
DOWNHOLE COMMINGLE					
CLOSED-LOOP SYSTEM  OTHER:	J	OTHER:	П		
	pleted operations. (Clearly state all p		give pertinent dates, including estimated date		
		C. For Multiple Comp	pletions: Attach wellbore diagram of		
proposed completion or re	ecompletion.				
CIMCOF II C (PR			attace and a bata		
SIMCOE LLC (BP as contractor of	pperator) restored integrity to the	referenced well pe	er the procedure below:		
1 Rig up service unit on 6	/18/2020				
<u> </u>		upper packer at 90	020') with 13 holes sized at .40" and		
9		• • •	ulus until well showed no pressure or		
flow.	it fidia, 12.5 ppg, to surface on be	oth tubing and annit	ards diffil well showed no pressure of		
	cker (Baker Hornet) at 8032'.				
	ng on top of the lower packer.				
	- ,	14' nacker remains	in the well		
<ul> <li>Unable to remove the lower packer (Baker Lok Set) T 8114', packer remains in the well.</li> <li>Set a new permanent packer at 8050'.</li> </ul>					
7 Circulated out kill weigh					
		al assembly, tie/sea	al into new permanent packer at 8050'.		
•	witnessed MIT to 500 psi on the c		us on 8/4/2020 (attached).		
11 Rigged down service ur		3 3 3	, , , ,		
	he MIT from NMOCD on 8/4/2020	0.			
	med on all three injection pumps of		ted satisfactorily.		
14 Returned well to dispos	• • •		,		


of 5

Attached is the successful MIT chart and current wellbore diagram.

Spud Date:	06/07/1990	Rig Release Date:				
<del></del>						
I hereby certify that the information above is true and complete to the best of my knowledge and belief.						
SIGNATURE	Patti Campbell	TITLE Regulatory AnalystDATE9/1/2020				
Type or print	namePatti Campbell	E-mail address: _patti.campbell@bpx.com PHONE:970-712-5997				
For State Use						
APPROVED	BY: Monica Kushling	TITLE Deputy Oil and Gas Inspector DATE 1/24/2022				

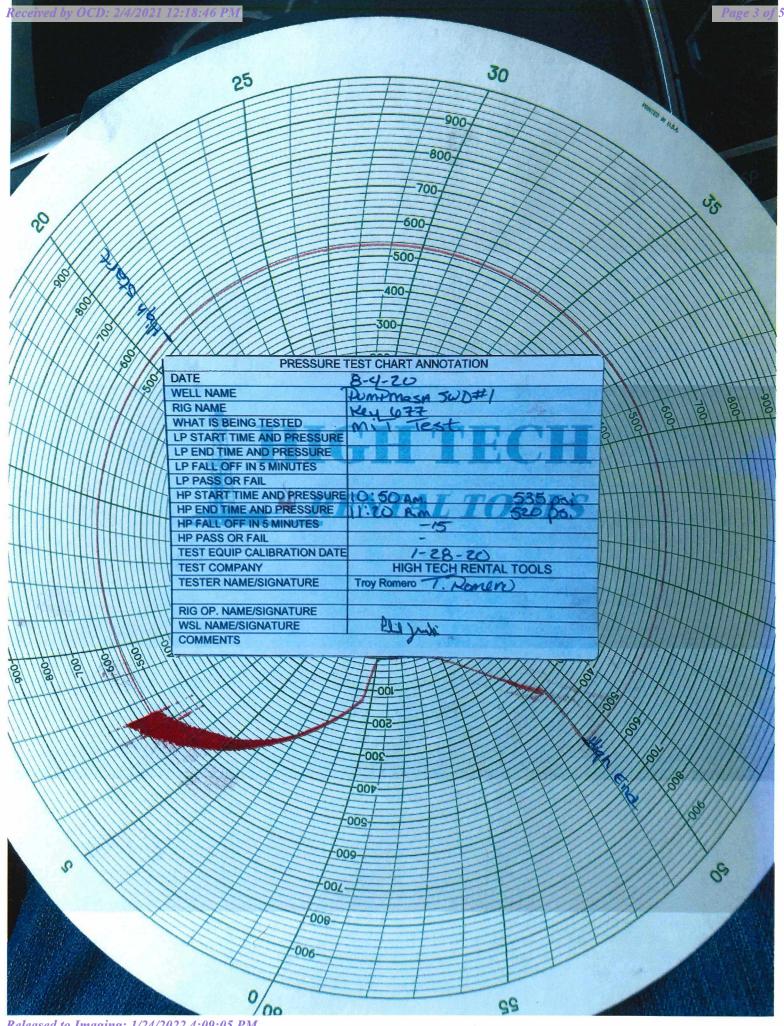

Released to Imaging: 1/24/2022 4:09:05 PM

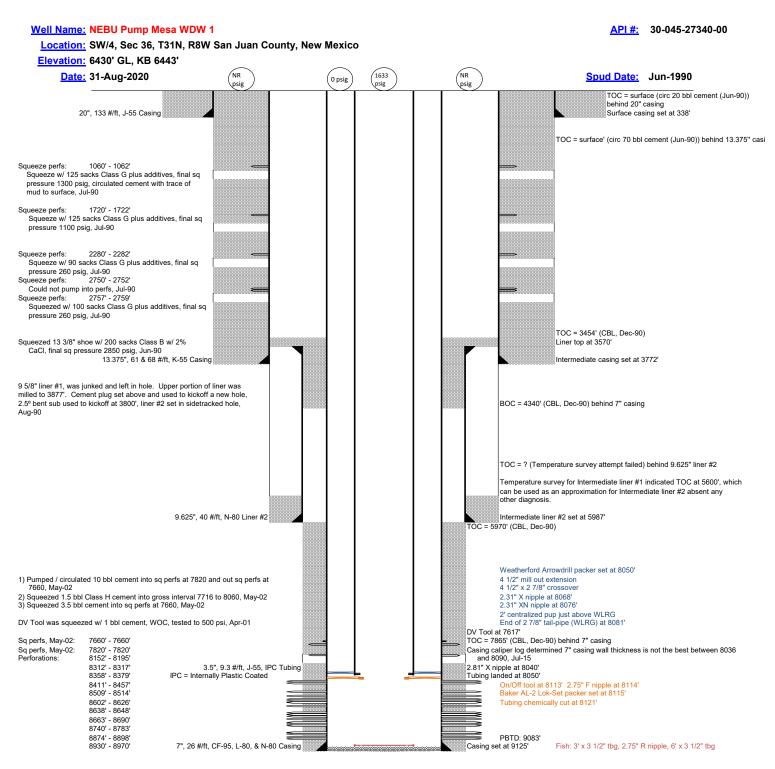

TD = 9130

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 16967

## **CONDITIONS**

Operator:	OGRID:
SIMCOE LLC	329736
1199 Main Ave., Suite 101	Action Number:
Durango, CO 81301	16967
	Action Type:
	[C-103] Sub. Workover (C-103R)

## CONDITIONS

Created By	Condition	Condition Date
mkuehling	Warning - Calibration was overdue by 6 days - by rule calibration is be performed on chart recorders every 6 months. Will reject future tests if calibration is off.	1/24/2022