

Submit Copy To Appropriate District
Office
District I – (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II – (575) 748-1283
811 S. First St., Artesia, NM 88210
District III – (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV – (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-20738
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Ryan
8. Well Number 001
9. OGRID Number 372043
10. Pool name or Wildcat Carlsbad; Morrow, South (Gas)
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3176 GR

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator TAP ROCK OPERATING, LLC	
3. Address of Operator 523 PARK POINT DR, SUITE 200, GOLDEN, CO 80401	
4. Well Location Unit Letter <u>D</u> : <u>600</u> feet from the <u>North</u> line and <u>990</u> feet from the <u>West</u> line Section <u>5</u> Township <u>23S</u> Range <u>27E</u> NMPM County <u>Eddy</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3176 GR	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
CLOSED-LOOP SYSTEM ☐			
OTHER: ☐		OTHER: Temporarily Abandon ☒	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Tap Rock performed the TA procedure approved 7/15/2022. See attached post-job TA procedure, MIT test, and WBD.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Regulatory Analyst DATE 10/10/2022

Type or print name Jeff Trlica E-mail address: jtrlica@taprk.com PHONE: 720-772-5910

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____
Conditions of Approval (if any): _____


Tap Rock Operating, LLC

Ryan #001

30-015-20738

Post-Job TA Summary

MIRU on Ryan Com #1. Bled the well down. POOH 352 joints of 2-3/8" tubing. Rig up WL unit and RIH with GR/JB to 11,787' with no issues. Ran in hole with CIBP and set at 11,713' MD. Attempted to pressure test casing to no success. Discussed plan forward with Dave Averado of NMOCD and proceeded forward as follows. RIH with cement dump bail and spot cement on top of CIBP. WOC. RIH with tubing and tagged cement at 11,640' MD, notified Dan Smolick of NMOCD. RIH with second CIBP and set at 11,521' MD. RIH with cement dump bail and spot cement on top of CIBP. WOC. Tag cement at 11,435' MD. Notified Dan Smolick of NMOCD. RIH with third CIBP and set at 10,434' MD. RIH with tubing and spot cement plug on top. WOC. Tag cement at 10,280' MD. Notified Dan Smolick of NMOCD. Performed 500 psi MIT for 30 mins with Dan Smolick of NMOCD present on location. Good test. RDMO.

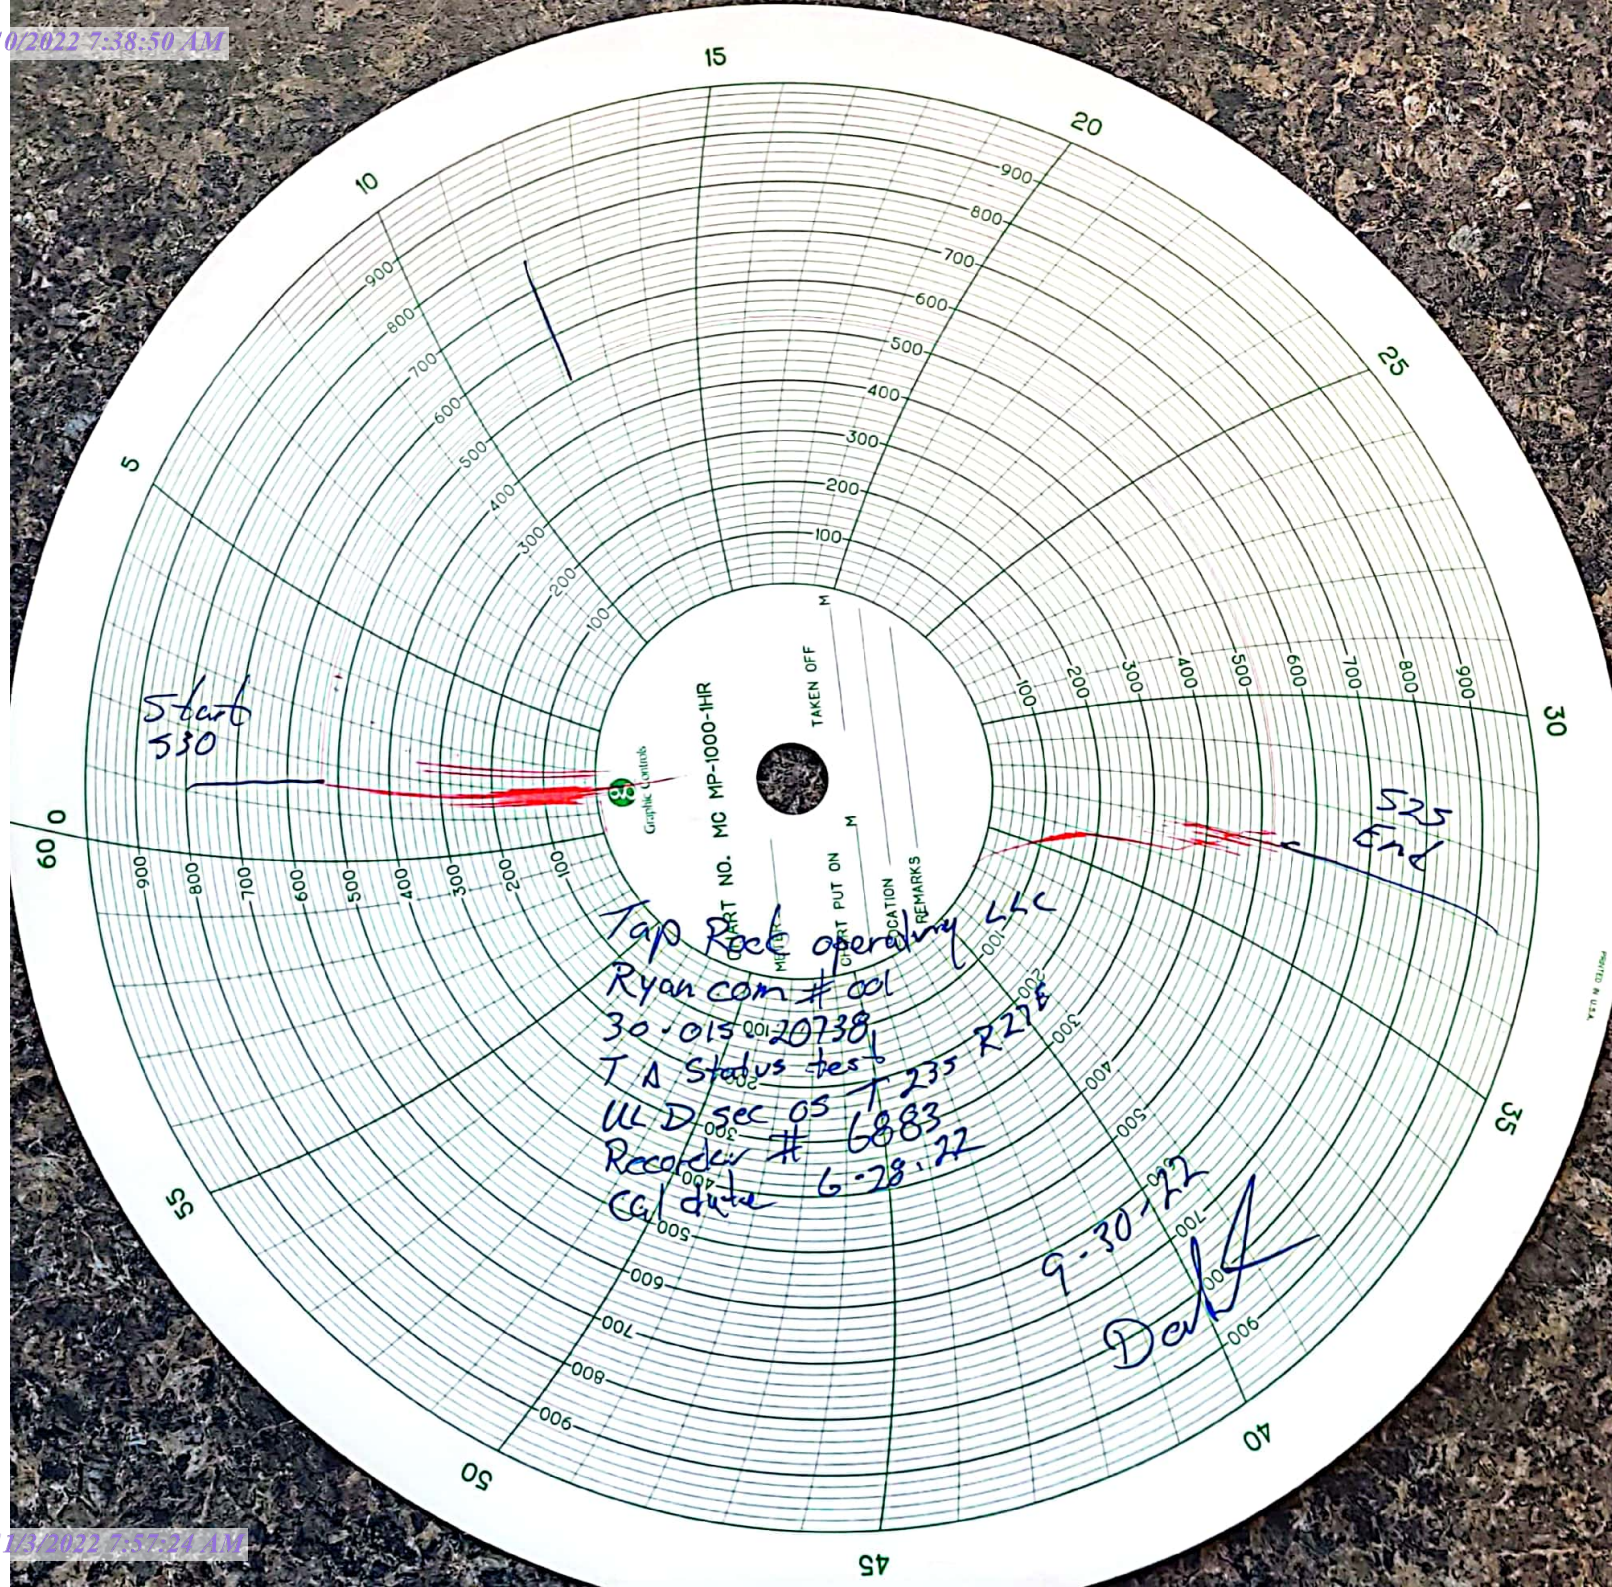

State of New Mexico
Energy, Minerals and Natural Resources Department

Michelle Lujan Grisham
Governor

Sarah Cottrell Propst
Cabinet Secretary

Todd E. Leahy, JD, PhD
Deputy Secretary

Adrienne Sandoval, Division Director
Oil Conservation Division



Date: 9-30-22

API# 30-015-20738

A Mechanical Integrity Test (M.I.T.) was performed on, Well Ryan com #1

 M.I.T. is successful, the original chart has been retained by the Operator on site. Submit a legible scan of the chart with an attached Original C-103Z Form indicating reason for the test. A scanned image will appear on line via NMOCD website.

 M.I.T. is unsuccessful, the original chart is returned to the Operator. Repairs will be made; Operator is to schedule for a re-test within a 90-day period. If this is a test of a repaired well currently in non-compliance, all dates and requirements of the original are still in effect.
No expectation of extension should be construed because of this test.

X M.I.T. for Temporary Abandonment, shall include a detailed description on Form C-103, including the location of the CIBP and any other tubular goods in the well including the Operator's request for TA status timeline.

 M.I.T. is successful, after the secondary request of a scheduled M.I.T. is performed. Therefore, Operator has within a 30-day period from the M.I.T. to submit a current C-103 along with a legible scan of the Chart, including a detailed description of the repair(s). **Only after receipt of the C-103 will the non-compliance be closed.**

 M.I.T. is successful, Initial of an injection well, you must submit a form C-103 to NMOCD within 30 days. A C-103 form must include a detailed description of the work performed on this well including the position of the packer, tubing Information, the date of first Injection, the tubing pressure and Injection volume.

Please ensure all documentation requirements are in place prior to injection process.

If I can be of additional assistance, please feel free to contact me at (575) 626-0836

Thank You,

Dan Smolik
EMNRD-O.C.D.
South District

Tap Rock Production

Current Configuration

Ryan Com #1


D5 T23S R27E

Eddy County, NM

API 30-015-20738

Lat. 32.3394356, Long. -104.2175903

Spud Date: September 1, 1972

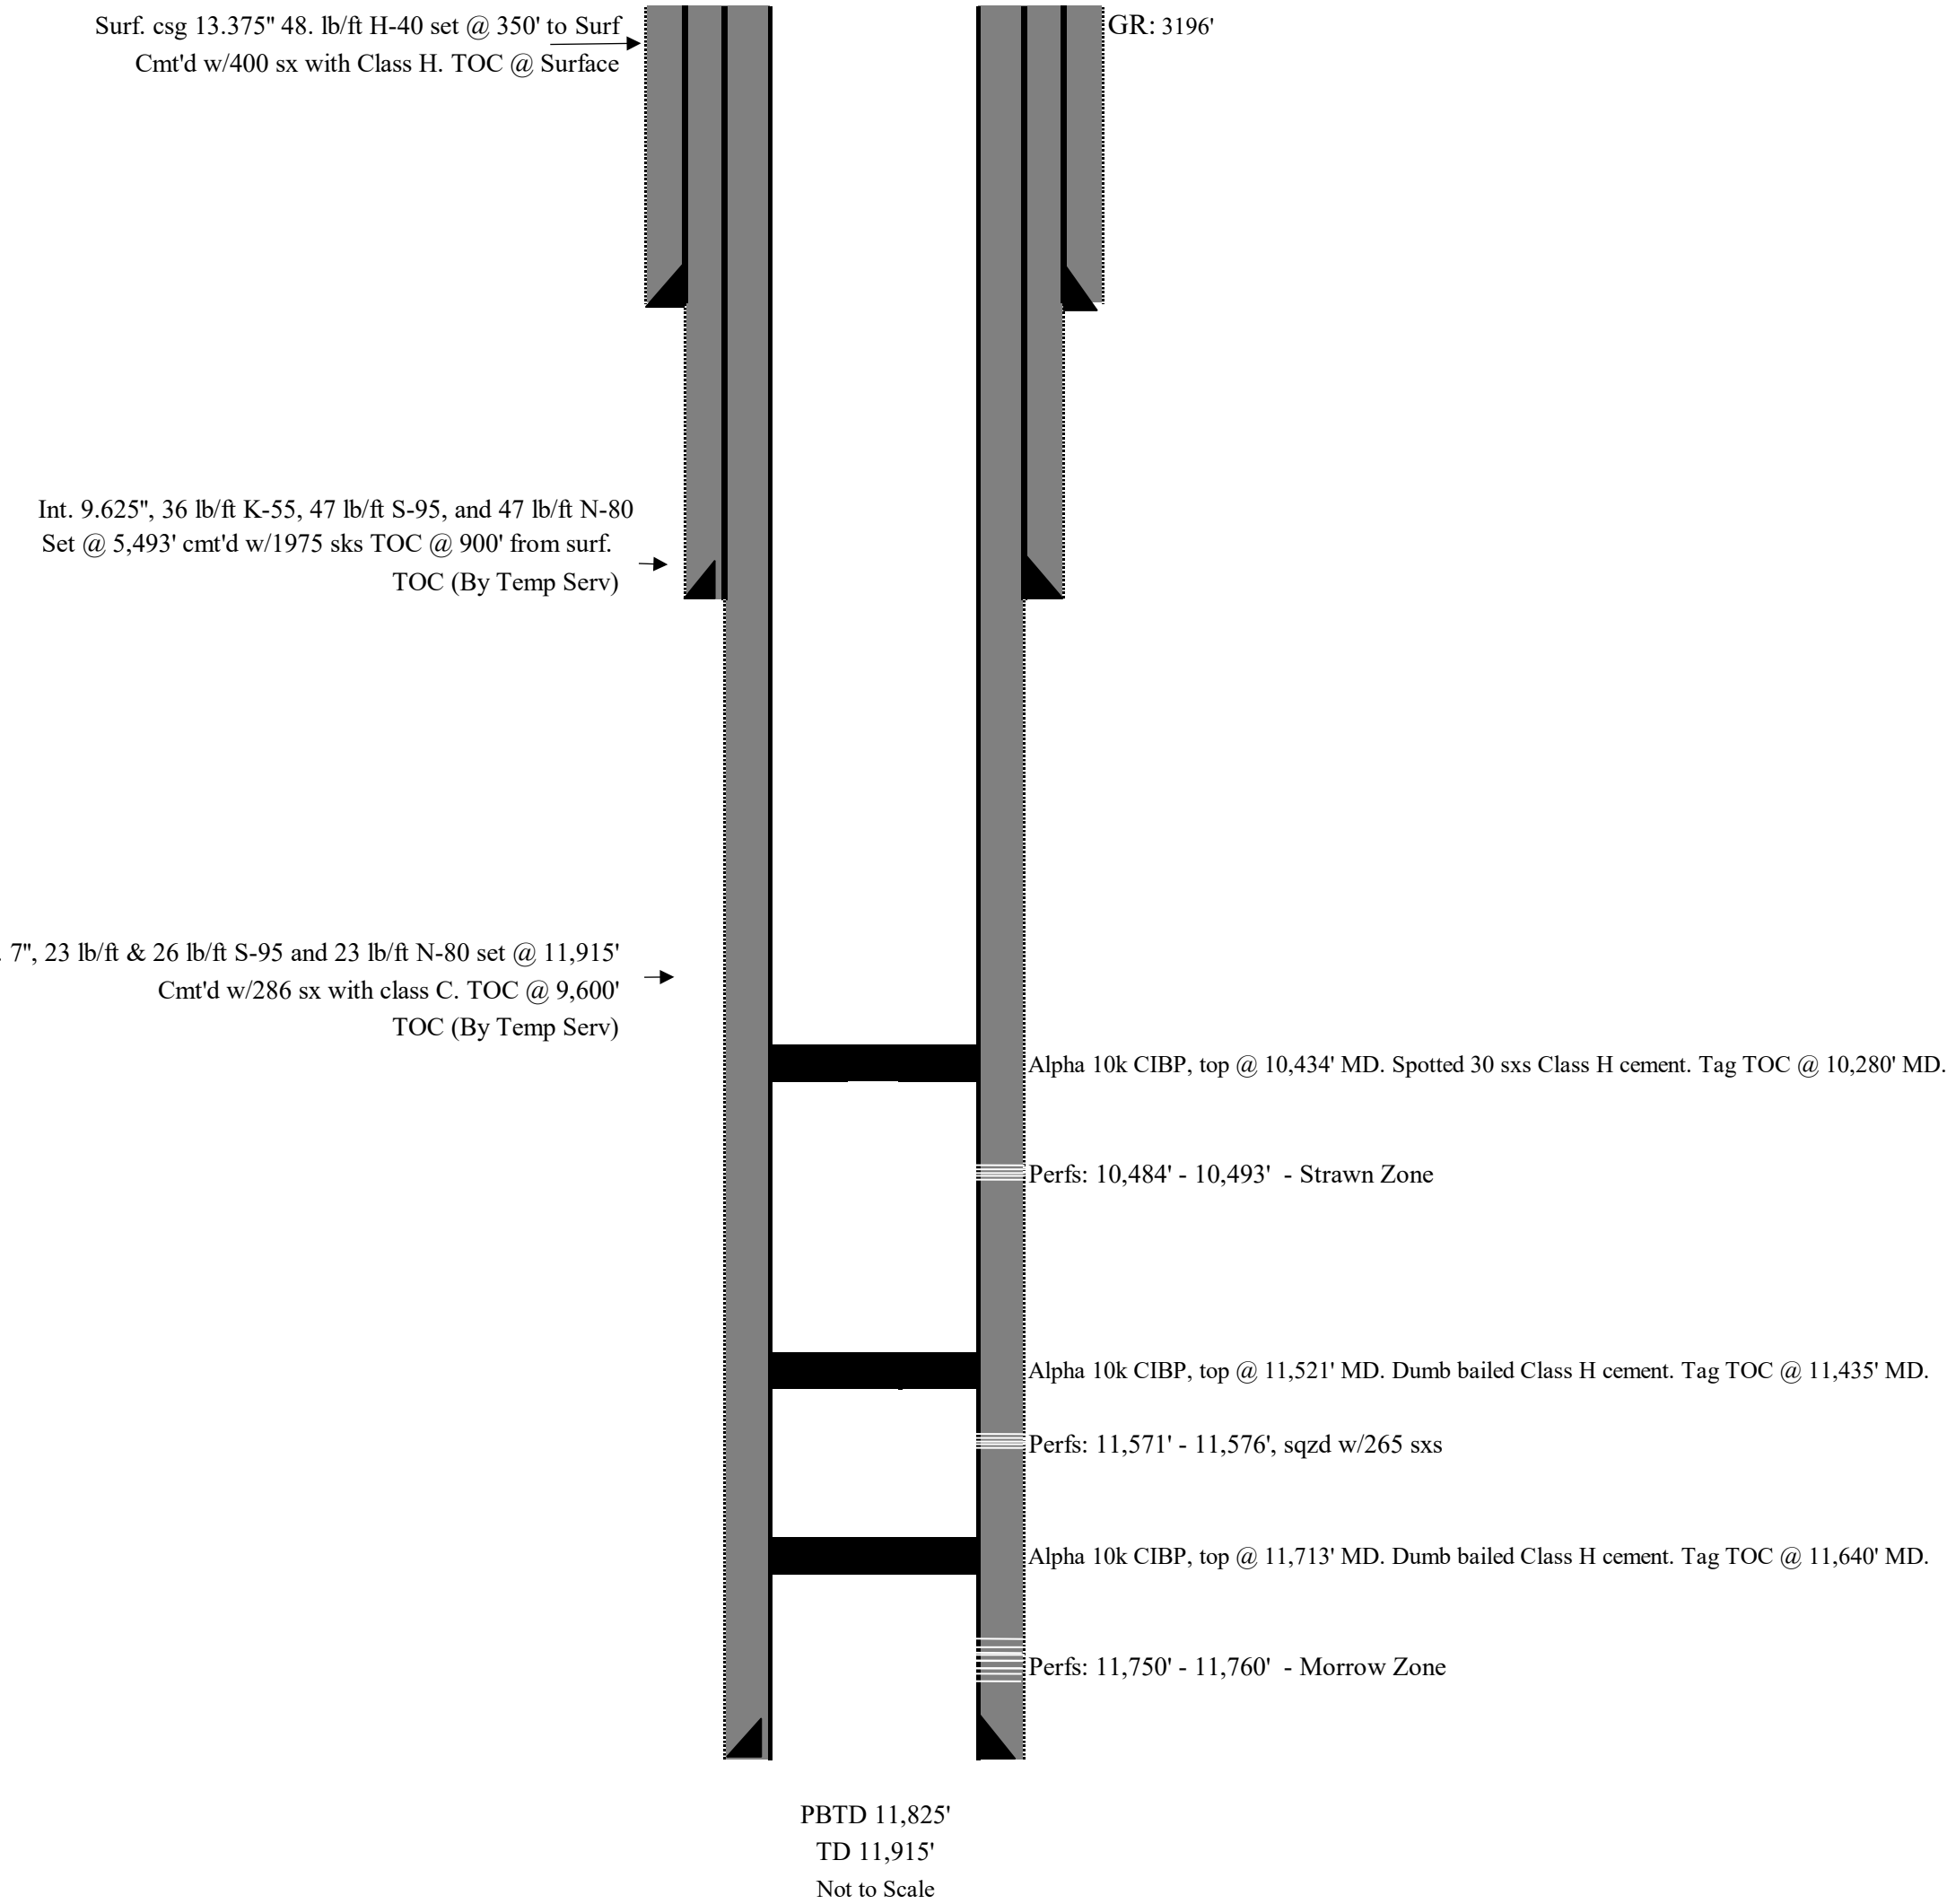

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 149722

CONDITIONS

Operator: TAP ROCK OPERATING, LLC 523 Park Point Drive Golden, CO 80401	OGRID: 372043
	Action Number: 149722
	Action Type: [C-103] Sub. Temporary Abandonment (C-103U)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	10/14/2022