<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District II 811 S. First St., Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico **Energy Minerals and Natural Resources** Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-144 Revised April 3, 2017

For temporary pits, below-grade tanks, and multi-well fluid management pits, submit to the appropriate NMOCD District Office.

For permanent pits submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

Dit Polovy Grada Tonk or

Proposed Alternative Method Permit or Closure Plan Application
Proposed Alternative Method Permit or Closure Plan Application
Type of action: Below grade tank registration Permit of a pit or proposed alternative method
BGT1 Closure Report
 ☐ Modification to an existing permit/or registration ☐ Closure plan only submitted for an existing permitted or non-permitted pit, below-grade tank,
or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
1. Operator: _Dugan Production Corp. OGRID #: _006515
Address: PO Box 420, Farmington, NM 87499-0420
Facility or well name: MF #2
API Number: 30-045-24995 OCD Permit Number:
U/L or Qtr/Qtr P Section 13 Township 24N Range 10W County: San Juan
Center of Proposed Design: Latitude 36.3089561 North Longitude -107.8419266 West NAD83
Surface Owner: Federal State Tribal Trust or Indian Allotment
2.
Pit: Subsection F, G or J of 19.15.17.11 NMAC
Temporary: Drilling Workover
☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A ☐ Multi-Well Fluid Management Low Chloride Drilling Fluid ☐ yes ☐ no
☐ Lined ☐ Unlined Liner type: Thicknessmil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
☐ String-Reinforced
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D
3.
Below-grade tank: Subsection I of 19.15.17.11 NMAC
Volume:25bbl Type of fluid:produced water
Tank Construction material: <u>steel</u>
Secondary containment with leak detection Uisible sidewalls, liner, 6-inch lift and automatic overflow shut-off
✓ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other+leak detection
Liner type: Thickness _20 high density weave, low density coating polyethylene_mil
4.
Alternative Method:
Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.
5. Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital,
institution or church)
Four foot height, four strands of barbed wire evenly spaced between one and four feet

Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks) Screen □ Netting □ Other □ Monthly inspections (If netting or screening is not physically feasible)	
7. Signs: Subsection C of 19.15.17.11 NMAC N 13" 24" 24" 24" 25" Lettering providing Operator's pages site location and engagement talonk are now here.	
☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers ☐ Signed in compliance with 19.15.16.8 NMAC	
8. Variances and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance. Please check a box if one or more of the following is requested, if not leave blank: □ Variance(s): Requests must be submitted to the appropriate division district for consideration of approval. □ Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
9. Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accematerial are provided below. Siting criteria does not apply to drying pads or above-grade tanks.	ptable source
General siting	
Ground water is less than 25 feet below the bottom of a low chloride temporary pit or below-grade tank. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No
Ground water is less than 50 feet below the bottom of a Temporary pit, permanent pit, or Multi-Well Fluid Management pit. NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. (Does not apply to below grade tanks) - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within the area overlying a subsurface mine. (Does not apply to below grade tanks) - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	Yes No
Within an unstable area. (Does not apply to below grade tanks) - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	Yes No
Within a 100-year floodplain. (Does not apply to below grade tanks) - FEMA map	Yes No
Below Grade Tanks	
Within 100 feet of a continuously flowing watercourse, significant watercourse, lake bed, sinkhole, wetland or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 200 horizontal feet of a spring or a fresh water well used for public or livestock consumption;. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No
Temporary Pit using Low Chloride Drilling Fluid (maximum chloride content 15,000 mg/liter)	1
Within 100 feet of a continuously flowing watercourse, or any other significant watercourse or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). (Applies to low chloride temporary pits.) - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a occupied permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	Yes No
Within 200 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 300feet of any other fresh water well or spring, in existence at the time of the initial application. NM Office of the State Engineer - iWATERS database search: Visual inspection (certification) of the proposed site	☐ Yes ☐ No

Within 100 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Temporary Pit Non-low chloride drilling fluid	
Within 300 feet of a continuously flowing watercourse, or any other significant watercourse, or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	Yes No
 Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. Visual inspection (certification) of the proposed site; Aerial photo; Satellite image 	☐ Yes ☐ No
Within 500 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 1000 feet of any other fresh water well or spring, in the existence at the time of the initial application; - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
 Within 300 feet of a wetland. US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site 	☐ Yes ☐ No
Permanent Pit or Multi-Well Fluid Management Pit	
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).	
- Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
 Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. Visual inspection (certification) of the proposed site; Aerial photo; Satellite image 	☐ Yes ☐ No
Within 500 horizontal feet of a spring or a fresh water well used for domestic or stock watering purposes, in existence at the time of initial application.	
- NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 Naturations: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the do attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19. and 19.15.17.13 NMAC Previously Approved Design (attach copy of design) API Number: or Permit Number:	O NMAC 15.17.9 NMAC
Multi-Well Fluid Management Pit Checklist: Subsection B of 19.15.17.9 NMAC	
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the do attached. Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC A List of wells with approved application for permit to drill associated with the pit. Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 and 19.15.17.13 NMAC Hydrogeologic Data - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Previously Approved Design (attach copy of design) API Number: or Permit Number: or Permit Number:	

Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.19 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC	documents are
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.	
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Multi-well F	luid Management Pit
☐ Alternative Proposed Closure Method: ☑ Waste Excavation and Removal	
☐ Waste Removal (Closed-loop systems only) ☐ On-site Closure Method (Only for temporary pits and closed-loop systems)	
☐ In-place Burial ☐ On-site Trench Burial ☐ Alternative Closure Method	
 □ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC □ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.13 NMAC □ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) □ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC □ Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC □ Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC 	
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sour provided below. Requests regarding changes to certain siting criteria require justifications and/or demonstrations of equivalency. P. 19.15.17.10 NMAC for guidance.	rce material are Please refer to
Ground water is less than 25 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is between 25-50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Within 100 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 300 horizontal feet of a private, domestic fresh water well or spring used for domestic or stock watering purposes, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 300 feet of a wetland. US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	

adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipali	ty; Written approval obtained from the municipality	☐ Yes ☐ No
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM	MEMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area. - Engineering measures incorporated into the design; NM Society; Topographic map	Bureau of Geology & Mineral Resources; USGS; NM Geological	
Within a 100-year floodplain.		Yes No
- FEMA map		☐ Yes ☐ No
by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon to Proof of Surface Owner Notice - based upon the appropriational Construction/Design Plan of Burial Trench (if applicable) Construction/Design Plan of Temporary Pit (for in-place be Protocols and Procedures - based upon the appropriate requirement Confirmation Sampling Plan (if applicable) - based upon the Waste Material Sampling Plan - based upon the appropriational Disposal Facility Name and Permit Number (for liquids, described Soil Cover Design - based upon the appropriate requirement Re-vegetation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate requirement Site Reclamation Plan - based upon the appropriate Plan - Based upon	the requirements of Subsection E of 19.15.17.13 NMAC based upon the appropriate requirements of Subsection K of 19.15.17. Durial of a drying pad) - based upon the appropriate requirements of 19. uirements of 19.15.17.13 NMAC the appropriate requirements of 19.15.17.13 NMAC the requirements of 19.15.17.13 NMAC trilling fluids and drill cuttings or in case on-site closure standards cannot sof Subsection H of 19.15.17.13 NMAC tents of Subsection H of 19.15.17.13 NMAC	11 NMAC 15.17.11 NMAC
17. Operator Application Certification:		
I hereby certify that the information submitted with this applicat	ion is true, accurate and complete to the best of my knowledge and beli	ef.
Name (Print):	Title:	
Signature:	Date:	
e-mail address: Telephone	o:	
18. OCD Approval: Permit Application (including closure plan	Report n) \(\overline{\overline{\text{N}}}\) Closure \(\frac{\text{Plan}}{\text{conly}}\) (only) \(\square \text{ OCD Conditions (see attachment)} \)	
OCD Representative Signature: <u>Shelly Wells</u>	Approval Date: <u>5/11/20</u>)23
Title: Environmental Specialist-Advanced	OCD Permit Number:_BGT1	
	sure plan prior to implementing any closure activities and submitting ithin 60 days of the completion of the closure activities. Please do not	
20.		
Closure Method: ☐ Waste Excavation and Removal ☐ On-Site Closure Meth ☐ If different from approved plan, please explain.	od Alternative Closure Method Waste Removal (Closed-lo	oop systems only)
Closure Report Attachment Checklist: Instructions: Each of mark in the box, that the documents are attached. ☐ Proof of Closure Notice (surface owner and division) ☐ Proof of Deed Notice (required for on-site closure for privent of the proof of Deed Notice (required for on-site closure for privent of the proof of Deed Notice (required for on-site closures and temporary pits) ☐ Confirmation Sampling Analytical Results (if applicable) ☐ Waste Material Sampling Analytical Results (required for on-site Soil Backfilling and Cover Installation of Re-vegetation Application Rates and Seeding Technique of Site Reclamation (Photo Documentation) ☐ On-site Closure Location: Latitude		

22.	
Operator Closure Certification:	
I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge	and
belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.	
Tid D 1 - F	
Name (Print): <u>Kevin Smaka</u> Title: <u>Regulatory Engineer</u>	
Signature: Klovi Smaha Date: 5 - 9 - 23	-
e-mail address: Kevin.Smaka@duganproduction.com Telephone: 505-325-1821 x1049	

MF #2 BGT Closure Report

30-045-24995

P-13-24N-10W

Closure Notification

On 3/28/22, Dugan emailed the NMOCD and BLM of our intention to close and remove a BGT located at the MF #2 well site. The surface is privately owned and a notification was also sent to the land owner via certified mail of our intentions. A copy of the email sent to BLM and OCD has been included with this report. In addition, a copy of the certified notice has been included as proof of our effort to contact the landowner.

Closure Narrative

- 1. On 3/31/23 Soil samples were collected as part of BGT closure at the MF# 2 well site.
- 2. While removing the BGT and its associated line there were no indications of a spill or prior release. Pictures of the soil conditions have been included. Each picture has been stamped with time, date and GPS coordinates.
- 3. A 5-point composite sample was collected from the soils directly beneath the BGT and taken to the lab. The lab analyzed the samples for TPH, BTEX and Chlorides. The samples were collected by JAKD Solutions.
- 4. Lab results indicated no further remedial activities would be needed.
- 5. Since lab results indicated the soil is in good condition, the hole was back filled. Dugan personnel made diligent effort to ensure quality topsoil was used to cover the excavation. This was done to ensure vegetation could regrow once seeding had been completed.
- 6. In addition to using a top cover that will encourage plant growth the surface will also be contoured to allow for adequate drainage.
- 7. The BGT area and well pad will be seeded as part of the P&A reclamation process. The seed mix will use the following seeds, all rates are listed in pounds/acre:

3 ½ # Crested Wheatgrass

1# Four wing Saltbush

34# Sand Dropseed

34# Alkali Sucaton

Closure Standard

Dugan has elected to forego providing additional maps and groundwater determinations for this closure report. In so doing the standard for closure will be set at the highest standard in the "pit rule". A copy of the standard is included below:

		Table I ow-Grade Tanks, Drying Pads Associat Pits where Contents are Removed	ted with
Depth below bottom of pit to groundwater less than 10,000 mg/l TDS	oundwater less than		Limit**
	Chloride	EPA 300.0	600 mg/kg
≤50 feet	TPH	EPA SW-846 Method 418.1	100 mg/kg
	BTEX	EPA SW-846 Method 8021B or 8260B	50 mg/kg
	Benzene	EPA SW-846 Method 8021B or 8015M	10 mg/kg
	611 11	-n	10000 #

As part of this report Dugan has included the following items:

- 1. A copy of the labs results
- 2. A copy of the notice of sampling
- 3. Pictures of the BGT vault prior to backfilling

Kevin Smaka

From:

Kevin Smaka

Sent:

Tuesday, March 28, 2023 9:30 AM

To:

'Burdine, Jaclyn, EMNRD'; Adeloye, Abiodun A

Cc:

James McDaniel; Carlos Ramos

Subject:

BGT Closure Notifcation

Dugan Production will be removing a below grade tank and collecting soil samples this Friday, 3/31/23, at 10:00 AM at Dugan's MF#2 wellsite.

The well is located on private land, but the minerals are federal. The landowner has been notified via certified mail of our intentions.

Here is the locations information:

MF #2 30-045-24995 P-13-24N-10W 790 FSL 790 FEL

Feel free to contact me should you have questions.

Kevin Smaka P.E. Regulatory Engineer Dugan Production Corp. 505-486-6207

U	S	P	S	Ti	ra	C	k	in	g	®
1177	32.75	100	10.7	_						

Electronic Return Receipt Request

10	•
42	_

From: Kevin Smccke

TO: Mr. Ed Blancett

271 CR 3000

Arfec NM 87410

9489009000276269 563764

Tracking Number:

re X

9489009000276269563764

Copy

Tracking Number:

Add to Informed Delivery (https://informeddelivery.usps.com/)

Your item was picked up at the post office at 10:41 am on March 31, 2023 in AZTEC, NM 87410. Get More Out of USPS Tracking: USPS Tracking Plus®

Delivered

Delivered, Individual Picked Up at Post Office

AZTEC, NM 87410 March 31, 2023, 10:41 am

See All Tracking History

Text & Email Updates		~
Return Receipt Electronic		~
USPS Tracking Plus®		~
USPS Tracking Plus®		▼.

Product Information

See Less ^

Track Another Package

Enter tracking or barcode numbers

Released to Imaging: 5/11/2023 11:01:10 AM



May 9, 2023

Dear Tyra Feil:


The following is in response to your request for proof of delivery on your item with the tracking number: 9489 0090 0027 6269 5637 64.

Item Details				
Status: Status Date / Time: Location: Postal Product: Extra Services:	Delivered, Individual Picked Up at Post Office March 31, 2023, 10:41 am AZTEC, NM 87410 First-Class Mail® Certified Mail™ Return Receipt Electronic			
Shipment Details				
Weight:	1.0oz			
Destination Delivery Address				
Street Address: City, State ZIP Code:	271 ROAD 3000 AZTEC, NM 87410-9507			
Recipient Signature				
Signature of Recipient:	Then Blandt			
Address of Recipient:	AZTEC, NM 87410-9907			

Note: Scanned image may reflect a different destination address due to Intended Recipient's delivery instructions on file.

Thank you for selecting the United States Postal Service® for your mailing needs. If you require additional assistance, please contact your local Post Office™ or a Postal representative at 1-800-222-1811.

Sincerely, United States Postal Service® 475 L'Enfant Plaza SW Washington, D.C. 20260-0004

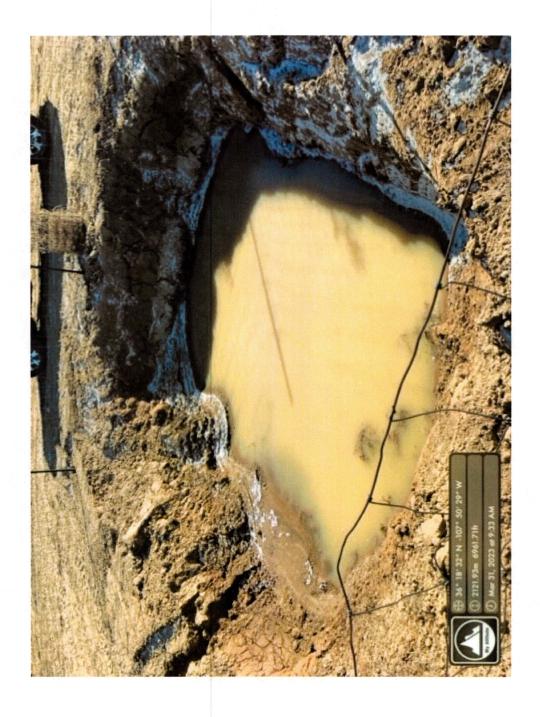



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87109 TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

April 12, 2023

James McDaniel
JAKD Solutions
3811 Crestridge Dr
Farmington, NM 87401
TEL: (505) 860-1666

FAX:

RE: MF 2 OrderNo.: 2304004

Dear James McDaniel:

Hall Environmental Analysis Laboratory received 1 sample(s) on 4/1/2023 for the analyses presented in the following report.

These were analyzed according to EPA procedures or equivalent. To access our accredited tests please go to www.hallenvironmental.com or the state specific web sites. In order to properly interpret your results, it is imperative that you review this report in its entirety. See the sample checklist and/or the Chain of Custody for information regarding the sample receipt temperature and preservation. Data qualifiers or a narrative will be provided if the sample analysis or analytical quality control parameters require a flag. When necessary, data qualifiers are provided on both the sample analysis report and the QC summary report, both sections should be reviewed. All samples are reported, as received, unless otherwise indicated. Lab measurement of analytes considered field parameters that require analysis within 15 minutes of sampling such as pH and residual chlorine are qualified as being analyzed outside of the recommended holding time.

Please don't hesitate to contact HEAL for any additional information or clarifications.

ADHS Cert #AZ0682 -- NMED-DWB Cert #NM9425 -- NMED-Micro Cert #NM0901

Sincerely,

Andy Freeman

Laboratory Manager

andyl

4901 Hawkins NE

Albuquerque, NM 87109

Analytical Report

Lab Order 2304004

Date Reported: 4/12/2023

Hall Environmental Analysis Laboratory, Inc.

CLIENT: JAKD Solutions Client Sample ID: BGT Composite

 Project:
 MF 2
 Collection Date: 3/31/2023 10:00:00 AM

 Lab ID:
 2304004-001
 Matrix: SOIL
 Received Date: 4/1/2023 8:50:00 AM

Result	RL Qu	al Units	DF	Date Analyzed
RGANICS				Analyst: PRD
ND	8.5	mg/Kg	1	4/10/2023 10:55:34 AM
ND	42	mg/Kg	1	4/10/2023 10:55:34 AM
83.2	69-147	%Rec	1	4/10/2023 10:55:34 AM
				Analyst: JJP
ND	4.7	mg/Kg	1	4/8/2023 5:29:38 PM
95.1	37.7-212	%Rec	1	4/8/2023 5:29:38 PM
				Analyst: JJP
ND	0.023	mg/Kg	1	4/8/2023 5:29:38 PM
ND	0.047	mg/Kg	1	4/8/2023 5:29:38 PM
ND	0.047	mg/Kg	1	4/8/2023 5:29:38 PM
ND	0.094	mg/Kg	1	4/8/2023 5:29:38 PM
80.0	70-130	%Rec	1	4/8/2023 5:29:38 PM
				Analyst: CAS
ND	60	mg/Kg	20	4/7/2023 10:51:37 PM
	ND ND 83.2 ND 95.1 ND 80.0	ND 8.5 ND 42 83.2 69-147 ND 4.7 95.1 37.7-212 ND 0.023 ND 0.047 ND 0.047 ND 0.047 ND 0.094 80.0 70-130	ND 8.5 mg/Kg ND 42 mg/Kg 83.2 69-147 %Rec ND 4.7 mg/Kg 95.1 37.7-212 %Rec ND 0.023 mg/Kg ND 0.047 mg/Kg ND 0.047 mg/Kg ND 0.047 mg/Kg ND 0.047 mg/Kg ND 0.094 mg/Kg 80.0 70-130 %Rec	RGANICS ND 8.5 mg/Kg 1 ND 42 mg/Kg 1 83.2 69-147 %Rec 1 ND 4.7 mg/Kg 1 95.1 37.7-212 %Rec 1 ND 0.023 mg/Kg 1 ND 0.047 mg/Kg 1 ND 0.094 mg/Kg 1 80.0 70-130 %Rec 1

Refer to the QC Summary report and sample login checklist for flagged QC data and preservation information.

Qualifiers:

Value exceeds Maximum Contaminant Level.

D Sample Diluted Due to Matrix

H Holding times for preparation or analysis exceeded

ND Not Detected at the Reporting Limit

PQL Practical Quantitative Limit

S % Recovery outside of standard limits. If undiluted results may be estimated.

B Analyte detected in the associated Method Blank

E Above Quantitation Range/Estimated Value

J Analyte detected below quantitation limits

P Sample pH Not In Range

RL Reporting Limit

Page 1 of 5

Hall Environmental Analysis Laboratory, Inc.

WO#: 2304004

12-Apr-23

Client:

JAKD Solutions

Project:

MF 2

Sample ID: MB-74211

SampType: mblk

TestCode: EPA Method 300.0: Anions

Client ID:

PBS

Batch ID: 74211

RunNo: 95862

Prep Date:

Analysis Date: 4/7/2023 4/7/2023

SeqNo: 3471550

Units: mg/Kg

Qual

Analyte Chloride

Result **PQL**

1.5

SPK value SPK Ref Val %REC LowLimit HighLimit

%RPD

%RPD

RPDLimit

Qual

Sample ID: LCS-74211

SampType: Ics

TestCode: EPA Method 300.0: Anions

RunNo: 95862

Client ID: LCSS Prep Date:

4/7/2023

Batch ID: 74211

PQL

SeqNo: 3471551

Units: mg/Kg

RPDLimit

Analyte

Analysis Date: 4/7/2023

SPK value SPK Ref Val %REC

LowLimit

HighLimit 110

Chloride

Result 15

ND

15.00

96.9

90

1.5

Qualifiers:

- Value exceeds Maximum Contaminant Level.
- Sample Diluted Due to Matrix
- Н Holding times for preparation or analysis exceeded ND Not Detected at the Reporting Limit
- Practical Quanitative Limit PQL
- % Recovery outside of standard limits. If undiluted results may be estimated.
- Analyte detected in the associated Method Blank
- Above Quantitation Range/Estimated Value Analyte detected below quantitation limits
- Sample pH Not In Range
- Reporting Limit

Page 2 of 5

Hall Environmental Analysis Laboratory, Inc.

WO#:

2304004

12-Apr-23

Client:

JAKD Solutions

Project:

MF 2

Sample ID: LCS-74202	SampT	ype: LC	s	Tes	tCode: El	PA Method	8015M/D: Die	sel Range	Organics	77 9 9 11 11
Client ID: LCSS	Batch	ID: 74 2	202	F	RunNo: 9	5894				
Prep Date: 4/7/2023	Analysis D	ate: 4/	10/2023	\$	SeqNo: 3	472132	Units: %Rec	:		
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Surr: DNOP	4.5		5.000		90.2	69	147			

Sample ID: MB-74202	SampType: MBLK	TestCode: EPA Method 8015M/D: Diesel Range Organics									
Client ID: PBS	Batch ID: 74202	RunNo: 95894									
Prep Date: 4/7/2023	Analysis Date: 4/10/2023	SeqNo: 3472133	Units: %Rec								
Analyte	Result PQL SPK value	SPK Ref Val %REC LowLimit	HighLimit %RPD RI	PDLimit Qual							
Surr: DNOP	8.7 10.00	87.2 69	147								

Sample ID: MB-74198	SampT	уре: МВ	BLK	TestCode: EPA Method 8015M/D: Diesel Range Organics									
Client ID: PBS	Batch	1D: 74 1	198	F	RunNo: 9	5898							
Prep Date: 4/7/2023	Analysis D)ate: 4/1	10/2023	5	SeqNo: 34	172268	Units: mg/K						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual			
Diesel Range Organics (DRO)	ND	10		•									
Motor Oil Range Organics (MRO)	ND	50											
Surr: DNOP	8.3		10.00		83.4	69	147						

Sample ID: LCS-74198	SampT	ype: LC	S	TestCode: EPA Method 8015M/D: Diesel Range Organics										
Client ID: LCSS	Batch	n ID: 74	198	F	RunNo: 9	5898								
Prep Date: 4/7/2023	Analysis D	Date: 4/	10/2023	\$	SeqNo: 34	472269	Units: mg/K	(g						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual				
Diesel Range Organics (DRO)	46	10	50.00	0	91.8	61.9	130							
Surr: DNOP	4.4		5.000		88.5	69	147							

Qualifiers:

Value exceeds Maximum Contaminant Level.

D Sample Diluted Due to Matrix

H Holding times for preparation or analysis exceeded

ND Not Detected at the Reporting Limit

PQL Practical Quanitative Limit

% Recovery outside of standard limits. If undiluted results may be estimated.

B Analyte detected in the associated Method Blank

E Above Quantitation Range/Estimated Value

J Analyte detected below quantitation limits

P Sample pH Not In Range

RL Reporting Limit

Page 3 of 5

Hall Environmental Analysis Laboratory, Inc.

WO#:

2304004 12-Apr-23

Client:

JAKD Solutions

Project:

MF 2

Sample ID: Ics-74179	Samp	Гуре: LC	s	TestCode: EPA Method 8015D: Gasoline Range									
Client ID: LCSS	Batc	h ID: 74 1	179	F	RunNo: 9	5869							
Prep Date: 4/6/2023	Analysis [Date: 4/8	3/2023	5	SeqNo: 34	471789	Units: mg/K						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual			
Gasoline Range Organics (GRO)	23	5.0	25.00	0	90.2	70	130						
Surr: BFB	1900		1000		185	37.7	212						
Sample ID: mb-74179	Samp	Гуре: МВ	BLK	Tes	tCode: EF	PA Method	8015D: Gaso	line Range					

Sample ID: mb-74179	SampT	ype: ME	BLK	TestCode: EPA Method 8015D: Gasoline Range									
Client ID: PBS	Batch	n ID: 74 ′	179	F	RunNo: 9	5869							
Prep Date: 4/6/2023	Analysis D)ate: 4 /8	8/2023	5	SeqNo: 34	471791	Units: mg/K	g					
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual			
Gasoline Range Organics (GRO)	ND	5.0											
Surr: BFB	970		1000		96.7	37.7	212						

Qualifiers:

Value exceeds Maximum Contaminant Level.

Sample Diluted Due to Matrix

Н Holding times for preparation or analysis exceeded

ND Not Detected at the Reporting Limit

PQL Practical Quanitative Limit

% Recovery outside of standard limits. If undiluted results may be estimated.

Analyte detected in the associated Method Blank

Above Quantitation Range/Estimated Value

Analyte detected below quantitation limits

Sample pH Not In Range

RL Reporting Limit Page 4 of 5

Hall Environmental Analysis Laboratory, Inc.

WO#: 2304004

12-Apr-23

Client:

JAKD Solutions

Project: MF 2

Sample ID: LCS-74179	Samp1	ype: LC	s	TestCode: EPA Method 8021B: Volatiles								
Client ID: LCSS	Batcl	h ID: 74 1	179	F	RunNo: 9	5869						
Prep Date: 4/6/2023	Analysis [Date: 4/8	8/2023	5	SeqNo: 34	173502	Units: mg/K	g				
Analyte	Result	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual			
Benzene	0.85	0.025	1.000	0	85.0	80	120					
Toluene	0.87	0.050	1.000	0	86.6	80	120					
Ethylbenzene	80	120										
Xylenes, Total	2.5	0.10	3.000	0	84.5	80	120					
Surr: 4-Bromofluorobenzene	0.84		1.000	84.2 70 130								

Sample ID: mb-74179	Samp1	Гуре: МЕ	BLK	TestCode: EPA Method 8021B: Volatiles									
Client ID: PBS	Batc	h ID: 74 1	179	F									
Prep Date: 4/6/2023	Analysis [Date: 4/ 8	8/2023	5	SeqNo: 34	473503	Units: mg/K						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual			
Benzene	ND	0.025											
Toluene	ND	0.050											
Ethylbenzene	ND	0.050											
Xylenes, Total	ND	0.10											
Surr: 4-Bromofluorobenzene	1.000		83.3	70	130								

Qualifiers:

- Value exceeds Maximum Contaminant Level.
- Sample Diluted Due to Matrix
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- PQL Practical Quanitative Limit
- S % Recovery outside of standard limits. If undiluted results may be estimated.
- B Analyte detected in the associated Method Blank
- E Above Quantitation Range/Estimated Value
 J Analyte detected below quantitation limits
- P Sample pH Not In Range
- RL Reporting Limit

Page 5 of 5



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87109

TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

Sample Log-In Check List

Client Name: JAF	(D Solutions	Work Orde	er Number:	2304004		RcptNo:	1
Received By: Ch	eyenne Cason	4/1/2023 8:5	0:00 AM		Chul		
Completed By: Ch	eyenne Cason	4/1/2023 9:4	4:17 AM		Chul		
Reviewed By: 7	Mc	4/1/23					
Chain of Custod	<u>Y</u>						
1. Is Chain of Custoo	ly complete?			Yes 🗹	No 🗆	Not Present	
2. How was the sam	ole delivered?			Courier			
<u>Log In</u> 3. Was an attempt m	ade to cool the sam	oles?		Yes 🗹	No 🗆	NA 🗆	
4. Were all samples	received at a tempera	ature of >0° C to 6.	0°C	Yes 🗹	No 🗆	NA 🗆	
5. Sample(s) in prop	er container(s)?			Yes 🗹	No 🗆		
6. Sufficient sample v	volume for indicated t	test(s)?		Yes 🗹	No 🗆		
7. Are samples (exce	pt VOA and ONG) p	roperly preserved?		Yes 🗹	No 🗆		
8. Was preservative	added to bottles?			Yes 🗌	No 🗹	NA 🗆	
9. Received at least	i vial with headspace	e <1/4" for AQ VOA	?	Yes 🗌	No 🗆	NA 🗹	
10. Were any sample	containers received	broken?		Yes	No 🗹	# of preserved	
11. Does paperwork m	natch bottle labels?	v)		Yes 🗹	No 🗆	bottles checked for pH:	>12 unless noted)
2. Are matrices corre				Yes 🗹	No 🗆	Adjusted?	
3. Is it clear what and	lyses were requeste	d?		Yes 🗹	No 🔲		000 111.1
4. Were all holding ti	mes able to be met? mer for authorization.)		Yes 🗹	No 🔲	Checked by:	MC 4/1/2
Special Handling	(if applicable)						
15. Was client notified	d of all discrepancies	with this order?		Yes 🗌	No 🗆	NA 🗹	,
Person Noti	fied:	contradado como amodas contradas fundirado atente car	Date:				
By Whom:		CONTRACTOR	Via:	eMail [Phone Fax	☐ In Person	
Regarding:							
Client Instru							
16. Additional remark							
17. Cooler Informat Cooler No	i <u>on</u> emp °C Condition	Seal Intact Se	al No S	eal Date	Signed By	Аммену	
	2 Good	entre e profesorari di transalina de material di transalina e profesione	gi (to)	Jai Date	Cignou Dy		

	Brush ANALYSIS LABORATORY		4901 Hawkins NE - Albuquerque, NM 87109	Tel. 505-345-3975 Fax 505-345-4107	Analysis	† 0 5	CB. ²	OЯ(() S07:	MT (1.40)	ANON SERVICE S	O'.0'.C'.C'.C'.C'.C'.C'.C'.C'.C'.C'.C'.C'.C'	X / X / Seq / A / A / B / A / B / A / A / B / A / A	Native HEAL No. 174 No	× × ×						ia: 3 pate Time Remarks: $32/23/25$	Via: Date Time	
Turn-Around Time:	ちょう 文 Standard	Project Name:	MF # O	Project #:	١	Project Manager:	S S		Sampler: ///	9	Cooler Temp(Including CF):		Container Prese							Received by:	Received by:	7
Chain-of-Custody Record	Client: TAMD Solutions		Mailing Address: 3011 Crestroder	1 P. Juni	9991	=ax#: Janus Gjakosolutions,com	ige:	☐ Level 4 (Full Validation)	on: ☐ Az Compliance				Date Time Matrix Sample Name	Sirpo Soil Klat Composite						Date: Time: Relinquished by:	Relipquehed by:	

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 215552

CONDITIONS

Operator:	OGRID:
DUGAN PRODUCTION CORP	6515
PO Box 420	Action Number:
Farmington, NM 87499	215552
	Action Type:
	[C-144] Below Grade Tank Plan (C-144B)

CONDITIONS

Create	ed By	Condition	Condition Date
scw	ells	Please submit notification to OCD when site has been seeded or planted.	5/11/2023