

Sundry Print Report

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Name: BERGER Well Location: T26N / R11W / SEC 22 / County or Parish/State: SAN

NENE / 36.478257 / -107.985354 JUAN / NM

Well Number: 6 Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMSF078641 Unit or CA Name: Unit or CA Number:

US Well Number: 3004531204 Well Status: Producing Gas Well Operator: HILCORP ENERGY

COMPANY

Notice of Intent

Sundry ID: 2755987

Type of Submission: Notice of Intent

Type of Action: Casing

Date Sundry Submitted: 10/11/2023 Time Sundry Submitted: 12:37

Date proposed operation will begin: 10/12/2023

Procedure Description: Hilcorp Energy Company requests permission to perform a casing repair on the above mentioned well. Please see the attached procedure and wellbore diagram.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

 $Berger_6_Production_Casing_Remediation_NOI_20231011123700.pdf$

Page 1 of 2

Well Location: T26N / R11W / SEC 22 /

County or Parish/State: SAN 200 NENE / 36.478257 / -107.985354 JUAN / NM

Well Number: 6 Allottee or Tribe Name: Type of Well: OTHER

Lease Number: NMSF078641 **Unit or CA Name: Unit or CA Number:**

US Well Number: 3004531204 **Operator: HILCORP ENERGY** Well Status: Producing Gas Well

COMPANY

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Signed on: OCT 11, 2023 12:37 PM **Operator Electronic Signature: AMANDA WALKER**

Name: HILCORP ENERGY COMPANY Title: Operations/Regulatory Technician

Street Address: 1111 TRAVIS ST

City: HOUSTON State: TX

Phone: (346) 237-2177

Email address: MWALKER@HILCORP.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742 BLM POC Email Address: krennick@blm.gov

Disposition: Approved Disposition Date: 10/11/2023

Signature: Kenneth Rennick

Page 2 of 2

Berger 6

A-22-26N-11W 940 FNL 865 FEL


API#: 3004531204


4.5" Casing Remediation Procedure

10/11/2023

Procedure:

- 1. MIRU WOR and associated equipment. Check casing, tubing, and bradenhead pressures and record. Ensure well is killed.
- 2. RD Horse head. Unseat pump. POOH w/ rods and pump.
- 3. NDWH, NUBOPs. Pick up and remove tubing hanger. POOH 2-3/8" tubing.
- 4. PU RBP for 4.5" 10.5# J-55 casing. RIH and set above top Fruitland Coal perforation. Ensure well is dead.
- 5. Cut 4.5" casing below identified leak and weld on new 4.5" casing joint.
- 6. MIT wellbore from surface to RBP to 500 PSI. Chart and record test.
- 7. RIH and retrieve RBP. Pull OOH.
- 8. RIH w/ 2-3/8" production tubing. Land at ~1775'.
- 9. RIH w/ rods and pump. Seat pump and space out. Pressure test tubing/pump to 500psi. Hang off.
- 10.ND BOPs. NUWH. Check for leaks at surface. RDMO WOR and turn well over to production.

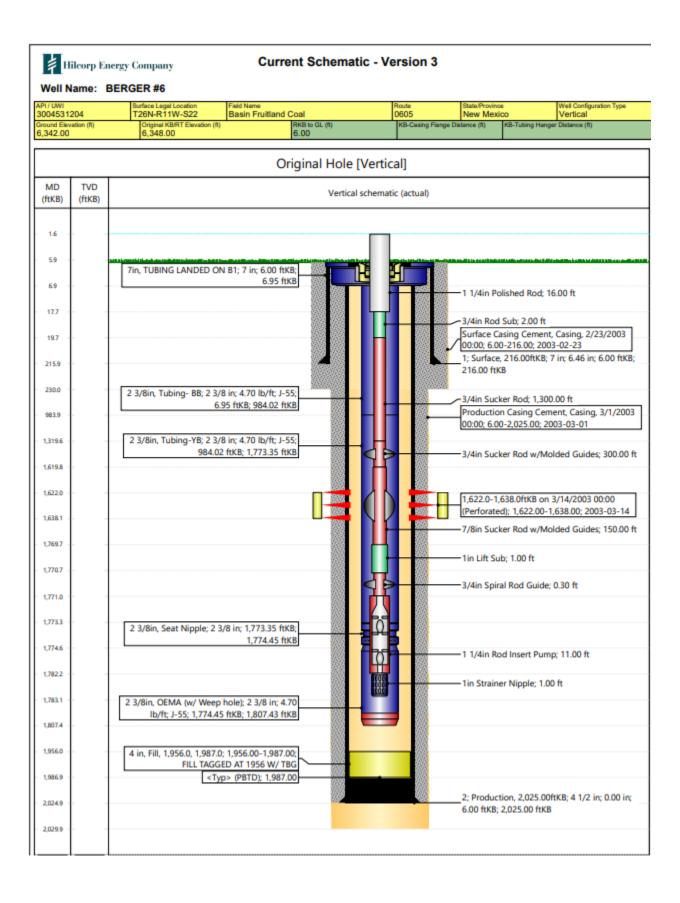

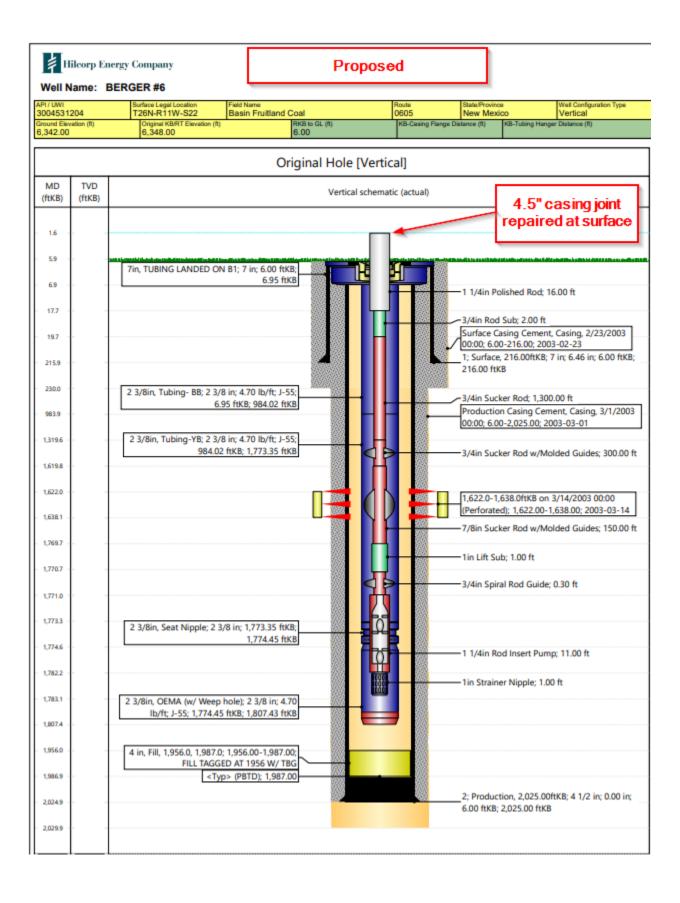

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 274886

CONDITIONS

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	274886
	Action Type:
	[C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
mkuehlin	Notify NMOCD 24 hours prior to moving on - MIT required after replacement of casing - bradenhead test required prior to MIT day of MIT	10/12/2023