

Submit a Copy To Appropriate District

Office  
 District I – (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II – (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III – (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV – (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM  
 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

Form C-103  
 Revised July 18, 2013

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

WELL API NO. <b>30-025-30769</b>
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name <b>Daisy AFS State</b>
8. Well Number <b>#001</b>
9. OGRID Number <b>330447</b>
10. Pool name or Wildcat <b>Townsend;Permo Upper Penn</b>

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator <b>Contango Resources, LLC</b>	
3. Address of Operator <b>111 E. 5<sup>th</sup> Street, Suite 300, Fort Worth, TX 76102</b>	
4. Well Location Unit Letter <b>B</b> : <b>2310</b> feet from the <b>N</b> line and <b>1650</b> feet from the <b>E</b> line Section <b>03</b> Township <b>16S</b> Range <b>35E</b> NMPM County <b>Lea</b>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) <b>4008' GR</b>	

## 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached plugging summary

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Alison Denner TITLE Regulatory Compliance Analyst IV DATE 10/16/2024

Type or print name Alison Denner E-mail address: adenner@contango.com PHONE: 713-236-7456

**For State Use Only**

APPROVED BY: \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

Conditions of Approval (if any):



**Daisy AFS State #001**  
**30-025-30769**  
**Contango Resources, LLC**

### Plugging Report

6/27/24 – MIRU. PU on rods. Weigh ~17k. POOH w/ rods. Found pulled threads on pin 387.

6/28/24 – RU Blackbeard WL. TIH and shoot drainhole @ 9,636. LD WL. POOH to fish. Unseat pump and LD rods and pump.

7/1/24 – POOH w/ tbg. LD BHA. PU bit and string mill and tag @ 11,485'. Try to work w/ tongs and make no progress.

7/2/24 – RU power swivel and make 2'. Cannot get any torque. Work for 1 hr. POOH, LD BHA, no signs of wear. TIH w/ mule shoe to 6,562'. SDON.

7/3/24 -- Tag @ 11,485'. Make no hole. POOH. LD BHA. Showed signs of tbg in wellbore. Contact Gilbert w/ NMOCD and receive direction to fish tbg.

7/8/24 – PU fishing BHA and tag fish @ 11,485'. Latch fish and set jars off 6 times and PU free. Could not latch back on, did not see any weigh gain. POOH.

7/9/24 – Continue POOH. Overshot empty and grapple was broken. Change out and TIH. Tag fish @ 11,485'. Try to latch. Unsuccessful. RU swivel and try to work over fish while pumping down tbg. Could not latch fish. Contact Gilbert w/ NMOCD and receive direction to continue fishing. POOH.

7/10/24 – Continue POOH. LD overshot. Nothing in it. PU new fishing assembly. MIRU reverse unit. Tag @ 11,485'. RU swivel, broke circ w/ 280 bbls pumping 3 bpm and getting 2 bpm back. Made a total of 6' and lost all torque.

7/11/24 – Continue POOH. LD BHA. Nothing inside shoe. PU impression block. TIH and tag @ 11,586' POOH. Looks like 2-3/8" tbg in well.

7/12/24 – PU new fishing assembly. TIH to 11,092 and brakes gave out. SI waiting on mechanic.

7/15/24 – TIH and latch fish @ 11,485'. Start jarring. RU power swivel. Work fish. Moved 1' up hole. Came free. Did not gain and weight and could not latch fish again. POOH.



**Daisy AFS State #001**

**30-025-30769**

**Page 2**

7/16/24 – POOH. Slip in oversocket was stripped. Contact Gilbert w/ NMOCD. Received permission to set CIBP @ 11,400' and top w/ 35' cement. RIH w/ wireline and set 5-1/2" CIBP @ 11,400'. Dump 35' cement on top. SDON.

7/17/24 – Tag TOC @ 11,365'. Set 5-1/12" CIBP @ 10,148'. Pressure test csg to 500 psi for 30 mins. Good test. Run CBL from 10,148' to surface. TOC @ 4,792'. SDON.


7/18/24 – Circulate 300 bbls and spot 25 sx cmt on top of CIBP. WOC.

7/19/24 – Tag TOC @ 9,945'. Spot 25 sx cement at 9,738'. Tag cement @ 9,460'. Spot 25 sx cmt @ 8,066'. WOC. Tag @ 7,739'. Spot 25 sx cmt @ 7,384'. Tag @ 7,131. Spot 25 sx cmt @ 6,216'. WOC.

7/22/24 – Tag TOC @ 5,878'. PU 5-1/2" AD-1 and set pkr @ 3,953'. TIH w/ perf gun, misfire, pooh. TIH and perf @ 4,632'. EIR @ 2 BPM and 250 psi. Break circulation on surf. Pump 45 sx and displace w/ 34.2 bbls.

7/23/24 – Tag cement @ 4,350'. Spot 25 sx cmt @ 3,896' and displace w/ 21 bbls. TOC @ 3,635'. Perf @ 3,041'. Circulate from csg to surface at 2 BPM w/ 200 psi. Squeeze 25 sx cmt. WOC. Tag @ 2,898'. Perf @ 1,962'. Circulate well w/ 2 BPM @ 200 psi. Sqz 50 sx cmt. WOC.

7/24/24 – TOC @ 1,672'. Perf @ 475'. Circ. 125 sx cmt to surface.

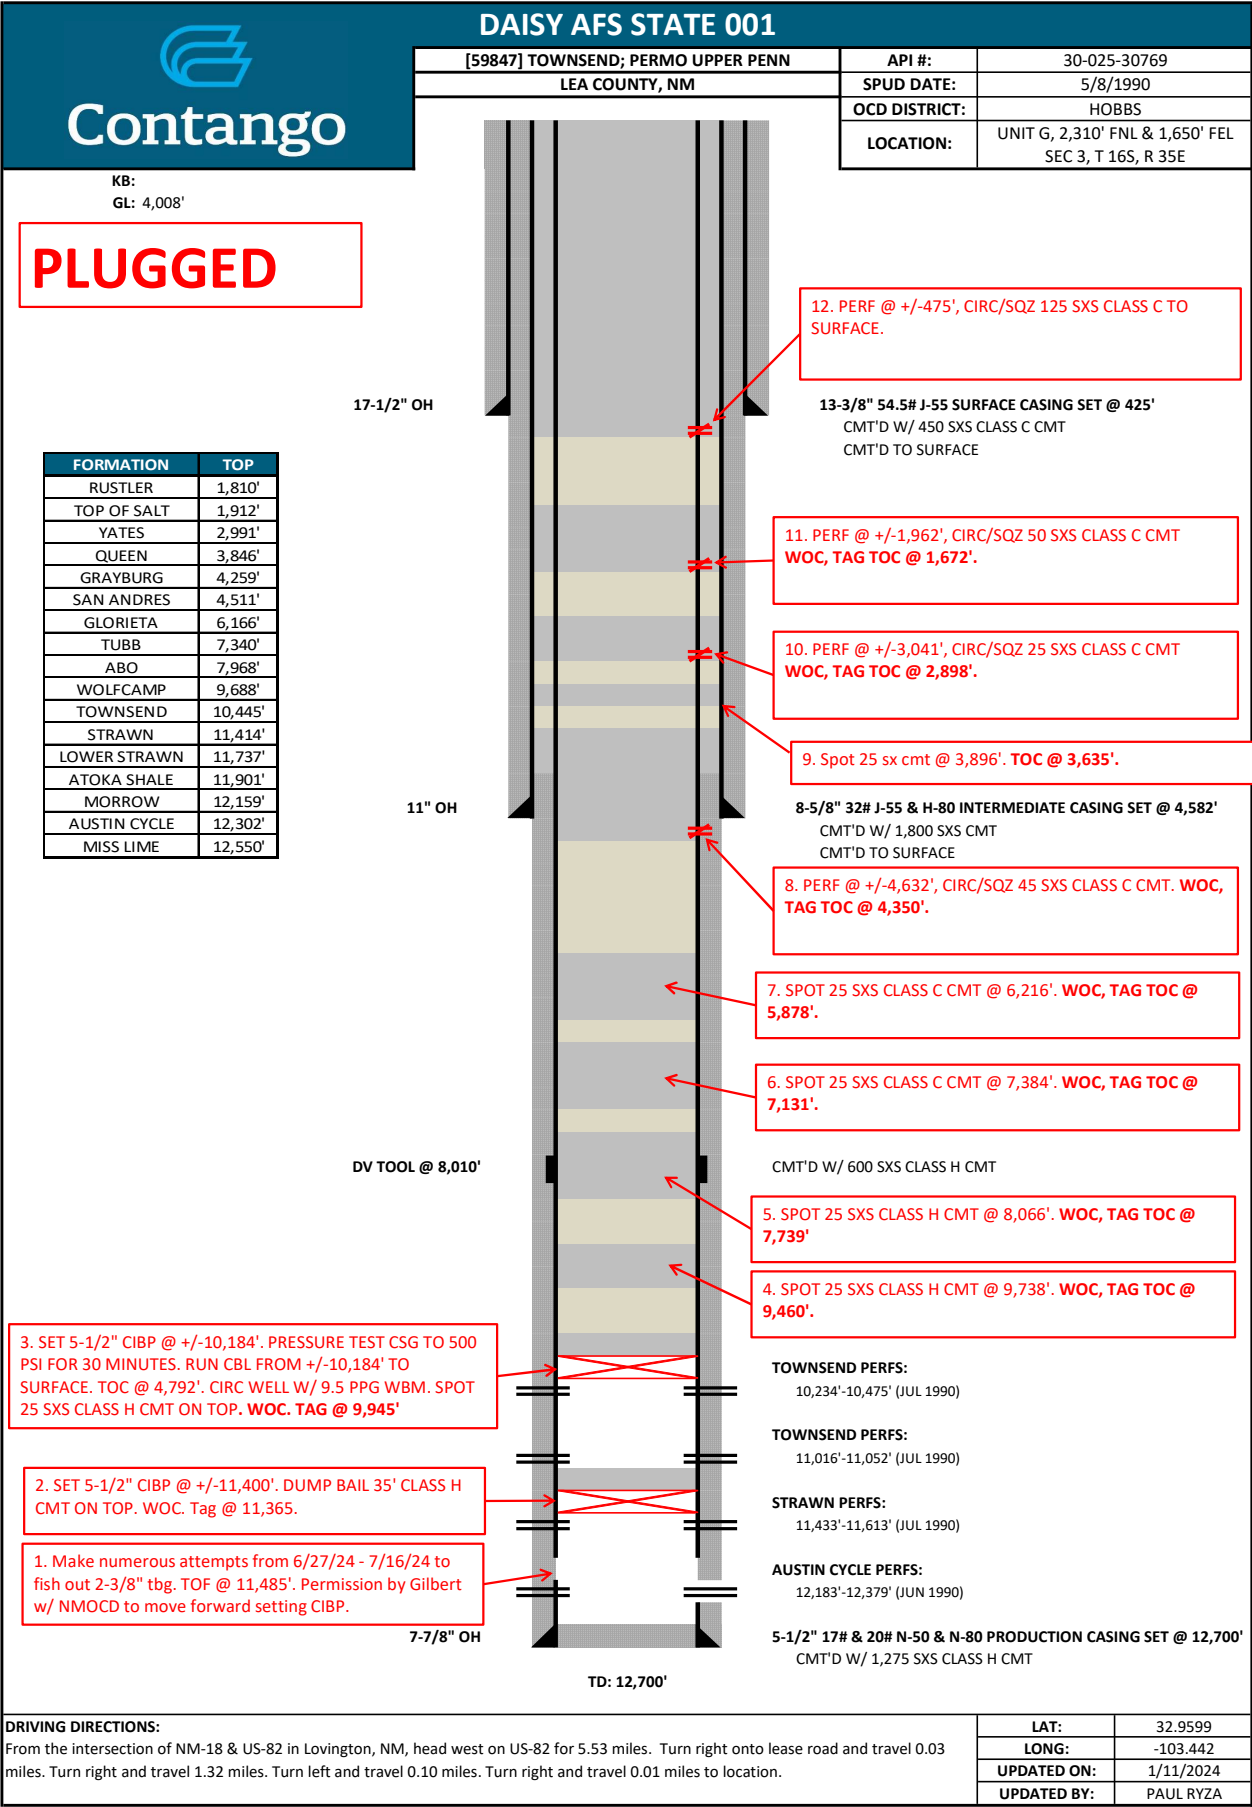

**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico  
Energy, Minerals and Natural Resources  
Oil Conservation Division  
1220 S. St Francis Dr.  
Santa Fe, NM 87505

CONDITIONS

Action 393039

CONDITIONS

Operator: Contango Resources, LLC 3230 Camp Bowie Blvd FORT WORTH, TX 76107	OGRID: 330447
	Action Number: 393039
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Need C103Q and marker photo to release CBL is in files DHM set 9/31/24	10/28/2024