


District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

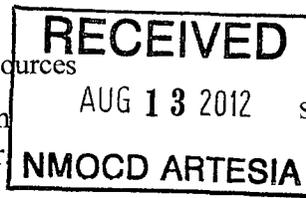

Form C-141  
Revised October 10, 2003  
Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

### Release Notification and Corrective Action

#### OPERATOR

Initial Report  Final Report

Name of Company Yates Petroleum Corporation	OGRID Number 25575	Contact Robert Asher
Address 105 S. 4 <sup>TH</sup> Street		Telephone No. 575-748-1471
Facility Name Stogey BLG State Com. #1-H	API Number 30-015-36305	Facility Type Battery

Surface Owner State	Mineral Owner State	Lease No. VA-6885
------------------------	------------------------	----------------------

#### LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
A	36	24S	27E	660	North	660	East	Eddy

Latitude 32.17895 Longitude 104.13718

#### NATURE OF RELEASE

Type of Release Produced Water	Volume of Release 75 B/PW	Volume Recovered 70 B/PW
Source of Release Poly line	Date and Hour of Occurrence 6/7/2011; PM	Date and Hour of Discovery 6/7/2011; PM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher/NMOCD II	
By Whom? Bob Asher/Yates Petroleum Corporation	Date and Hour 6/7/2011; PM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	

If a Watercourse was Impacted, Describe Fully.\*  
N/A

Describe Cause of Problem and Remedial Action Taken.\*

3" poly line on ruptured possibly due to an increase in main line pressure. Valves were isolated from main waterline. Vacuum trucks called.

Describe Area Affected and Cleanup Action Taken.\*

An approximate area of 6' X 400' (on production pad and of edge of pad). Vertical and horizontal delineation samples will be taken and analysis ran for TPH & BTEX (chlorides for documentation). If initial analytical results for TPH & BTEX are under RRAL's (site ranking is 10) a Final Report, C-141 will be submitted to the OCD requesting closure. If the analytical results are above the RRAL a work plan will be submitted to the OCD. Based on analytical results, work plan submitted to further excavate/haul impacted soils. **Depth to Ground Water: 50-99' (70', Section 22, T24S-R27E, NMOSE), Wellhead Protection Area: No, Distance to Surface Water Body: > 1000', SITE RANKING IS 10. Based on enclosed analytical results, impacted soils excavated/hailed, Yates Petroleum Corporation requests closure.**

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	<u>OIL CONSERVATION DIVISION</u>	
Printed Name: Robert Asher	Approved by District Supervisor:	
Title: Senior Environmental Regulatory Agent	Approval Date:	Expiration Date:
E-mail Address: boba@yatespetroleum.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: Monday, August 13, 2012 Phone: 575-748-4021	2RP-816	

\* Attach Additional Sheets If Necessary