


District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

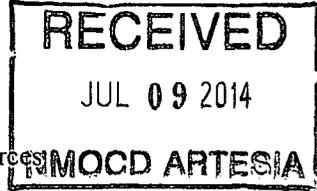

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

NAB1A20648311 OPERATOR Initial Report Final Report

Name of Company Yates Petroleum Corporation	25575	Contact Robert Asher
Address 104 S. 4 th Street		Telephone No. 575-748-4217
Facility Name Juniper BIP Federal #8H		Facility Type Well pad
Surface Owner Federal	Mineral Owner Federal	API No. 30-015-37252

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
L	4	24S	29E	1375	South	330	East	Eddy

Latitude 32.24311 Longitude 103.99716

NATURE OF RELEASE

Type of Release Crude Oil and Produced Water	Volume of Release 10 B/O & 5 B/PW	Volume Recovered 8 B/O & 3 B/PW
Source of Release Tubing	Date and Hour of Occurrence 6/27/2014; AM	Date and Hour of Discovery 6/27/2014; AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher/NMOCD II	
By Whom? Robert Asher/Yates Petroleum Corporation	Date and Hour 6/28/2014; AM (Email)	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

The gauge on the tubing blew out, causing the release. Gauge repaired; vacuum truck(s) and roustabout crew called.

Describe Area Affected and Cleanup Action Taken.*

An approximate area of 10' x 60'. Impacted area scraped and excavated soils hauled to a NMOCD approved facility. Vertical and horizontal delineation samples will be taken and analysis ran for TPH & BTEX (chlorides for documentation). If initial analytical results for TPH & BTEX are under RRAL's (site ranking is 10) a Final Report, C-141 will be submitted to the OCD requesting closure. If the analytical results are above the RRAL's a work plan will be submitted to the OCD. **Depth to Ground Water: 50-99' (approximately 75', Section 4, T24S-R29E, per Trend Map), Wellhead Protection Area: No, Distance to Surface Water Body: >1000', SITE RANKING IS 10.**

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	<u>OIL CONSERVATION DIVISION</u>	
Printed Name: Robert Asher	Approved by Environmental Specialist:	
Title: NM Environmental Regulatory Supervisor	Approval Date: <u>7/28/14</u>	Expiration Date: <u>NA</u>
E-mail Address: boba@yatespetroleum.com	Conditions of Approval: remediation per OCD Rule & Guidelines, & like approval by BLM. SUBMIT REMEDIATION	Attached <input type="checkbox"/>
Date: _____ Phone: 575-748-4217		

* Attach Additional Sheets If Necessary

PROPOSAL NO LATER THAN:

8/28/14

RP2-2394

Bratcher, Mike, EMNRD

From: Tanna Adams <TCArms@yatespetroleum.com>
Sent: Wednesday, July 09, 2014 3:18 PM
To: Bratcher, Mike, EMNRD
Cc: Bob Asher
Subject: Juniper BIP Federal #8H
Attachments: Juniper BIP Federal #8H.pdf

Mr. Bratcher,

Please find attached the signed C141 Initial for the below listed location:

Juniper BIP Federal #8H
30-015-37252
Section 4, T24S-R29E
1375 FSL & 330 FEL
Eddy County, New Mexico

Thank you,

Tanna Adams
Yates Petroleum Corporation
Environmental Tech
Environmental Department
TCArms@yatespetroleum.com

This message may contain confidential information and is intended for the named recipient only. If you are not the intended recipient you are notified that disclosing, copying, distributing or taking any action in reliance on the contents of this information is strictly prohibited. E-mail transmission cannot be guaranteed to be secure or error-free as information could be intercepted, corrupted, lost, destroyed, arrive late or incomplete, or contain viruses. The sender therefore does not accept liability for any errors or omissions in the contents of this message, which arise as a result of e-mail transmission. If verification is required please request a hard-copy version.
