

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company	Cooper SWD Station	Contact	Eddie W Seay
Address	Box 55 Monument	Telephone No.	575-390-2454
Facility Name		Facility Type	SWD

Surface Owner	Jim Cooper	Mineral Owner	J. Cooper	Lease No.	
---------------	------------	---------------	-----------	-----------	--

API# 30.025.06017.00.00

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
G	8	20	37	1980	N	1980	E	lea

Latitude 32° 35' 25" Longitude 103° 14' 18"

NATURE OF RELEASE

Type of Release	BS + Iron and salt water	Volume of Release	150	Volume Recovered	12 P
Source of Release	4 in valve broke	Date and Hour of Occurrence		Date and Hour of Discovery	
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	6 am 8/25		
By Whom?	Eddie W Seay	Date and Hour			
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

4 in valve at bottom of skimmer tank broke, iron sulfide, water + BS ran out across drive into low spot in pasture. Repaired valve + began vacuum up tanks.

Describe Area Affected and Cleanup Action Taken.*

area in pasture 25 x 35, vacuum Truck cleaning up. will file Work Plan and remediate

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: Eddie W Seay	OIL CONSERVATION DIVISION	
Printed Name: Eddie W Seay	Approved by District Environmental Engineer	
Title: Agent	Approval Date: 8.27.08	Expiration Date: 9.29.08
E-mail Address: seay.04@leaco.net	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 8/26/2008 Phone: 390-2454	SUBMIT FINAL C-141	IRP#1939

* Attach Additional Sheets If Necessary

w/ Documentation BY

FGRL 0824240499

COOPER DISPOSAL
Unit G, Sect. 8, Tws. 20 S., Rng. 37 E.
Monument, NM

WORKPLAN

RECEIVED
AUG 27 2008
HOBBS OCD

Prepared By
Eddie Seay Consulting
August 2008

WORKPLAN

General:

Leak occurred 8/25/08, notice was given to OCD immediately. Vacuum trucks were on location and began cleaning up. All fluids available were picked up and hauled to Sundance Disposal. We recovered approximately 128 bls. Valve in tank was replaced and cleanup around tank and drive area was started.

Groundwater:

According to the State Engineers records, groundwater occurs at a depth of approximately 30 ft. The groundwater in this area has elevated chloride of approximately 2000 ppm.

Cleanup Proposal:

Sample area for BTEX, TPH and Chloride. Excavate spill area until a cleanup level approved by the OCD is achieved. Install a clay barrier at bottom of excavation, backfill and level, only after OCD approves.

Cleanup level based on groundwater 100 ppm TPH.

All analysis, photos and report will be sent to the OCD.

We will notify the OCD of all activities. If this meets with your approval, we will begin immediately.

Thanks.

August 26, 2008

NMOCD

ATTN: ~~Chris Williams~~ Larry Johnson
1625 N. French Drive
Hobbs, NM 88240-1750


RE: Cooper SWD
Unit G, Sect. 8, Tws. 20 S., Rng. 37 E.

Mr. Williams:

Find attached workplan for the remediation of the SWD spill at the above listed facility. Most all of the fluids were heavy bottoms and iron, all settling in the South side of the facility in an area 25' x 35', the land is owned by Mr. Cooper.

If you have any questions, please call.

Thanks,

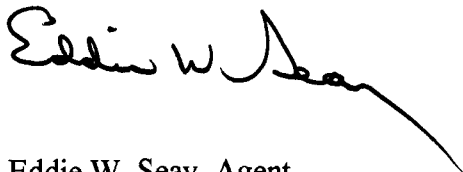

Eddie W. Seay, Agent
Eddie Seay Consulting
601 W. Illinois
Hobbs, NM 88242
(575)392-2236
Seay04@leaco.net

cc: Cooper SWD

