

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

30-005-63684

Release Notification and Corrective Action

n MCB 0914637432

OPERATOR

☒ Initial Report ☐ Final Report

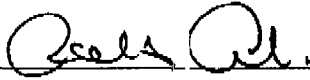
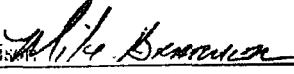
Name of Company Yates Petroleum Corporation	OGRID Number 25575	Contact Robert Asher
Address 104 S. 4 TH Street	Telephone No. 505-748-1471	
Facility Name Borfin State Unit #1	API Number 30-005-63684	Facility Type Battery
Surface Owner State	Mineral Owner State	Lease No. VA-2055

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
J	16	9S	27E	1500	South	1500	East	Chaves

Latitude 33.52916 Longitude 104.19436

NATURE OF RELEASE

Type of Release Oil	Volume of Release 186 B/O	Volume Recovered 140 B/O
Source of Release Circulating Pump	Date and Hour of Occurrence 4/23/2009 - PM	Date and Hour of Discovery 4/24/2008 - AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher/NMOCD (voicemail and e-mail, 4/24/2009)	
By Whom? Robert Asher/YPC Environmental	Date and Hour 4/24/2009 - AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	
If a Watercourse was Impacted, Describe Fully.* N/A		
Describe Cause of Problem and Remedial Action Taken.* Oil released from circulating pump that was stolen off of location, a valve from production tank was opened after pump was removed. Vacuum truck called.		
Describe Area Affected and Cleanup Action Taken.* An approximate area of 70' X(30)' (all inside bermed battery). Vacuum truck picked up remaining oil. Vertical and horizontal delineation samples have been taken and analyses run for TPH & BTEX. Based on results, Yates will remove 12" of impacted soil and take to an OCD approved facility. Vertical and horizontal delineation samples will be taken and analyses run for TPH & BTEX to verify that excavation area is below RRAL's for the site ranking. Depth to Ground Water: >50-99' (approximately 70' per trend map), Wellhead Protection Area: No, Distance to Surface Water Body: >1000', SITE RANKING IS 10.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		
Signature: 		OIL CONSERVATION DIVISION
Printed Name: Robert Asher		Approved by District Director: 
Title: Environmental Regulatory Agent		Approval Date: MAY 26 2009
E-mail Address: hoba@yatespetroleum.com		Expiration Date: N/A
Date: Friday, May 01, 2009 Phone: 505-748-4217		Conditions of Approval: REMEDIATION PER NMOCD RULES & GUIDELINES
		Attached <input type="checkbox"/>

* Attach Additional Sheets If Necessary

2RP-312