

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-38576 and 30-025-42139
5. Indicate Type of Lease STATE [X] FEE []
6. State Oil & Gas Lease No. V07530-0001
7. Lease Name or Unit Agreement Name Linam AGI
8. Wells Number 1 and 2
9. OGRID Number 36785
10. Pool name or Wildcat Wildcat
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3736 GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)
1. Type of Well: Oil Well [] Gas Well [X] Other
2. Name of Operator DCP Midstream LP
3. Address of Operator 370 17th Street, Suite 2500, Denver CO 80202
4. Well Location Unit Letter K; 1980 feet from the South line and 1980 feet from the West line
Section 30 Township 18S Range 37E NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3736 GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK [] PLUG AND ABANDON []
TEMPORARILY ABANDON [] CHANGE PLANS []
PULL OR ALTER CASING [] MULTIPLE COMPL []
DOWNHOLE COMMINGLE []
OTHER: []
SUBSEQUENT REPORT OF:
REMEDIAL WORK [] ALTERING CASING []
COMMENCE DRILLING OPNS. [] P AND A []
CASING/CEMENT JOB []
OTHER: Monthly Report pursuant to Workover C-103 [X]

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Report for the Month ending January 31, 2021 Pursuant to Workover C-103 for Linam AGI#1 and AGI#2

This is the 105th monthly submittal of data as agreed to between DCP and OCD relative to injection pressure, TAG temperature and casing annulus pressure and bottom hole data for Linam AGI#1. Since the data for both wells provide the best overall picture of the performance of the AGI system, the data for both wells is analyzed and presented herein even though that analysis is required only on a quarterly basis for AGI #2.

Only AGI #1 was in use this month and AGI#2 was not used at all this month and had no flow directed to it. Injection parameters being monitored for AGI #1 were as follows (Figures #1, #2, #3 & #4): Average Injection Rate 213,680 scf/hr, Average TAG Injection Pressure: 1691 psig, Average TAG Temperature: 110°F, Average Annulus Pressure: 15 psig, Average Pressure Differential: 1676 psig. Bottom hole sensors provided the average BH pressure for the entire period of 4523 psig and BH temperature of 136°F (Figures #8 & #9).

AGI #2 was not used this month (see Figures #5, #6 & #7). Injection parameters for AGI #2 for the month were: Average Injection Rate 0 scf/hr, Average Injection Pressure: 1237 psig, Average TAG Temperature: 61°F, Average Annulus Pressure: 135 psig, Average Pressure Differential: 1102 psig. There was an unexplained rise in annular pressure for several hours on 1/12 which appears related to corresponding drop in temperature and may have affected the reliability of the sensor for this period. Clearly this didn't represent any issue with the well but rather behavior of the tubing and annulus pressure in response to temperature fluctuation. Bottom Hole Sensors in AGI #2 are not operating because they were damaged in a lightning strike shortly after AGI #2 was commissioned. However, because the injection zones for AGI #1 and AGI #2 are only about 450 feet apart, the bottom hole readings for AGI #1 are reflective of the general reservoir conditions for both wells.

The Linam AGI#1 and AGI #2 wells are serving as safe, effective and environmentally-friendly system to dispose of Class II wastes consisting of H2S and CO2. The two wells provide the required redundancy to the plant that allows for operation with disposal to either or both wells. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Consultant to DCP Midstream/ Geolex, Inc. DATE 2/9/2021
Type or print name Alberto A. Gutierrez, RG E-mail address: aag@geolex.com PHONE: 505-842-8000

For State Use Only

APPROVED BY: TITLE DATE
Conditions of Approval (if any):

Figure #1: Linam AGI#1 and #2 Combined TAG Injection Flow Rate

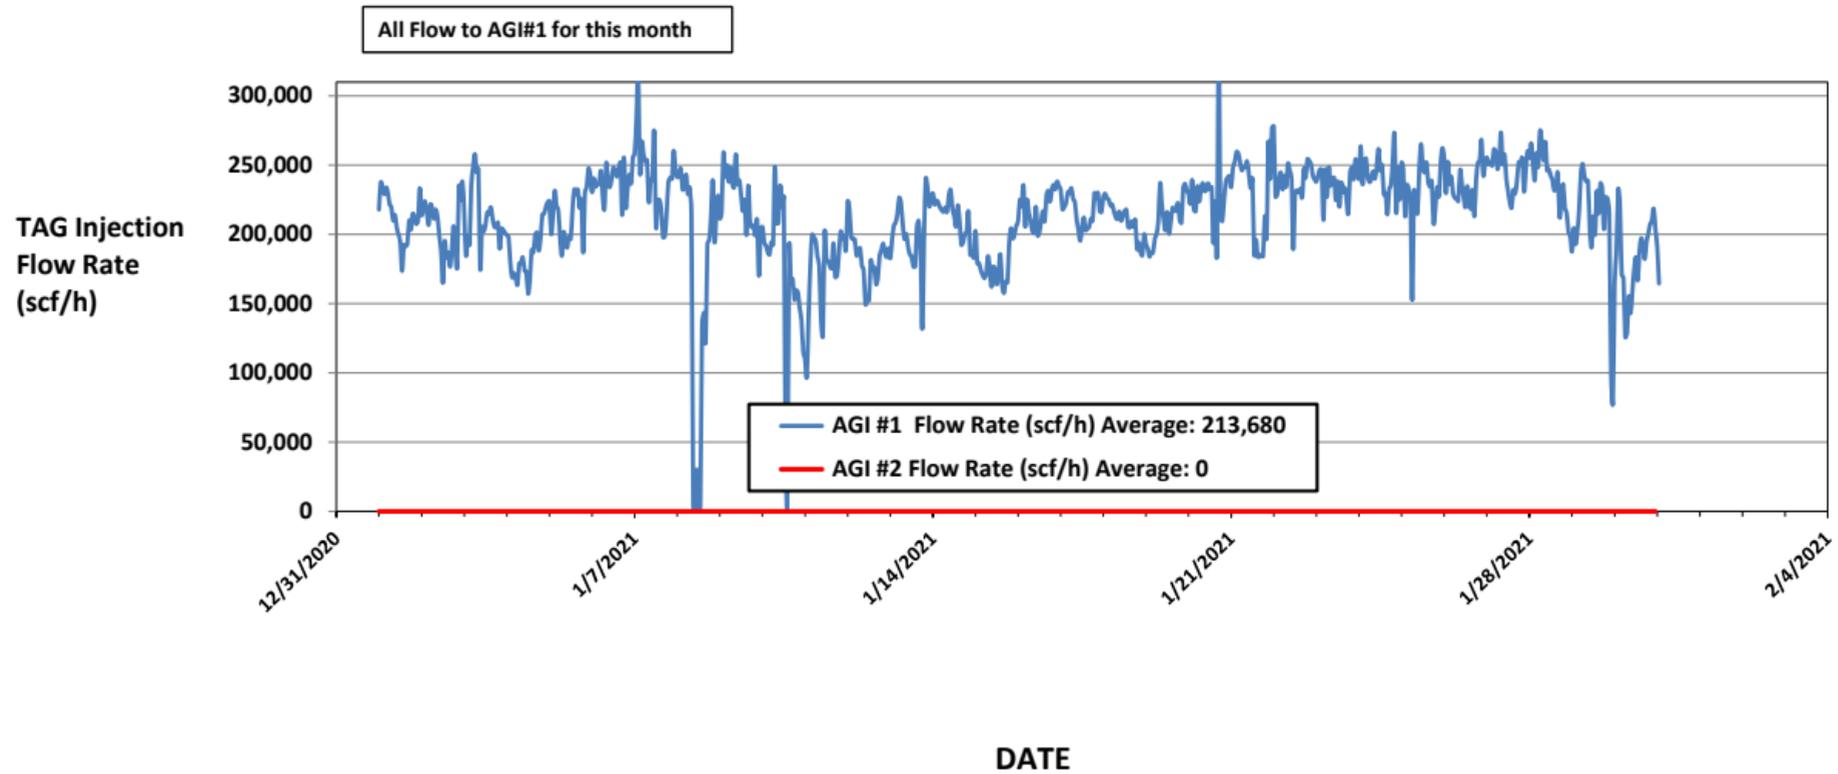


Figure #2: Linam AGI #1 Surface TAG Injection Pressure and Annular Pressure

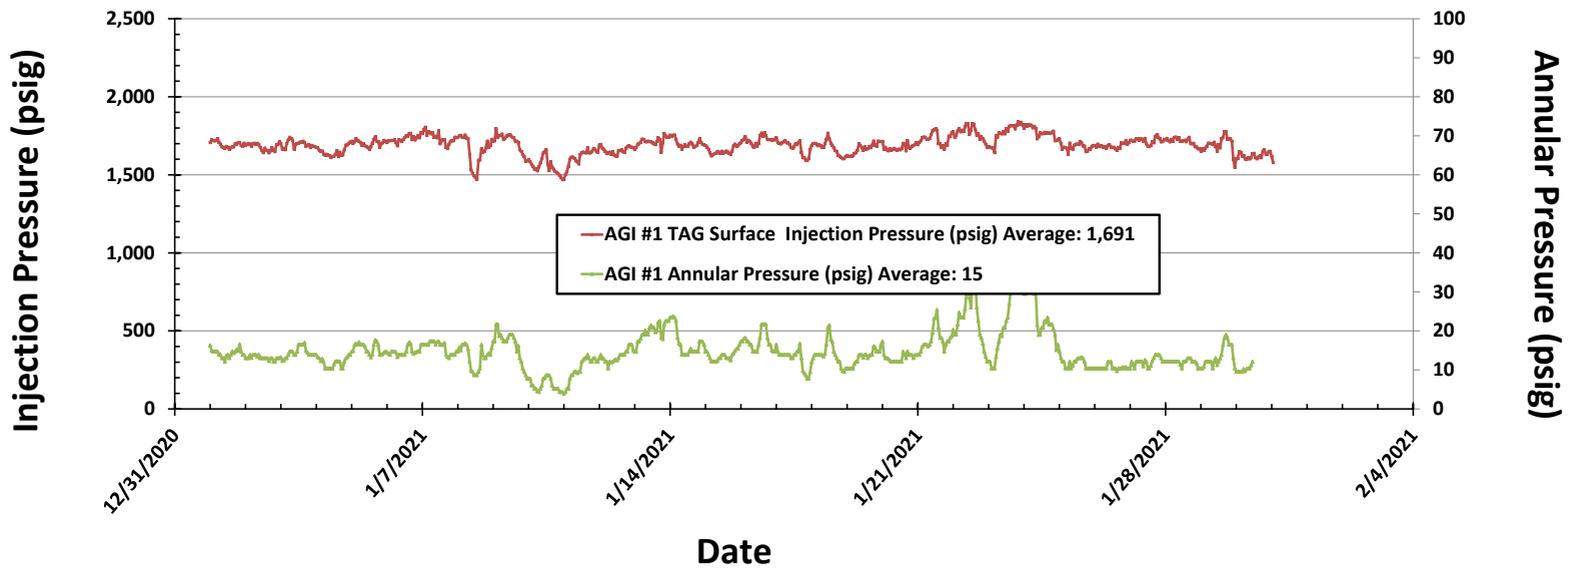


Figure #3: Linam AGI #1 TAG Injection Pressure, Casing Annulus Pressure and TAG Injection Temperature

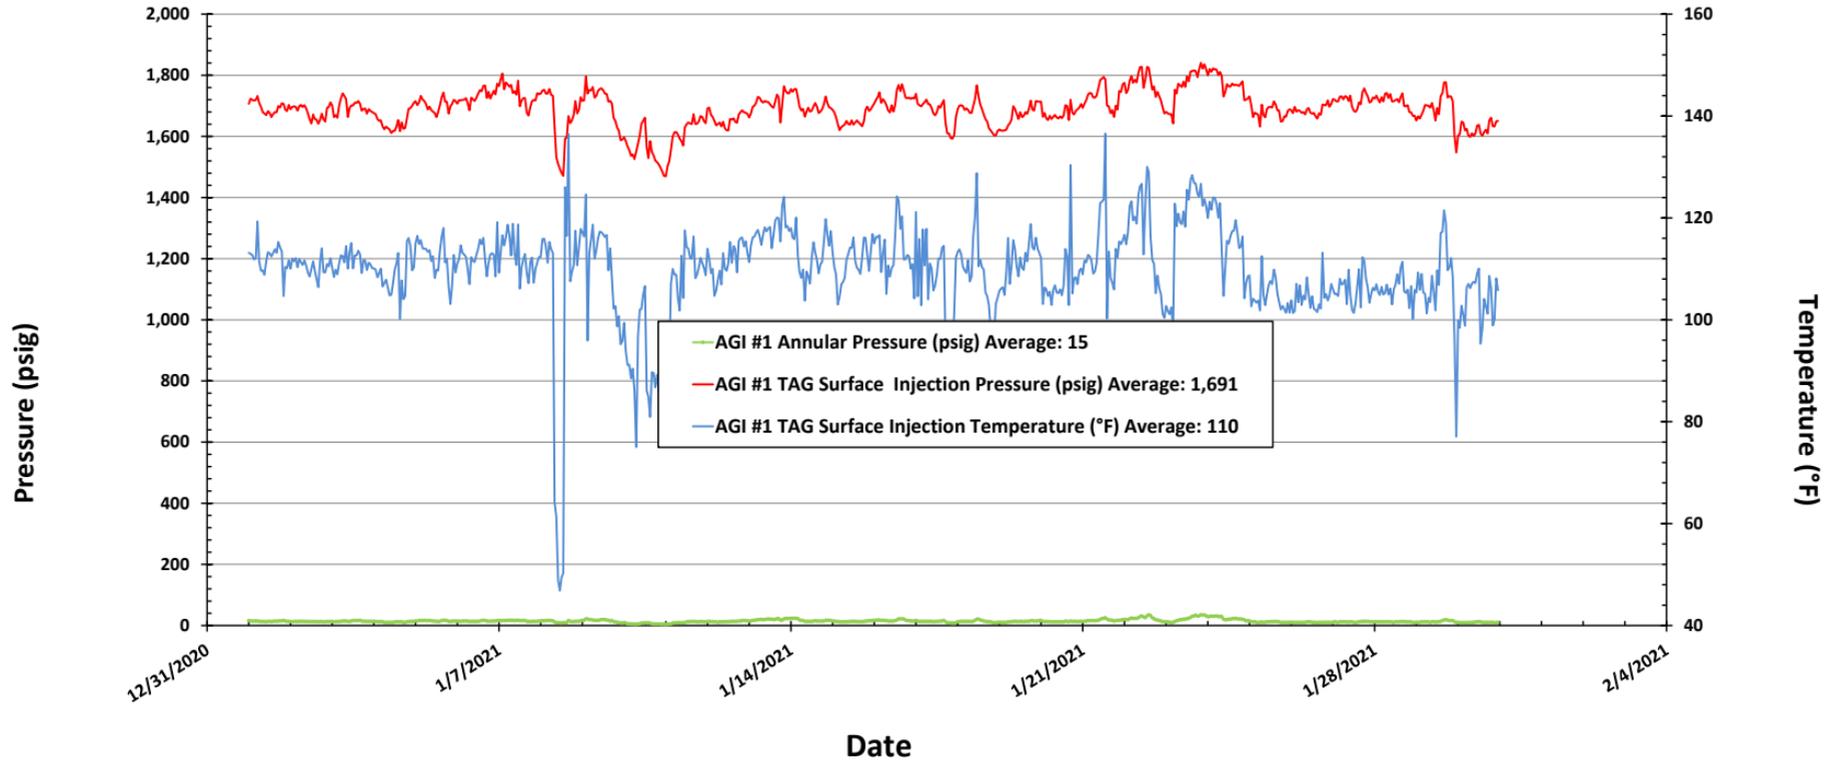


Figure #4: Linam AGI #1 TAG Injection Pressure and Casing Annular Pressure Differential (psig)

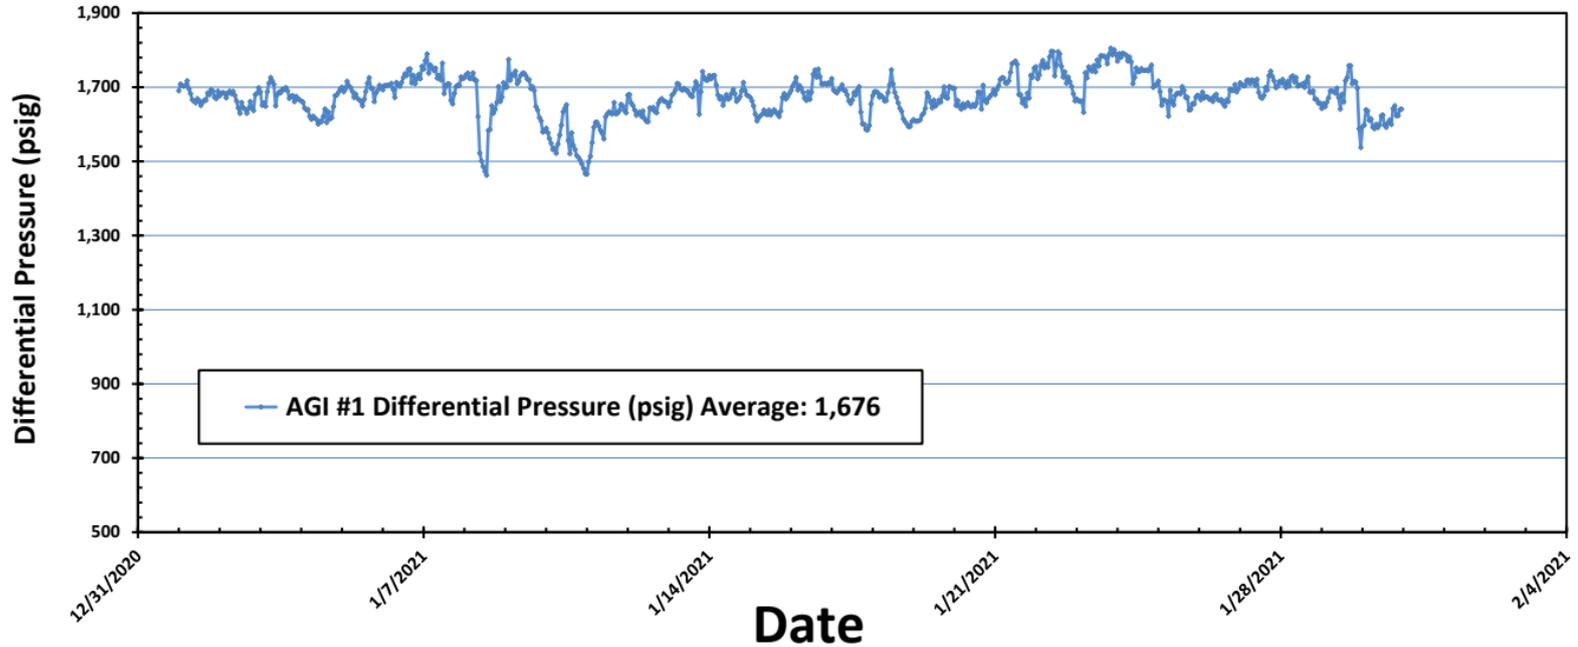


Figure #5: Linam AGI #2 Injection Pressure, Rate and Casing Annulus Pressure

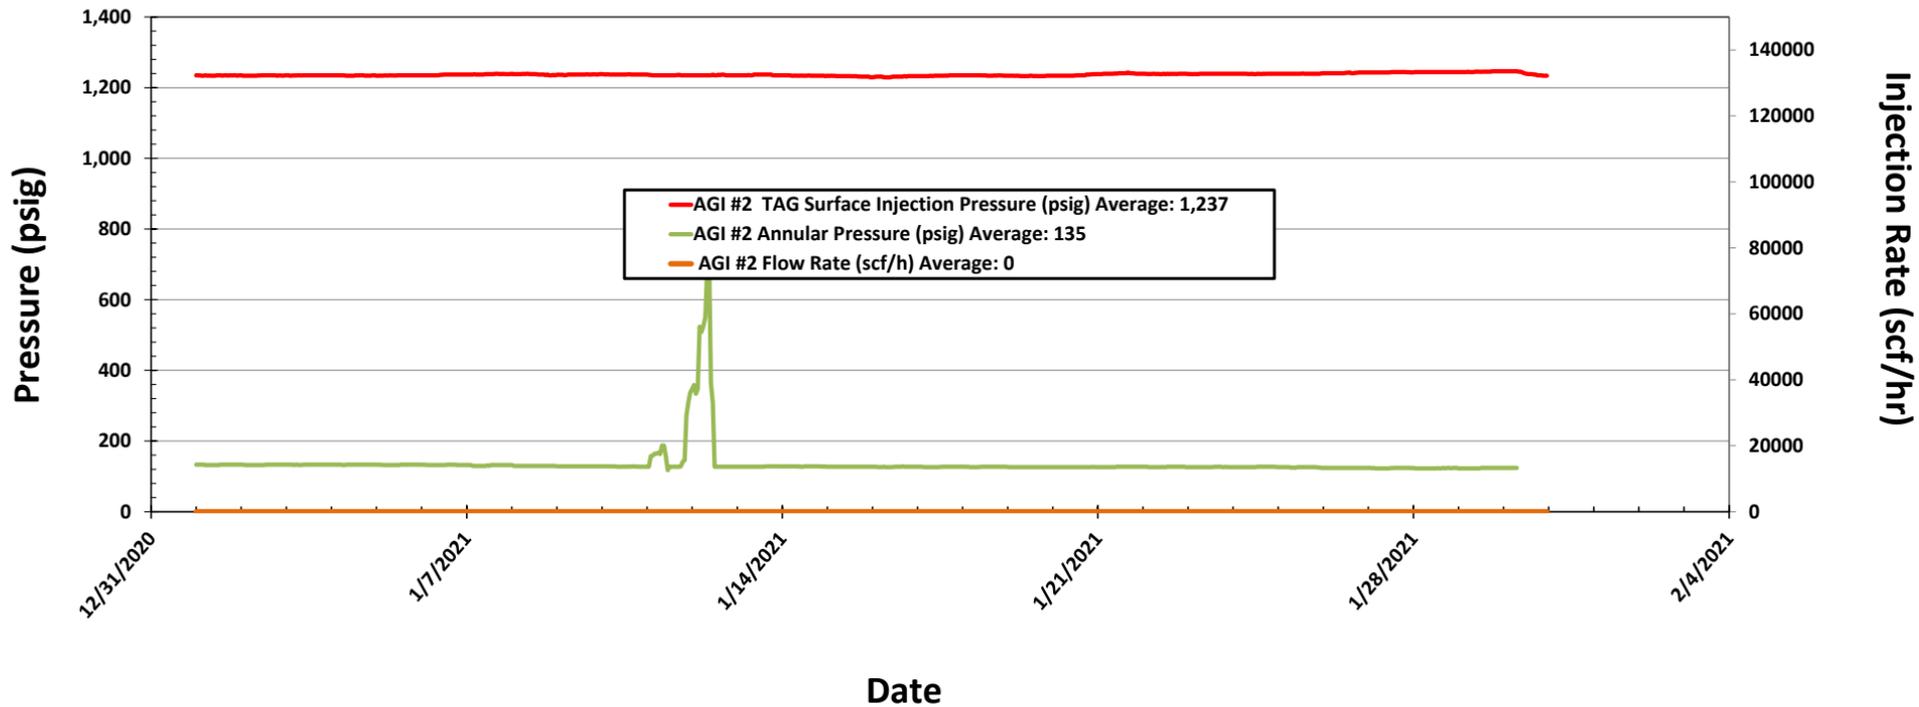


Figure #6: Linam AGI #2 TAG Injection Pressure, Casing Annulus Pressure and TAG Injection Temperature

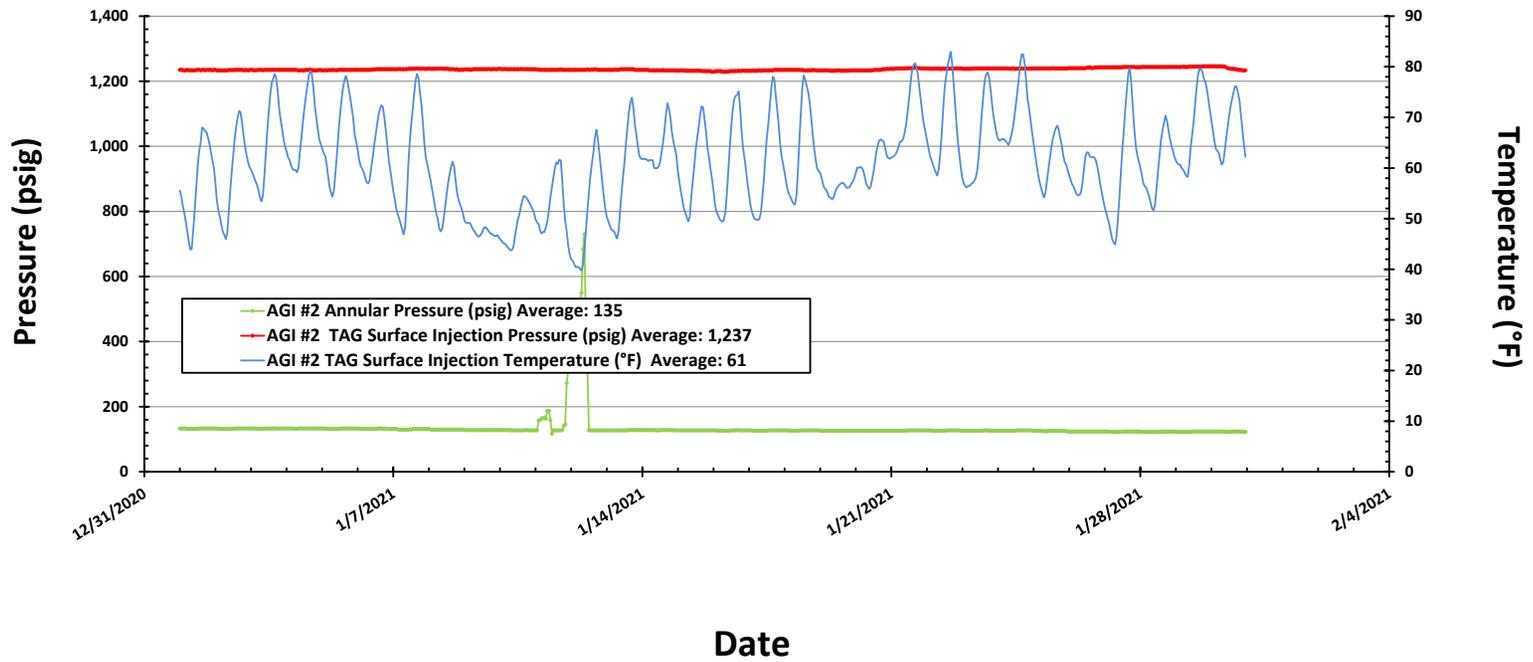


FIGURE #7: LINAM AGI #2 TAG INJECTION PRESSURE AND CASING ANNULAR PRESSURE DIFFERENTIAL (PSIG)

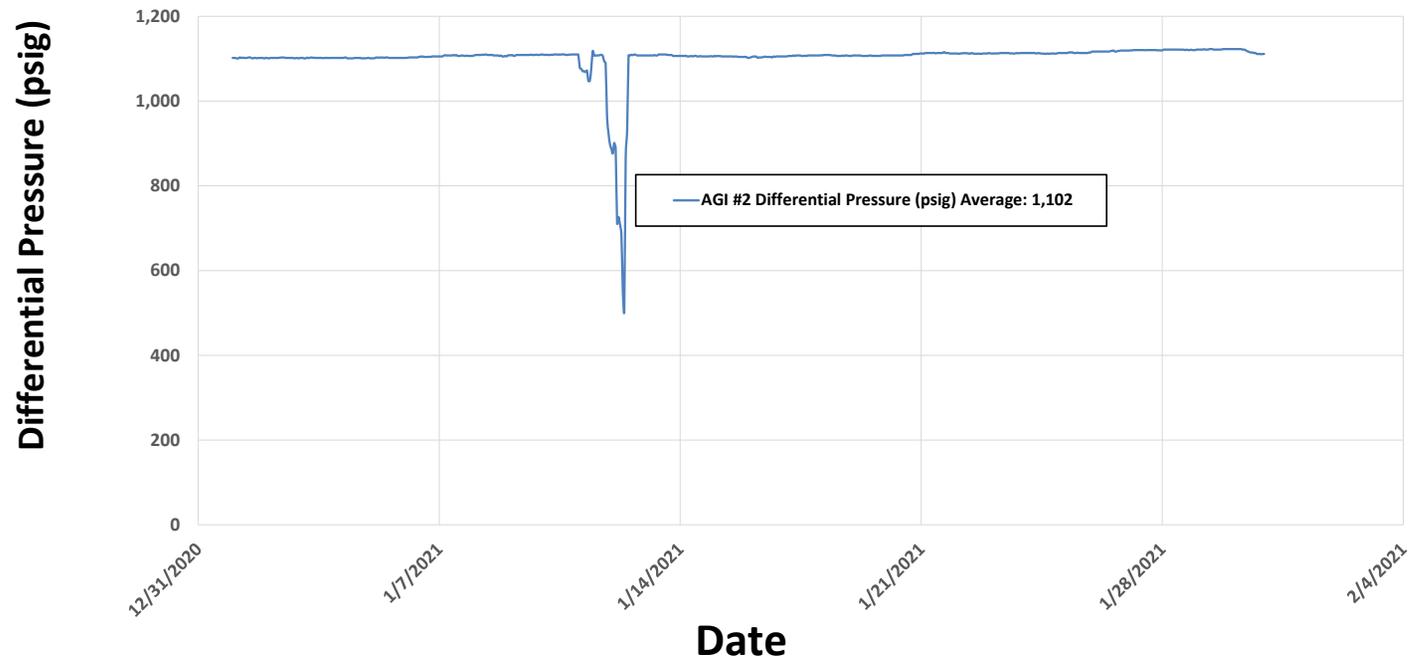


Figure #8: Linam AGI #1 Bottom Hole Pressure and Temperature

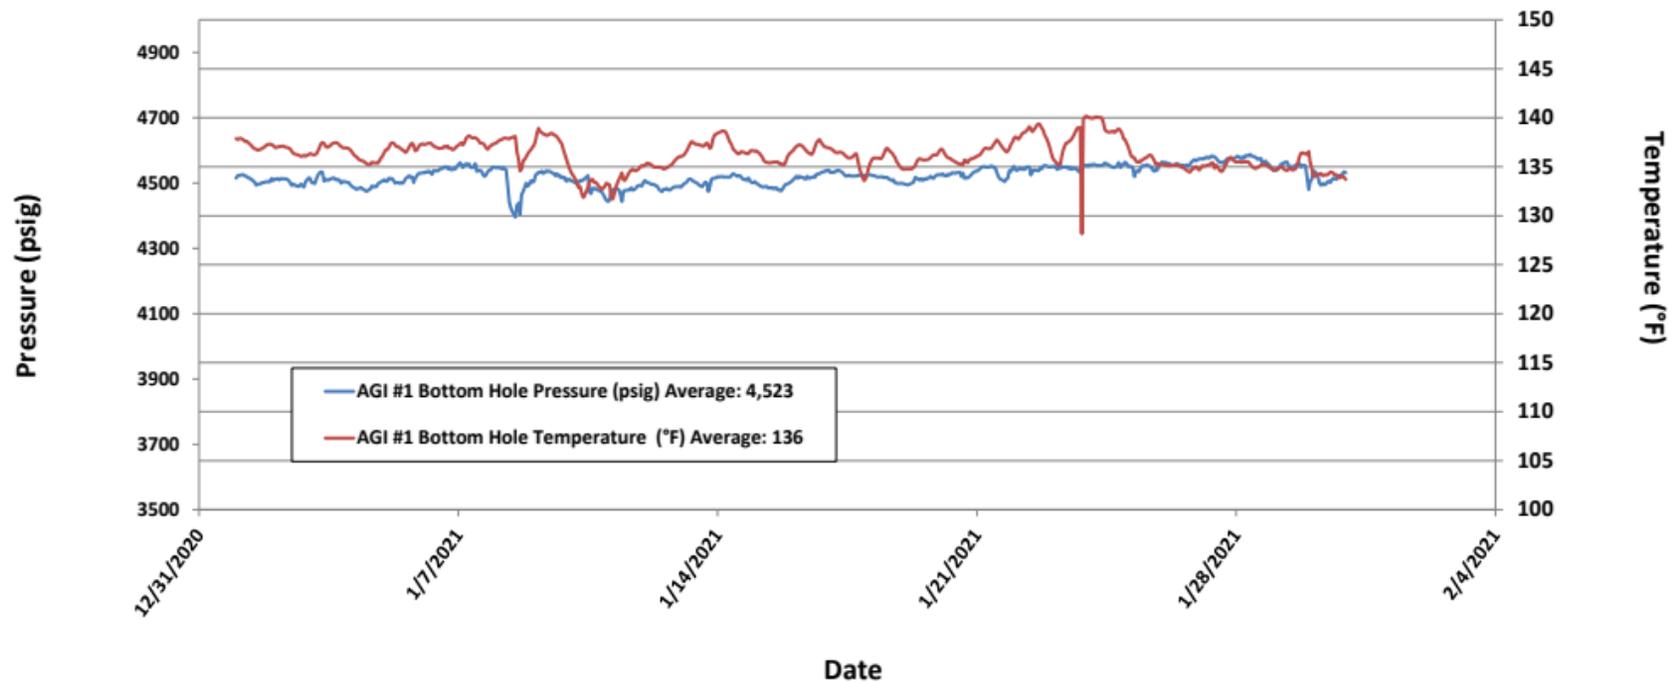


Figure 9: Linam AGI #1 Surface Injection Pressure and Bottom Hole Pressure

