

1R - 426-6

REPORTS

DATE:

6/02/2003

1R-426-6

DISCLOSURE REPORT

**RICE OPERATING COMPANY
JUNCTION BOX DISCLOSURE* REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
Blinebry-Drinkard	Brunson EOL	P	4	22 S	37 E	Lea	Length	Width	Depth
							Moved 40' west		

LAND TYPE: BLM _____ STATE _____ FEE LANDOWNER _____ Priscilla West _____ OTHER _____

Depth to Groundwater _____ 93 _____ feet NMOCD SITE ASSESSMENT RANKING SCORE: _____ 10 _____

Date Started _____ 4/14/2003 _____ Date Completed _____ 4/23/2003 _____ OCD Witness _____ No _____

Soil Excavated _____ 400 _____ cubic yards Excavation Length _____ 30 _____ Width _____ 30 _____ Depth _____ 12 _____ feet

Soil Disposed _____ 0 _____ cubic yards Offsite Facility _____ n/a _____ Location _____ n/a _____

FINAL ANALYTICAL RESULTS: Sample Date _____ 4/21/2003 _____ Sample Depth _____ 12' bgs _____

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH, BTEX and Chloride laboratory test results completed by using an approved lab and testing procedures pursuant to NMOCD guidelines.

Sample Location	Benzene mg/kg	Toluene mg/kg	Ethyl Benzene mg/kg	Total Xylenes mg/kg	GRO mg/kg	DRO mg/kg	Chlorides mg/kg
SIDEWALLS	<0.025	<0.025	<0.025	<0.025	<10.0	<10.0	1950
BOTTOM	<0.025	<0.025	<0.025	<0.025	<10.0	102	3650
REMEDIATED	<0.025	<0.025	<0.025	<0.025	<10.0	131	1100

General Description of Remedial Action: The junction box location was delineated vertically and laterally producing a 30' x 30' x 12' bgs excavation. TPH was well below NMOCD guidelines, while chloride concentrations were relatively consistent. A 20 mil poly liner was installed at the bottom of the excavation and extended up the walls to impede impact migration. The hole was then backfilled with the excavated soil that was landfarmed onsite. A new watertight junction box has been built about 40' west of this location. The disturbed area has been re-seeded with native vegetation and will be monitored for growth.

CHLORIDE FIELD TESTS

LOCATION	DEPTH (ft)	ppm
Vertical	5	2200
	9	2750
	12	3500
15' N	12	3300
15'S	12	2450
15'E	12	2800
15'W	12	1700
Wall Comp.	n/a	1700
Bottom Comp.	12	3000
Remed. Comp.	n/a	1100

cc: lab results, photos, diagrams

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.


DATE _____ 6/2/2003 _____ PRINTED NAME _____ Kristin Farris _____

SIGNATURE _____ *Kristin Farris* _____ TITLE _____ Project Scientist _____

* This site is a "DISCLOSURE." It will be placed on a prioritized list of similar sites for further consideration.

BD Brunson EOL

30' x 30' x 12' Excavation

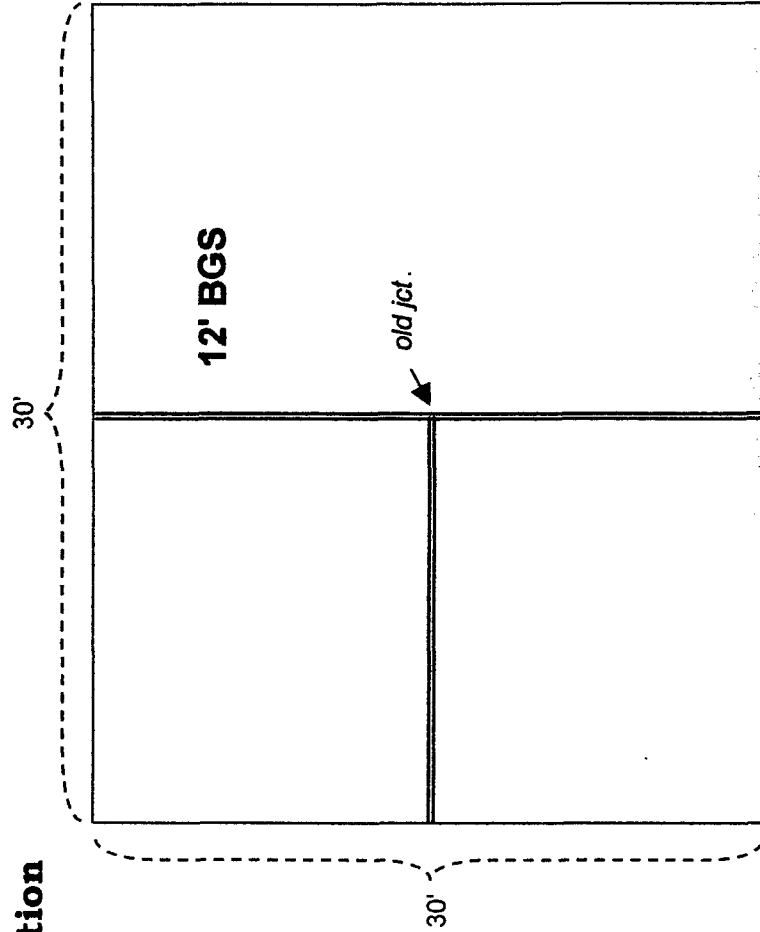



new jct. 40' west
↓

old jct.
↙

poly customer line
→

BATTERY

**BD Brunson EOL
Impact Excavation
Cross-Section**

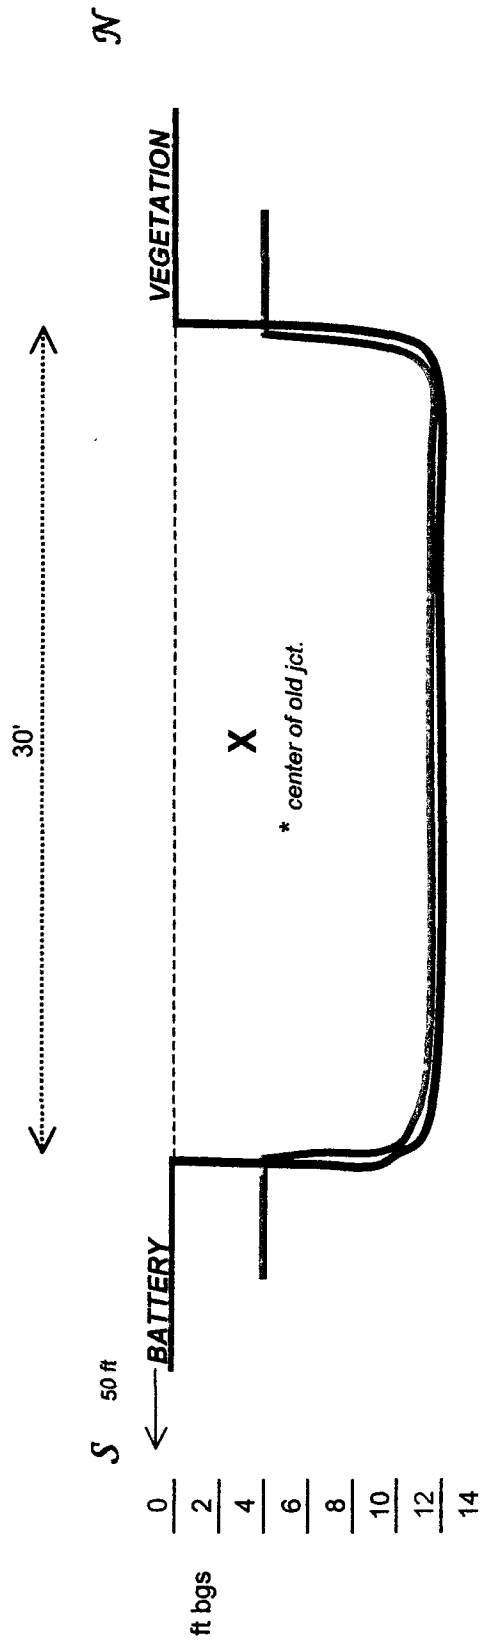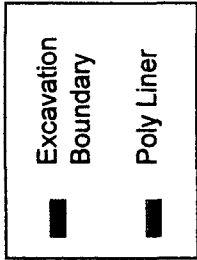

SURFACE HAS BEEN RE-SEEDED WITH NATIVE VEGETATION

* New junction is located 40 ft west

BD Brunson EOL



Excavation



Installation of Poly Liner

BD Brunson EOL



Backfilled



New Junction Box Construction (40' west of excavation)

May 16, 2003

BD Brunson EOL

SEEDING



CHLORIDE CONCENTRATION CURVE


RICE Operating Company

BD Brunson EOL

UL 'P', Sec. 4, T22S, R37E

Depth bgs (ft)	[Cl-] ppm
5	2200
7	2000
9	2750
11	3100
12	3500

Groundwater = 93 ft

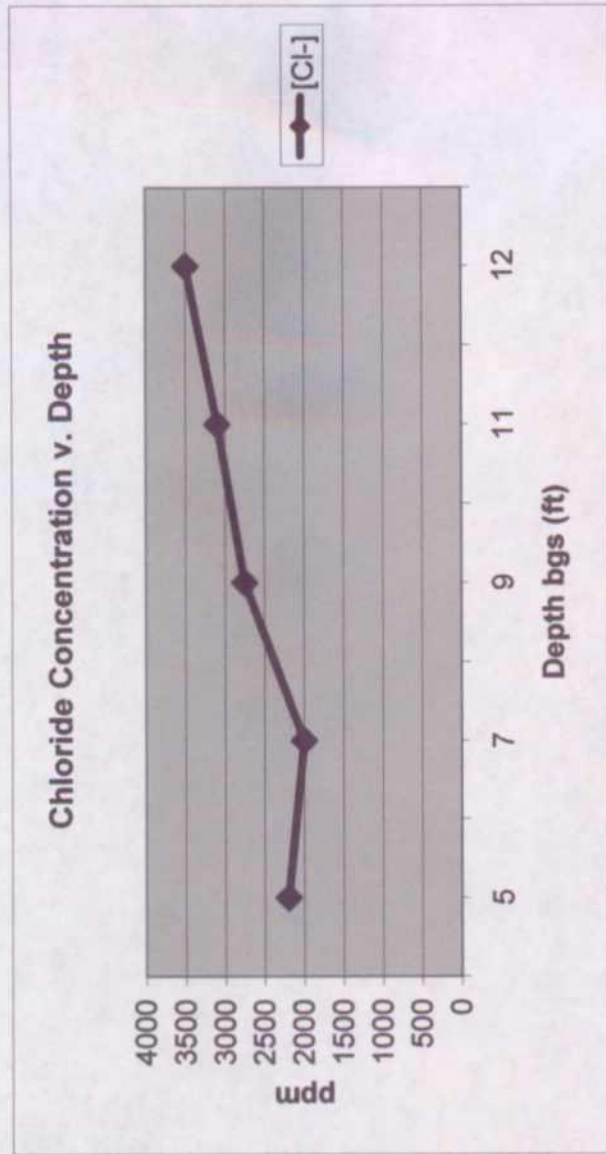

ANALYTICAL REPORT

Prepared for:

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Project: Texaco Brunson EOL

PO#:

Order#: G0306330

Report Date: 04/29/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

Rice Operating
122 W. Taylor
Hobbs, NM 88240
505-397-1471

Order#: G0306330
Project:
Project Name: Texaco Brunson EOL
Location: BD

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u> <u>Collected</u>	<u>Date / Time</u> <u>Received</u>	<u>Container</u>	<u>Preservative</u>
0306330-01	Rem. Pile Comp.	SOIL	4/23/03 12:00	4/24/03 10:20	4 oz glass	Ice
	<u>Lab Testing:</u>	Rejected: No		Temp: 3.0 C		
	8015M					
	8021B/5030 BTEX					
	Chloride					

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306330
Project:
Project Name: Texaco Brunson EOL
Location: BD

Lab ID: 0306330-01
Sample ID: Rem. File Comp.

8015M

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
		4/24/03	1	1	CK	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	131	10.0
TOTAL, C6-C35	131	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	97%	70	130
1-Chlorooctadecane	86%	70	130

8021B/5030 BTEX

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
0005320-02		4/24/03 19:38	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	93%	80	120
Bromofluorobenzene	99%	80	120

Approval:

Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date

Raland K. Tuttle 4-29-03

DL = Diluted out N/A = Not Applicable RL = Reporting Limit

Page 1 of 1

ENVIRONMENTAL LAB OF TEXAS I, LTD.

12600 West I-20 East, Odessa, TX 79765 Ph: 915-563-1800

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306330
Project:
Project Name: Texaco Brunson EOL
Location: BD

Lab ID: 0306330-01
Sample ID: Rem. Pile Comp.

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	1100	mg/kg	1	20	9253	4/28/03	SB

Approval:

Raland K. Tuttle 4-29-03
Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date *PT*

RL = Reporting Limit N/A = Not Applicable

Page 1 of 1

ENVIRONMENTAL LAB OF TEXAS I, LTD.

12600 West I-20 East, Odessa, TX 79765 Ph: 915-563-1800

ENVIRONMENTAL LAB OF TEXAS**QUALITY CONTROL REPORT****8015M****Order#: G0306330**

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005326-02			<10.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0306328-04	0	952	796	83.6%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0306328-04	0	952	786	82.6%	1.3%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005326-05		1000	815	81.5%	

ENVIRONMENTAL LAB OF TEXAS**QUALITY CONTROL REPORT****8021B/5030 BTEX****Order#: G0306330**

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005320-02			<0.025		
Toluene-mg/kg		0005320-02			<0.025		
Ethylbenzene-mg/kg		0005320-02			<0.025		
p/m-Xylene-mg/kg		0005320-02			<0.025		
o-Xylene-mg/kg		0005320-02			<0.025		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306328-04	0	0.1	0.096	96.0%	
Toluene-mg/kg		0306328-04	0	0.1	0.093	93.0%	
Ethylbenzene-mg/kg		0306328-04	0	0.1	0.091	91.0%	
p/m-Xylene-mg/kg		0306328-04	0	0.2	0.186	93.0%	
o-Xylene-mg/kg		0306328-04	0	0.1	0.088	88.0%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306328-04	0	0.1	0.102	102.0%	6.1%
Toluene-mg/kg		0306328-04	0	0.1	0.099	99.0%	6.3%
Ethylbenzene-mg/kg		0306328-04	0	0.1	0.097	97.0%	6.4%
p/m-Xylene-mg/kg		0306328-04	0	0.2	0.199	99.5%	6.8%
o-Xylene-mg/kg		0306328-04	0	0.1	0.095	95.0%	7.7%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005320-05		0.1	0.107	107.0%	
Toluene-mg/kg		0005320-05		0.1	0.105	105.0%	
Ethylbenzene-mg/kg		0005320-05		0.1	0.100	100.0%	
p/m-Xylene-mg/kg		0005320-05		0.2	0.205	102.5%	
o-Xylene-mg/kg		0005320-05		0.1	0.095	95.0%	

ENVIRONMENTAL LAB OF TEXAS**QUALITY CONTROL REPORT****Test Parameters**

Order#: G0306330

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005346-01			<20.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306331-01	372	500	851	95.8%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306331-01	372	500	868	99.2%	2.0%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005346-04		5000	4960	99.2%	

Environmental Lab of Texas I, Ltd.

12600 West 1-20 East
Odessa, Texas 79763

Phone: 915-563-1800
Fax: 915-563-1713

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

Project Manager:

Kristh Farris

Company Name

Rice

Company Address:

122 W Taylor

City/State/Zip:

Hocks, NM 88240

Telephone No:

Fax No:

Sampler Signature:

[Signature]

Project Name:

Texaco Drilling EOL

Project #:

Project Loc:

BD

PO #:

0306330

LAB # (lab use only)

01

FIELD CODE

Kem. Aile Comp.

Date Sampled

4-23-03

Time Sampled

12:00P

No. of Containers *402 glass*

Preservative

Matrix

Ice

HNO₃

HCl

NaOH

H₂SO₄

None

Other (Specify)

Water

Sludge

Soil

Other (specify):

TPH: 418.1 1015M 1005 1006

Cations (Ca, Mg, Na, K)

Anions (Cl, SO₄, CO₃, HCO₃)

SAR / ESP / CEC

Metals: As Ag Ba Cd Cr Pb Hg Se

Volatiles

Semivolatiles

BTEX 8021B/5030

RCI

N.O.R.M.

Total Gamma

RUSH TAT (Pre-Schedule)

Standard TAT

Special Instructions

Fax to Rice

Relinquished by:

[Signature]

Date

4-23-03

Time

Received by:

[Signature]

Date

4/23/03

Time

1020

Relinquished by:

Date

Time

Received by:

Date

Time

Sample Containers Intact?

Y N

Temperature Upon Receipt:

30°C

Laboratory Comments:

ANALYTICAL REPORT

Prepared for:

**Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240**

Project: Texaco Brunson EOL

PO#:

Order#: G0306319

Report Date: 04/29/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

Rice Operating
122 W. Taylor
Hobbs, NM 88240
505-397-1471

Order#: G0306319
Project:
Project Name: Texaco Brunson EOL
Location: BD

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u> <u>Collected</u>	<u>Date / Time</u> <u>Received</u>	<u>Container</u>	<u>Preservative</u>
0306319-01	5 pt. Bottom Comp. @ 12'	SOIL	4/21/03	4/22/03	4 oz glass	Ice
			13:00	14:42		
			Temp: 8.0 C			
			Rejected: No			
			<u>Lab Testing:</u>			
8015M						
8021B/5030 BTEX						
Chloride						
0306319-02	Wall Comp.	SOIL	4/21/03	4/22/03	4 oz glass	Ice
			13:00	14:42		
			Temp: 8.0 C			
			Rejected: No			
			<u>Lab Testing:</u>			
8015M						
8021B/5030 BTEX						
Chloride						

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306319
Project:
Project Name: Texaco Brunson EOL
Location: BD

Lab ID: 0306319-01
Sample ID: 5 pt. Bottom Comp. @ 12'

8015M

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
		4/22/03	1	1	WL	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	102	10.0
TOTAL, C6-C35	102	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	104%	70	130
1-Chlorooctadecane	89%	70	130

8021B/5030 BTEX

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
0005319-02		4/24/03 10:59	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	103%	80	120
Bromofluorobenzene	98%	80	120

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306319
Project:
Project Name: Texaco Brunson EOL
Location: BD

Lab ID: 0306319-02
Sample ID: Wall Comp.

8015M

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
		4/22/03	1	1	WL	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	<10.0	10.0
TOTAL, C6-C35	<10.0	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	112%	70	130
1-Chlorooctadecane	94%	70	130

8021B/5030 BTEX

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
0005319-02		4/24/03 11:18	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	93%	80	120
Bromofluorobenzene	96%	80	120

Approval:

Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date

4-29-03

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306319
Project:
Project Name: Texaco Brunson EOL
Location: BD

Lab ID: 0306319-01
Sample ID: 5 pt. Bottom Comp. @ 12'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	3650	mg/kg	1	20	9253	4/23/03	SB

Lab ID: 0306319-02
Sample ID: Wall Comp.

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	1950	mg/kg	1	20	9253	4/23/03	SB

Approval:

Raland K. Tuttle 4-29-03

Raland K. Tuttle, Lab Director, QA Officer

Date

Celey D. Keene, Org. Tech. Director

Jeanne McMurrey, Inorg. Tech. Director

Sandra Biezugbe, Lab Tech.

Sara Molina, Lab Tech.

RL = Reporting Limit

N/A = Not Applicable

Page 1 of 1

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8015M

Order#: G0306319

BLANK SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005303-02			<10.0		
CONTROL SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005303-03		952	850	89.3%	
CONTROL DUP SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005303-04		952	847	89.9%	0.4%
SRM SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005303-05		1000	763	76.3%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8021B/5030 BTEX

Order#: G0306319

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005319-02			<0.025		
Toluene-mg/kg		0005319-02			<0.025		
Ethylbenzene-mg/kg		0005319-02			<0.025		
p/m-Xylene-mg/kg		0005319-02			<0.025		
o-Xylene-mg/kg		0005319-02			<0.025		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306317-02	0	0.1	0.101	101.%	
Toluene-mg/kg		0306317-02	0	0.1	0.098	98.%	
Ethylbenzene-mg/kg		0306317-02	0	0.1	0.095	95.%	
p/m-Xylene-mg/kg		0306317-02	0	0.2	0.195	97.5%	
o-Xylene-mg/kg		0306317-02	0	0.1	0.090	90.%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306317-02	0	0.1	0.103	103.%	2.%
Toluene-mg/kg		0306317-02	0	0.1	0.100	100.%	2.%
Ethylbenzene-mg/kg		0306317-02	0	0.1	0.098	98.%	3.1%
p/m-Xylene-mg/kg		0306317-02	0	0.2	0.201	100.5%	3.%
o-Xylene-mg/kg		0306317-02	0	0.1	0.095	95.%	5.4%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005319-05		0.1	0.100	100.%	
Toluene-mg/kg		0005319-05		0.1	0.096	96.%	
Ethylbenzene-mg/kg		0005319-05		0.1	0.091	91.%	
p/m-Xylene-mg/kg		0005319-05		0.2	0.186	93.%	
o-Xylene-mg/kg		0005319-05		0.1	0.088	88.%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0306319

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005296-01			<20.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306319-01	3650	500	4090	88.8%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306319-01	3650	500	4110	92.2%	0.5%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005296-04		5000	4960	99.2%	

**12600 West I-20 East
Odessa, Texas 79763**

Phone: 915-563-1800
Fax: 915-563-1713

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

Project Name: Texaco Brunson #
Zia Brunson E06

Project Manager: Kristin Harris

Company Name Rice

Company Address: 122w Taylor

City/State/Zip: Albuquerque, NM 88240

Page No:

Sampler Signature: _____

[illegible]

Special Instructions

* Project Name change per Logan - 4-24-03 - 0830
 -Tons were killed as Texaco Brinson

Sample Containers Intact?	
Temperature Upon Receipt:	
Laboratory Comments:	

Relinquished by:

Received by:	Date	Time
	9-21-03	6:00P

Relinquished by:

Received by ELOI:	Date	Time
Jane Murray	4-22-3	1442