

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

TV - File

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Bosque Rd., Aztec, NM 87410

WELL API NO.
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name  LIBBY
8. Well No. 4
9. Pool name or Wildcat BUEYEROS ABO

1. Type of Well:  
OIL WELL  GAS WELL  OTHER CARBON DIOXIDE

2. Name of Operator  
AMERADA HESS CORPORATION

3. Address of Operator  
DRAWER D, MONUMENT, NEW MEXICO 88265

4. Well Location  
Unit Letter I : 1980 Feet From The SOUTH Line and 660 Feet From The EAST Line  
Section 16 Township 20N Range 31E NMPM HARDING County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
GL 4590'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: <u>BRADENHEAD TEST</u> <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

IT WAS NOT POSSIBLE TO TEST BRADENHEAD PRESSURES ON THIS WELL BECAUSE ALL CASING ANNULI WERE CEMENTED TO THE SURFACE. SEE ATTACHED WELLBORE DIAGRAM.


AMERADA HESS CORPORATION REQUESTS TA'D STATUS FOR THIS WELL.

*Inspected  
6-27-91 - leak in hbq valve -  
Re-inspect in 60 to 90 days*

I hereby certify that the information above is true and complete to the best of my knowledge and belief.  
SIGNATURE S.W. Small TITLE DISTRICT SUPERINTENDENT DATE JUNE 13, 1991  
TYPE OR PRINT NAME S.W. Small TELEPHONE NO. 393-2144

(This space for State Use)  
APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR DATE 7-1-91  
CONDITIONS OF APPROVAL, IF ANY:  
Authorization for maintenance in shut-in or  
temporary abandonment status expires 6-13-92

Libby No. 4  
 I- Sec. 16, T-20N, R-31E.  
 Harding County

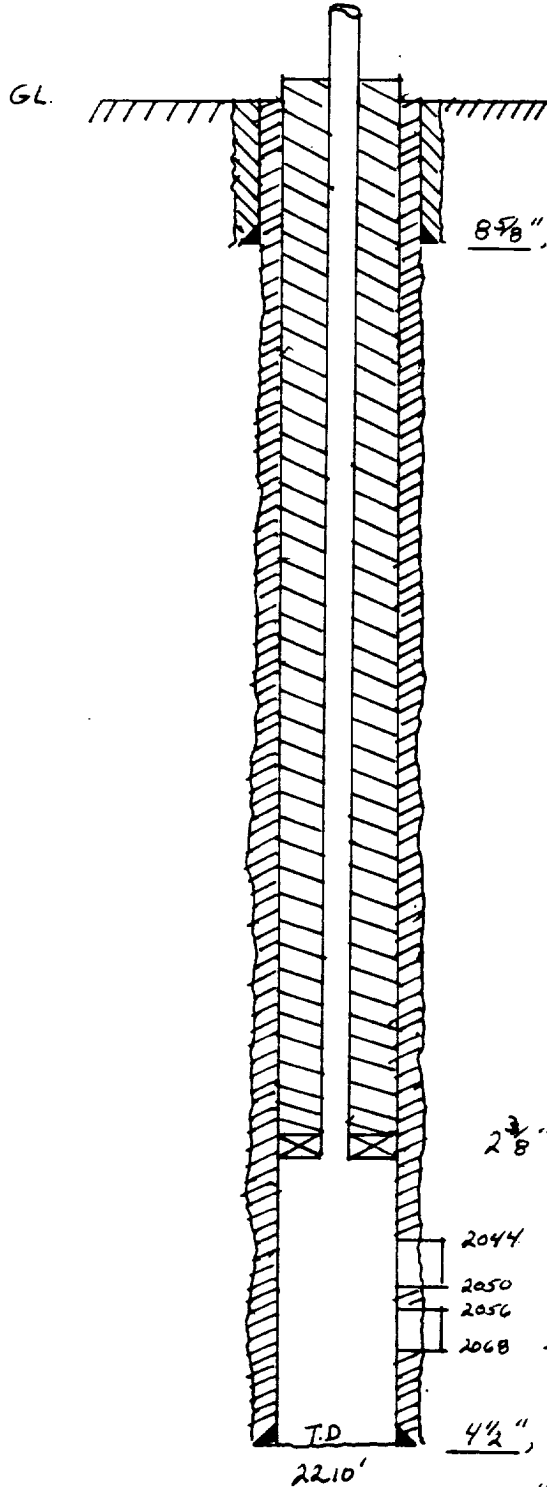

$8\frac{5}{8}$ " 20# Casing set @ 155'. Cut to surface  
 in  $12\frac{1}{2}$ " hole w/ 155 SK class 'C' cmt.  
 Good circ.

$2\frac{3}{8}$ " 4.7# J-55 tbg cmt'd in  $4\frac{1}{2}$ " csg to surface  
 w/ 115 SK Class 'C' cmt. Guiberson Uni. - 2 pkr @ 1841'

2044 }  
 2050 } Abo Perfs. (2 jspt)  
 2056 }  
 2068 }

$4\frac{1}{2}$ " 9.5# Casing set @ 2210'. Cut to surface  
 in  $7\frac{7}{8}$ " hole w/ 600 SK Class 'H' cmt.  
 Good circ.