


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

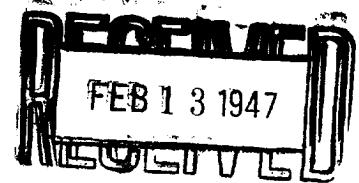

HOBBS OFFICE

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL		PLUGGING BACK	X

FEBRUARY 7, 1947

Date

Keyes, Oklahoma.

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO.
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____
Black Mesa Unit Well No. **1** in the _____

Company or Operator _____ Lease _____
NE NE SE of Sec. **13**, T. **31 N**, R. **36 E**, N. M. P. M.,
wildcat Field, **Union** County.

The dates of this work were as follows: **February 6, 1947.**

Notice of intention to do the work was (was not) submitted on Form C-102 on **February 6, 1947** 19____
and approval of the proposed plan was (was not) obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

Plugged back by running **3 1/2"** open-ended drill pipe and spotting **135** sx. Ashgrove cement by Halliburton @ **3100'** - displaced out of drill pipe with **17** bbls. rotary mud. Raised drill pipe to **2820'** and circulated out excess cement. Job completed @ **1 PM 2/6/47**. Shrs WOC, then checked and found firm cement @ **2822'** - Left heavy rotary mud in hole from **3100'** to total depth of **3814'**.

Witnessed by *A.B. Weiss* **The Pure Oil Company** **Dist. Supt.**
Name Company Title

Subscribed and sworn before me this _____

I hereby swear or affirm that the information given above is true and correct.

8 day of **February**, 19 **47**Name *H. L. Barton*Position **Chief Field Clerk**Representing **The Pure Oil Company**
Company or OperatorMy commission expires **8-10-47**Address **Box 101 - Keyes, Oklahoma**

Remarks:

APPROVED

Date **FEB 13 1947**

Roy Yarbrough
Name
Oil & Gas Inspector
Title