

talonlpe.com • 866.742.0742



Closure Report

Emerald PWU 20 #001H
|30-015-38338|2RP-4109|

Prepared For:

Devon Energy Production
6488 Seven Rivers Hwy
Artesia, New Mexico 88210

Prepared By:

TALON/LPE
408 W. Texas Avenue
Artesia, New Mexico 88210

April 25, 2017

Mr. Mike Shoemaker
Devon Energy Corporation
6488 Seven Rivers Hwy.
Artesia, New Mexico 88210

Subject: **Closure Report**
 Emerald PWU 20 #001H
 |30-015-38338| 2RP-4109|

Dear Mr. Shoemaker,

Devon Energy Corporation (Devon) has contracted Talon/LPE (Talon) to perform soil assessment and remediation services at the above referenced location. The incident description, soil sampling results, remediation activities and closure request are submitted herein.

Site Information

The Emerald PWU 20 #001H is located approximately twenty-five (25) miles southeast of Artesia, New Mexico. The legal location for this release is Unit Letter D, Section 20, Township 19 South and Range 29 East in Eddy County, New Mexico. More specifically the latitude and longitude for the release are 32.6525154 North and -104.1045456 West. A site plan is presented in [Appendix I](#).

According to the soil survey provided by the United States Department of Agriculture Natural Resources Conservation Service, the soil in this area is made up of Tonuco loamy fine sand with 0 to 3 percent slopes, eroded. Drainage courses in this area are normally dry.

Ground Water and Site Ranking

The New Mexico Office of the State Engineer (NMOSE) Water Rights Reporting System indicates that groundwater in the project vicinity is 150-feet below ground surface (BGS). See [Appendix II](#) for the referenced groundwater data.

Therefore the ranking for this site is a **0** based on the following:

Depth to ground water	>100'
Wellhead Protection Area	>1000'
Distance to surface water body	>1000'

Based upon the site ranking of **0**, NMOCD Recommended Remedial Action Levels (RRAL) are 50 mg/kg for BTEX, 10 mg/kg for Benzene, 5,000 mg/kg for TPH and the recommended guideline for Total Chlorides is 1,000 mg/kg.

Incident Description

On January 30, 2017, a water dump failed on the 3-phase separator. This resulted in the release of approximately 38bbls of produced water and 2bbls of oil. A vacuum truck was dispatched to the site and was able to recover approximately 14bbls of produced water and 1bbl of oil.

On March 14, 2017, Talon mobilized personnel to the site to perform soil sampling within the impacted area utilizing a hand auger. The results of this soil sampling event are summarized in the table below.

Laboratory Results

See [Appendix IV](#) for complete report of laboratory results.

March 14, 2017

Sample ID	Depth (feet)	BTEX (mg/kg)	Chlorides (mg/kg)	TPH (mg/kg) GRO	TPH (mg/kg) DRO
S-1	0	2.51	18400	179	16800
S-1 Refusal	0.5	ND	544	ND	247
S-2	0	25.4	7120	828	8010
S-2	0.5	0.95	1760	18.4	248
S-2	1	ND	224	ND	70.8
S-2	2	ND	192	ND	ND
S-3	0	ND	992	ND	ND
S-3	0.5	ND	640	ND	ND
S-3	1	ND	64	ND	ND
S-3 Refusal	1.5	ND	128	ND	ND
S-4	0	ND	80	ND	ND
S-4	0.5	ND	32	ND	ND
S-4 Refusal	1	ND	16	ND	ND
S-5 Refusal	0	ND	432	ND	27.4
S-6 Refusal	0	ND	832	ND	ND
S-7 Refusal	0	ND	17400	ND	76.1

April 10, 2015 Confirmation Soil Sampling

Sample ID	Depth (feet)	BTEX (mg/kg)	Chlorides (mg/kg)	TPH (mg/kg) GRO	TPH (mg/kg) DRO
S-7	0.5	--	160	--	--

(--) Analyte Not Tested

Based upon the site ranking of **0**, NMOCD Recommended Remedial Action Levels (RRAL) are 50 mg/kg for BTEX, 10 mg/kg for Benzene, 5,000 mg/kg for TPH and the recommended guideline for Total Chlorides is 1,000 mg/kg

Remedial Actions

- The impacted area in the vicinity of sample location S-1 was excavated to a depth of 0.5-feet BGS.
- The impacted area in the vicinity of sample location S-2 was hand excavated to a depth of 1-foot BGS.
- The impacted area in the vicinity of sample location S-7 was excavated utilizing field chloride titrations to guide the vertical extent of the excavation. At a depth of 0.5-feet field chloride titrations indicated that the soil chloride concentration was below 250 mg/kg. Per the approved work plan, a confirmation soil sample was taken from the bottom of the excavation and analyzed for total chlorides.
- All of the excavated material was hauled to an NMOCD approved solid waste disposal facility.
- Following receipt of the analytical data from the confirmation soil sampling event which shows the area in the vicinity of sample location S-7 was successfully vertically delineated to a concentration of less than 250 mg/kg of total chlorides. The excavation was backfilled with caliche and contoured to match the surrounding location.

Closure

On behalf of Devon Energy Company we respectfully request that no further actions be required and that closure with regard to this release be granted.

If we can provide additional information or be of further assistance, please contact our office at (575)-746-8768.

Respectfully submitted,

TALON/LPE



Sheldon Hitchcock
Project Manager



David J. Adkins
District Manager

Attachments

Appendix I Site Plan
Appendix II Groundwater Data
Appendix III Initial & Final C-141
Appendix IV Laboratory Results

APPENDIX I


SITE PLAN

Emerald PWU 20 #1H

Devon Energy

Legend

- Impacted Area
- Sample Location

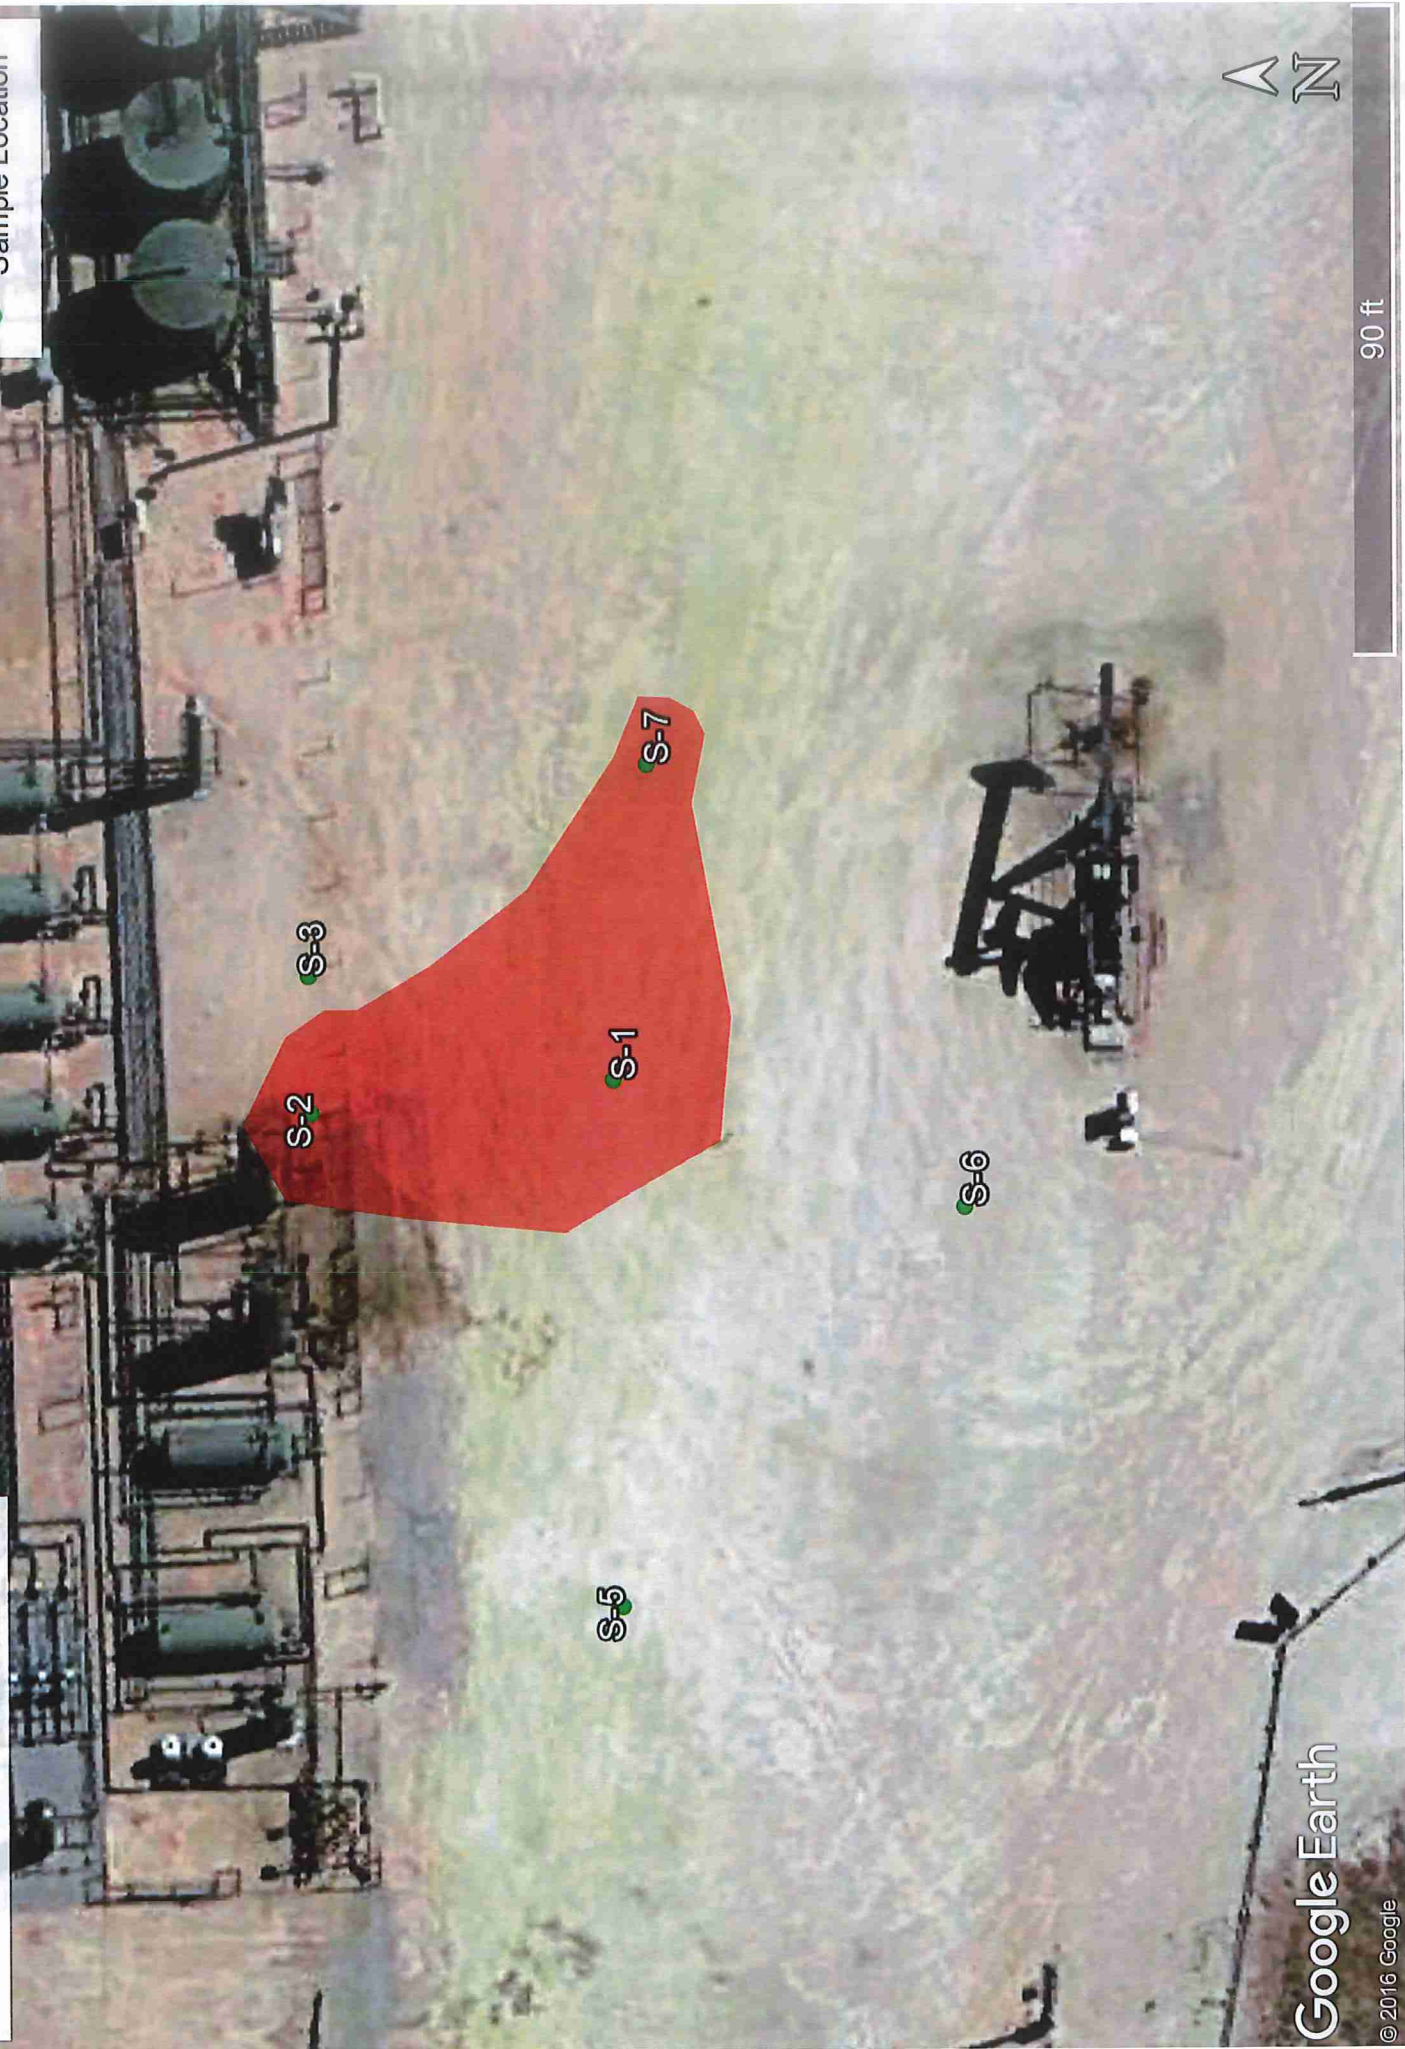

APPENDIX II

GROUNDWATER DATA



New Mexico Office of the State Engineer

Water Column/Average Depth to Water

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced,
O=orphaned,
C=the file is closed)

(quarters are 1=NW 2=NE 3=SW 4=SE)

(quarters are smallest to largest) (NAD83 UTM in meters)

(In feet)

POD Number	POD Sub-Code	basin	County	Q 64	Q 16	Q 4	Sec	Tws	Rng	X	Y	Distance	Depth Well	Depth Water	Water Column
CP 00646			ED	1	1	4	07	19S	29E	583155	3615551	2673	199	150	49

Average Depth to Water: 150 feet

Minimum Depth: 150 feet

Maximum Depth: 150 feet

Record Count: 1

UTMNAD83 Radius Search (in meters):

Easting (X): 584079

Northing (Y): 3613043

Radius: 3000

APPENDIX III
INITIAL C-141
&
FINAL C-141

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

NM OIL CONSERVATION
ARTESIA DISTRICT

FEB 06 2017

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
conformance with 19.15.29 NMAC.

RECEIVED

Release Notification and Corrective Action

NAB170395/412 OPERATOR ☒ Initial Report ☐ Final Report
Name of Company Devon Energy Production Company *6131* Contact Danny Velo, Production Foreman
Address 6488 Seven Rivers Hwy Artesia, NM 88210 Telephone No. 575-703-3360
Facility Name Emerald PWU 20 1H Facility Type Oil
Surface Owner State Mineral Owner State API No 30-015-38338

LOCATION OF RELEASE

Unit Letter D	Section 20	Township 19S	Range 29E	Feet from the 400	North/South Line North	Feet from the 330	East/West Line West	County Eddy
------------------	---------------	-----------------	--------------	----------------------	---------------------------	----------------------	------------------------	----------------

Latitude: 32.6525154

Longitude: -104.1045456

NATURE OF RELEASE

Type of Release Produced Water & Oil	Volume of Release 38bbls produced water / 2bbls oil	Volume Recovered 14bbls produced water / 1bbl oil
Source of Release Three Phase Separator	Date and Hour of Occurrence January 30, 2017 @ 1:30 AM	Date and Hour of Discovery January 30, 2017 @ 1:30 AM
Was Immediate Notice Given? ☒ Yes ☐ No ☐ Not Required	If YES, To Whom? Mike Bratcher, OCD Shelly Tucker, BLM	
By Whom? Hub Perry, Production Foreman	Date and Hour Mike Bratcher, OCD January 30, 2017 2:10 PM Shelly Tucker, BLM January 30, 2017 2:23 PM	
Was a Watercourse Reached? ☐ Yes ☒ No	If YES, Volume Impacting the Watercourse N/A	
If a Watercourse was Impacted, Describe Fully.* N/A		

Describe Cause of Problem and Remedial Action Taken.*

Water dump cracked due to sand wash out on the 3-phase separator. The well was shut in at the well head to stop the release. Repairs have been made and the separator is back in service.

Describe Area Affected and Cleanup Action Taken.*

Approximately 38bbls produced water and 2bbl oil was released on location in approximately a 35' wide by 50' long area. A vacuum truck was contacted and recovered 14bbls produced water and 1bbl oil from location. Environmental agency will be contacted for remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Sheila Fisher</i>	OIL CONSERVATION DIVISION	
Printed Name: Sheila Fisher	Signed By <i>[Signature]</i> Approved by Environmental Specialist:	
Title: Field Admin Support	Approval Date: <i>2/7/17</i>	Expiration Date: <i>N/A</i>
E-mail Address: <i>Sheila.fisher@dmn.com</i>	Conditions of Approval: <i>See attached</i>	Attached ☐
Date: 2/6/16 Phone: 575.748.1829		

* Attach Additional Sheets If Necessary

22P-4102

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company: Devon Energy Production Company	Contact: Mike Shoemaker
Address: 6488 Seven Rivers Hwy Artesia, NM 88210	Telephone No. 575-513-5035
Facility Name: Emerald PWU 20-1H	Facility Type: Tank Battery

Surface Owner: State	Mineral Owner: State	API No.30-015-38338
----------------------	----------------------	---------------------

LOCATION OF RELEASE

Unit Letter D	Section 20	Township 19S	Range 29E	Feet from the 400	North/South Line North	Feet from the 330	East/West Line West	County Eddy
------------------	---------------	-----------------	--------------	----------------------	---------------------------	----------------------	------------------------	----------------

Latitude 32.6525154 Longitude -104.1045456

NATURE OF RELEASE

Type of Release: Mixed fluids	Volume of Release: 38bbls PW/2bbls Oil	Volume Recovered: 14bbls PW/1bbls oil
Source of Release:	Date and Hour of Occurrence: 1/30/2017 @ 1:30 AM	Date and Hour of Discovery: 1/30/2017 @ 1:30 AM
Was Immediate Notice Given? ☒ Yes ☐ No ☐ Not Required	If YES, To Whom? Mike Bratcher-NMOCD Shelly Trucker-BLM	
By Whom? Hub Perry, Production Foreman	Date and Hour: Mike Bratcher-NMOCD 2:10 PM Shelly Trucker-BLM 2:23 PM	
Was a Watercourse Reached? ☐ Yes ☒ No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

A water dump cracked due to sand washout on the 3-phase separator. The well was shut in for repairs. The separator was repaired and put back into service.

Describe Area Affected and Cleanup Action Taken.*

Approximately 40bbls of mixed fluids were released onto the location. A vacuum truck was used to recover approximately 15bbls of mixed fluids. Talon/LPE was contracted to perform an initial site assessment and draft a remediation work plan. Upon approval of the remediation work plan Talon/LPE conducted the remediation in accordance with the approved work plan.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

OIL CONSERVATION DIVISION

Signature:	Approved by Environmental Specialist:		
Printed Name: Mike Shoemaker			
Title: EHS Representative	Approval Date:	Expiration Date:	
E-mail Address: mike.shoemaker@dvn.com	Conditions of Approval:		Attached ☐
Date: 4/25/2017 Phone: 575-513-5035			

* Attach Additional Sheets If Necessary

APPENDIX IV

LABORATORY RESULTS

March 16, 2017

KIMBERLY WILSON

TALON LPE

408 W. TEXAS AVE.

ARTESIA, NM 88210

RE: EMERALD PWU 20-1

Enclosed are the results of analyses for samples received by the laboratory on 03/15/17 10:03.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-16-8. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.


Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,



Celey D. Keene

Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-1 0' (H700675-01)

BTEX 8021B		mg/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	2.51	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	2.51	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 133 % 72-148

Chloride, SM4500Cl-B		mg/kg	Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	18400	16.0	03/15/2017	ND	400	100	400	7.69	

TPH 8015M		mg/kg	Analyzed By: MS							S-04
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10	179	10.0	03/16/2017	ND	184	92.2	200	0.325		
DRO >C10-C28	16800	10.0	03/16/2017	ND	194	97.1	200	0.595		


Surrogate: 1-Chlorooctane 150 % 25.1-158

Surrogate: 1-Chlorooctadecane 386 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-1 0.5' REFUSAL (H700675-02)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PID) 102 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	544	16.0	03/15/2017	ND	400	100	400	7.69	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	247	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 92.5 % 25.1-158

Surrogate: 1-Chlorooctadecane 83.7 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-2 0' (H700675-03)

BTX 8021B		mg/kg	Analyzed By: MS					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	1.61	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	3.27	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	20.5	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTX	25.4	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 186 % 72-148

Chloride, SM4500Cl-B		mg/kg	Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	7120	16.0	03/15/2017	ND	400	100	400	7.69	

TPH 8015M		mg/kg	Analyzed By: MS					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	828	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	8010	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 209 % 25.1-158

Surrogate: 1-Chlorooctadecane 197 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-2 0.5' (H700675-04)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	0.091	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	0.856	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	0.948	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 108 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1760	16.0	03/15/2017	ND	400	100	400	7.69	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	18.4	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	248	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 97.6 % 25.1-158

Surrogate: 1-Chlorooctadecane 85.8 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-2 1' (H700675-05)

BTX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 101 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	224	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	70.8	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 90.3 % 25.1-158

Surrogate: 1-Chlorooctadecane 91.5 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

 TALON LPE
 KIMBERLY WILSON
 408 W. TEXAS AVE.
 ARTESIA NM, 88210
 Fax To: (575) 745-8905

 Received: 03/15/2017
 Reported: 03/16/2017
 Project Name: EMERALD PWU 20-1
 Project Number: 700794.216.01
 Project Location: EDDY COUNTY, NM

 Sampling Date: 03/14/2017
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Celey D. Keene

Sample ID: S-3 0' (H700675-06)

BTX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 101 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	992	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 87.1 % 25.1-158

Surrogate: 1-Chlorooctadecane 91.7 % 26.8-170

Cardinal Laboratories

* = Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-3 0.5' (H700675-07)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PID) 102 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	640	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 95.5 % 25.1-158

Surrogate: 1-Chlorooctadecane 97.2 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-3 1' (H700675-08)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PID) 101 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	64.0	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 95.4 % 25.1-158

Surrogate: 1-Chlorooctadecane 97.2 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-3 1.5' REFUSAL (H700675-09)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PID) 103 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	128	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 95.2 % 25.1-158

Surrogate: 1-Chlorooctadecane 100 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-4 0' (H700675-10)

BTX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 102 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	80.0	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 95.1 % 25.1-158

Surrogate: 1-Chlorooctadecane 99.7 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-4 0.5' (H700675-11)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 102 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 93.3 % 25.1-158

Surrogate: 1-Chlorooctadecane 91.2 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-4 1' REFUSAL (H700675-12)

BTX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.01	100	2.00	1.32	
Toluene*	<0.050	0.050	03/16/2017	ND	1.88	93.9	2.00	1.12	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	1.26	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.34	89.0	6.00	1.02	
Total BTX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 102 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 92.2 % 25.1-158

Surrogate: 1-Chlorooctadecane 96.8 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-5 0' R (H700675-13)

BTEX 8021B		mg/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.00	99.8	2.00	0.479	
Toluene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	0.616	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.86	93.1	2.00	0.899	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.32	88.7	6.00	0.918	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 101 % 72-148

Chloride, SM4500Cl-B		mg/kg	Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	432	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	27.4	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 84.9 % 25.1-158

Surrogate: 1-Chlorooctadecane 89.6 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-6 0' R (H700675-14)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.00	99.8	2.00	0.479	
Toluene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	0.616	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.86	93.1	2.00	0.899	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.32	88.7	6.00	0.918	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 102 % 72-148

Chloride, SM4500CI-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	832	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 92.8 % 25.1-158

Surrogate: 1-Chlorooctadecane 95.7 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-7 0' R (H700675-15)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.00	99.8	2.00	0.479	
Toluene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	0.616	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.86	93.1	2.00	0.899	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.32	88.7	6.00	0.918	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 102 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	17400	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	76.1	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 76.3 % 25.1-158

Surrogate: 1-Chlorooctadecane 81.4 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

Analytical Results For:

TALON LPE
KIMBERLY WILSON
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 03/15/2017
Reported: 03/16/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 03/14/2017
Sampling Type: Soil
Sampling Condition: Cool & Intact
Sample Received By: Celey D. Keene

Sample ID: S-2 2' (H700675-16)

BTEX 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/16/2017	ND	2.00	99.8	2.00	0.479	
Toluene*	<0.050	0.050	03/16/2017	ND	1.87	93.5	2.00	0.616	
Ethylbenzene*	<0.050	0.050	03/16/2017	ND	1.86	93.1	2.00	0.899	
Total Xylenes*	<0.150	0.150	03/16/2017	ND	5.32	88.7	6.00	0.918	
Total BTEX	<0.300	0.300	03/16/2017	ND					

Surrogate: 4-Bromofluorobenzene (PIE) 101 % 72-148

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	192	16.0	03/15/2017	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	03/16/2017	ND	184	92.2	200	0.325	
DRO >C10-C28	<10.0	10.0	03/16/2017	ND	194	97.1	200	0.595	


Surrogate: 1-Chlorooctane 92.9 % 25.1-158

Surrogate: 1-Chlorooctadecane 96.7 % 26.8-170

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager


Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report


Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.




Celey D. Keene, Lab Director/Quality Manager

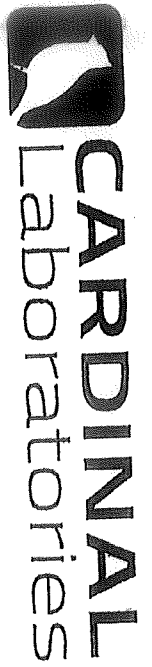

Page 1 of 2
CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Company Name: Talon/LPE		P.O. #:															
Project Manager: Kimberly Wilson		Company: Talon/LPE															
Address: 408 W. Texas Ave.		Attn:															
City: Artesia		Address:															
Phone #: 575-746-8768		City:															
Fax #: 575-746-8905		State:															
Project #: 700794.216.07		Zip:															
Project Name: Emerald Pail 20-1		Phone #:															
Project Location: Eddy City		Fax #:															
Sampler Name: Kim Wilson		PRESERVATION															
FOR LAB USE ONLY		SAMPLING															
Lab I.D.	Sample I.D.	(G) RAB OR (C) COMP.	# CONTAINERS	GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER:	ACID/BASE:	ICE/COOL	OTHER:	DATE	TIME	ANALYSIS REQUEST		
H706675																	
01	3-1 0'	6	1	1	1	1	1	1	1	1	1	1	3/14/17	2:00	1	Chlorides	
02	3-1 0.5' Refused	6	1	1	1	1	1	1	1	1	1	1		2:03	1	TPH	
03	3-2 0'	6	1	1	1	1	1	1	1	1	1	1		2:10	1	BTEX	
04	3-2 0.5'	6	1	1	1	1	1	1	1	1	1	1		2:17	1		
05	3-2 1'	6	1	1	1	1	1	1	1	1	1	1		2:30	1		
06	3-3 0'	6	1	1	1	1	1	1	1	1	1	1		2:35	1		
07	3-3 0.5'	6	1	1	1	1	1	1	1	1	1	1		2:38	1		
08	3-3 1'	6	1	1	1	1	1	1	1	1	1	1		2:40	1		
09	3-3 1.5' Refused	6	1	1	1	1	1	1	1	1	1	1		2:45	1		
10	3-4 0'	6	1	1	1	1	1	1	1	1	1	1					
PLEASE NOTE: Stability and integrity of samples is dependent on proper handling. Samples must be sealed within 30 days after completion of the applicable analysis. All labels including those for impurities and any other status whatsoever must be signed without undue delay by the client. In the event that Cardinal has been notified of potential or actual damage, including without limitation, business interruptions, loss of data, or loss of profits incurred by client, the client shall indemnify and hold Cardinal harmless for any and all damages, including without limitation, business interruptions, loss of data, or loss of profits incurred by client, the client shall indemnify and hold Cardinal harmless for any and all damages, including without limitation, business interruptions, loss of data, or loss of profits incurred by client.																	
Relinquished By: Kim Wilson		Date: 3/15/17		Received By: [Signature]		Date: 3/15/17		Sample Condition: Cool ☒ Warm ☐		Checked By: [Signature]		Date: 3/15/17		Time: 10:03		Remarks: RUS #	
Delivered By: (Circle One)		Date: 3/15/17		Received By: [Signature]		Date: 3/15/17		Sample Condition: Cool ☒ Warm ☐		Checked By: [Signature]		Date: 3/15/17		Time: 5:30		Remarks: RUS #	
Sampler - UPS - Bus - Other:		Date: 3/15/17		Received By: [Signature]		Date: 3/15/17		Sample Condition: Cool ☒ Warm ☐		Checked By: [Signature]		Date: 3/15/17		Time: 5:30		Remarks: RUS #	

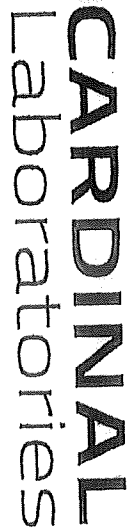

Page 2 of 2
CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

[illegible]

† Cardinal cannot accept verbal changes. Please fax written changes to (575) 398-2326



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

April 11, 2017

SHELDON HITCHCOCK

TALON LPE

408 W. TEXAS AVE.

ARTESIA, NM 88210

RE: EMERALD PWU 20-1

Enclosed are the results of analyses for samples received by the laboratory on 04/10/17 14:55.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-16-8. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene

Lab Director/Quality Manager

Analytical Results For:

TALON LPE
SHELDON HITCHCOCK
408 W. TEXAS AVE.
ARTESIA NM, 88210
Fax To: (575) 745-8905

Received: 04/10/2017
Reported: 04/11/2017
Project Name: EMERALD PWU 20-1
Project Number: 700794.216.01
Project Location: EDDY COUNTY, NM

Sampling Date: 04/10/2017
Sampling Type: Soil
Sampling Condition: ** (See Notes)
Sample Received By: Tamara Oldaker


Sample ID: S-7 0.5' (H700950-01)**Chloride, SM4500Cl-B****mg/kg****Analyzed By: AC**

Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	160	16.0	04/10/2017	ND	448	112	400	0.00	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager


Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report


Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



Celey D. Keene, Lab Director/Quality Manager

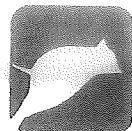

CARDINAL Laboratories

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Company Name: Talon/LPE

Project Manager:

Address: 408 W. Texas Ave.

City: Artesia

Phone #: 575-746-8768

Project #:

Project Name: Emerald PUA 20-1H

Project Location:

Sampler Name: S. Hitchcock

FOR LAB USE ONLY

BILL TO

ANALYSIS REQUEST

P.O. #:

Company: Talon/LPE

Attn:

Address:

City:

State: Zip:

Phone #:

Fax #:

MATRIX

PRESERV

SAMPLING

Lab I.D.

Sample I.D.

5-7 0.5'

(G)RAB OR (C)OMP.

CONTAINERS

GROUNDWATER

WASTEWATER

SOIL

OIL

SLUDGE

OTHER:

ACID/BASE:

ICE / COOL

OTHER: None

DATE TIME

Chlorides

Relinquished By:

Date:

Received By:

Relinquished By:

Date: 9-10-17

Received By:

Delivered By: (Circle One)

Sample - UPS - Bus - Other:

Time: 8:55

Time: 3:12

Sample Condition
Cool ☐ Intact ☐
Yes ☐ No ☐

CHECKED BY:
(Initials)
TO 475

Phone Result: ☐ Yes ☐ No ☐ Add'l Phone #:
Fax Result: ☐ Yes ☐ No ☐ Add'l Fax #:
REMARKS:

Rush