

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources

Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised October 10, 2003

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company – OXY USA	Contact – Kelton Beaird
Address – P O Box 1988 / 102 South Main St Carlsbad, NM	Telephone No. – 575-887-8337
Facility Name – SDS Federal 11 #1	Facility Type - SWD

Surface Owner – Federal	Mineral Owner – Federal	Lease No.
-------------------------	-------------------------	-----------

30-015-24677 LOCATION OF RELEASE

Unit Letter M	Section 11	Township 24S	Range 31E	Feet from the 2090'	North/South Line North Line	Feet from the 1980'	East/West Line West Line	County Eddy
------------------	---------------	-----------------	--------------	------------------------	--------------------------------	------------------------	-----------------------------	----------------

Latitude 32° 14.007' N Longitude 103° 45.049' W

NATURE OF RELEASE


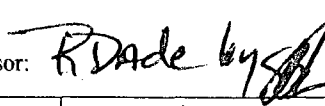
Type of Release – Produced Water	Volume of Release – 55 bbls	Volume Recovered – 40 bbls
Source of Release – Triplex Pump Failure	Date and Hour of Occurrence – 7/3/08	Date and Hour of Discovery – 11:30 AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NMOCD – Gerry Guye BLM – Bobby Ballard	
By Whom? – Rick Kerby	Date and Hour – 7/3/08 @ 1:29 PM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\* Triplex pump failure. Fluids picked up by vacuum truck. Spill ran across caliche location and into the field. The spill area was delineated using field chloride analysis.

Describe Area Affected and Cleanup Action Taken.\* The area of TP2 was excavated 2' deep and the areas of TP1, TP3 and TP4 were excavated 4' deep. The material excavated from those dimensions was hauled to Lea Land Disposal. The areas on location were domed and capped with a 20 mil liner. Clean native soil was backfilled in all excavated areas. A total of 1,296 yds<sup>3</sup> was hauled to the disposal. The spill area inside the historical pit area will be addressed during the reclamation of the historical pit at a separate time.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Kelton Beaird	Approved by District Supervisor: 	
Title: HES Specialist	Approval Date: 2-11-10	Expiration Date: N/A
E-mail Address: kelton_beaird@oxy.com	Conditions of Approval: N/A	Attached <input type="checkbox"/> N/A

12-23-2008 Phone: 575-887-8337

JRP-192

\* Attach Additional Sheets If Necessary