

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources

Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in  
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

nJMW1334339872

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: BOPCO, L.P. 260137	Contact: Tony Savoie
Address: 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220	Telephone No. 575-887-7329
Facility Name: Poker Lake Unit Crude Oil Gathering System.	Facility Type: Exploration and Production
Spill location 1400 ft. east of the PLU-227 Tank Battery	

Surface Owner: Federal	Mineral Owner: Federal	API No. 30-015-33929
------------------------	------------------------	----------------------

LOCATION OF RELEASE


Unit Letter M	Section 29	Township 24S	Range 30E	Feet from the 118	North/South Line South	Feet from the 836	East/West Line West	County Eddy
------------------	---------------	-----------------	--------------	----------------------	---------------------------	----------------------	------------------------	----------------

Latitude N 32.181606 Longitude W 103.909504

NATURE OF RELEASE

Type of Release: Crude oil	Volume of Release: 270 bbls.	Volume Recovered: 220 bbls.
Source of Release: 6" Pipeline	Date and Hour of Occurrence: 12/6/13 at 12:15 p.m.	Date and Hour of Discovery: 12/6/13 at 12:15 p.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NMOCD Emergency #104 and the BLM	
By Whom? Tony Savoie	Date and Hour: 12/6/13 NMOCD at 12:28 p.m. BLM 12:30 p.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.\*

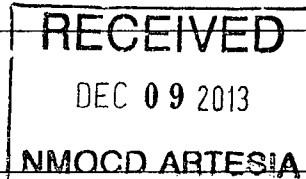

Describe Cause of Problem and Remedial Action Taken.\*

The 6" crude oil gathering line was struck and ruptured by a track-hoe operated by New Mexico Rental while excavating a line operated by Enterprise. Vacuum trucks were immediately dispatched to the spill location, lact units were shut down and the damaged section of pipe was isolated. The track-hoe excavated the damaged area and a temporary repair clamp was used to stop the flow of oil. The line was permanently repaired on 12/7/13 by replacing the damaged section of pipe.

Describe Area Affected and Cleanup Action Taken.\*

The spill was contained within the excavation which was in the middle of a lease road. The excavation measured approximately 30 ft. by 10 ft. by 6 ft. in depth. Approximately 220 bbls of crude oil was recovered from the excavation and placed back into the production facilities at the PLU-227 and PLU-213. The impacted area will be remediated in accordance to the NMOCD and BLM spill remediation guidelines.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: Tony Savoie		OIL CONSERVATION DIVISION	
Printed Name: Tony Savoie		Approved by Environmental Specialist Signed By Mike Benavente	
Title: Waste Management and Remediation Specialist		Approval Date: DEC 09 2013	Expiration Date:
E-mail Address: tasavoie@basspet.com		Conditions of Approval: Remediation per OGD Rule & Guidelines, & like approval by BLM. SUBMIT REMEDIATION	Attached <input type="checkbox"/>
Date: 12/9/13	Phone: 432-556-8730		

\* Attach Additional Sheets If Necessary

PROPOSAL NO LATER THAN:

January 9, 2013

2RP-2102