

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

RECEIVED

JUL 16 2013

NMOC D ARTESIA

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company : LRE Operating, LLC	Contact : Mike Barrett
Address : 1111 Bagby Street Suite 4600, Houston, TX 77002	Telephone No. : 575-623-8424
Facility Name : Logan 2 State No.2	Facility Type: tank battery
Surface Owner : Bogle	Mineral Owner: State
Lease No. : API #30-015-30406 2RP-1514	

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
C	2	18S	27E	990'	FNL	1750'	FWL	Eddy

Latitude 32.78018 N Longitude -104.25143 W

NATURE OF RELEASE

Type of Release : Produced Water	Volume of Release : 102 bbls	Volume Recovered: 20 bbl
Source of Release : Tank over flow	Date and Hour of Occurrence: 01/09/13 am	Date and Hour of Discovery: 01/09/13 8:00 am
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher	
By Whom? Mike Stubblefield with Talon/LPE	Date and Hour : 01/09/13 @ 9:30 am	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*


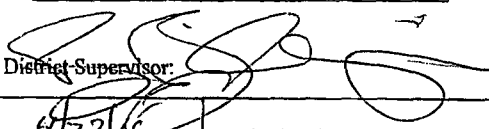
Describe Cause of Problem and Remedial Action Taken.*

Transfer pump failed causing the water tank to overflow. Approximately 102 barrels of produced water were released. 20 barrels standing fluids were immediately recovered by vacuum truck.

Describe Area Affected and Cleanup Action Taken.*

Talon/LPE was contacted for the correction of the release. The impacted areas were excavated to a depth of 2-6 feet deep in the bermed area and pasture located behind tank battery. Analytical testing was completed and the impacted soil was transported to Lea Land, LLC a NMOCD approved solid waste disposal facility. Following approval from the NMOCD, the excavated areas were backfilled to grade using new material transported to location.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Michael Barrett	Approved by District Supervisor: 	
Title: Production Supervisor	Approval Date: <u>4/22/13</u>	Expiration Date:
E-mail Address: mbarrett@limerockresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 5/22/2013 Phone: 575-623-8424		

* Attach Additional Sheets If Necessary

2RP 1514
Final