

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
OMB NO. 1004-0137  
Expires: January 31, 2018

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*

5. Lease Serial No.  
NMLC029426B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

**SUBMIT IN TRIPLICATE - Other instructions on page 2**

1. Type of Well  
☒ Oil Well ☐ Gas Well ☐ Other

8. Well Name and No.  
CEDAR LAKE FEDERAL CA 303H

2. Name of Operator  
APACHE CORPORATION  
Contact: SORINA FLORES  
E-Mail: sorina.flores@apachecorp.com

9. API Well No.  
30-015-43559-00-X1

3a. Address  
303 VETERANS AIRPARK LANE SUITE 3000  
MIDLAND, TX 79705

3b. Phone No. (include area code)  
Ph: 432.818.1167

10. Field and Pool or Exploratory Area  
CEDAR LAKE

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
Sec 3 T17S R31E SWNW 1815FNL 157FWL

11. County or Parish, State  
EDDY COUNTY, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION				
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off	
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity	
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other	
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	Change to Original A	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	PD	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

BLM-CO-1463 NATIONWIDE NMB-000736

APACHE REQUEST A VARIANCE TO USE A FLEXIBLE HOSE BETWEEN BOP & CHOKE MANIFOLD

SEE ATTACHMENT FOR ADDITIONAL INFORMATION

Manufacturer: Continental  
SN: 69915  
ID: 3"  
WP: 10,000psi  
TP: 15,000psi

SEE ATTACHED FOR  
CONDITIONS OF APPROVAL

Accepted for record - NMOCD

4-12-17

ARTESIA DISTRICT

APR 10 2017

RECEIVED

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #371317 verified by the BLM Well Information System

For APACHE CORPORATION, sent to the Carlsbad

Committed to AFMSS for processing by DEBORAH MCKINNEY on 04/03/2017 (17DLM1207SE)

Name (Printed/Typed) SORINA FLORES

Title SUBMITTING CONTACT

Signature (Electronic Submission)

Date 03/28/2017

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved By MUSTAFA HAQUE

Title PETROLEUM ENGINEER

Date 04/04/2017

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office Carlsbad

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

**\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\***

**PECOS DISTRICT  
CONDITIONS OF APPROVAL**

BLM OIL CONSERVATION  
ARTESIA DISTRICT

APR 10 2017

OPERATOR'S NAME:	Apache Corporation	RECEIVED
LEASE NO.:	NMLC029426A	
WELL NAME & NO.:	Cedar Lake Federal CA 303H	
SURFACE HOLE FOOTAGE:	1815'/N & 157'/W	
BOTTOM HOLE FOOTAGE:	1815'/N & 330'/W	
LOCATION:	Section 3, T.17 S., R.31 E., NMPM	
COUNTY:	Eddy County, New Mexico	

**All previous COAs still apply, except for the following:**

1. Variance approved to use flex line from BOP to choke manifold. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. **Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.** If the BLM inspector questions the straightness of the hose, a BLM engineer will be contacted and will review in the field or via picture supplied by inspector to determine if changes are required (operator shall expect delays if this occurs).

**MHH 04042017**

ContiTech

QUALITY CONTROL INSPECTION AND TEST CERTIFICATE				CERT. N°: 581	
PURCHASER: ContiTech Oil & Marine Corp.				P.O. N°: 4500511543	
CONTITECH RUBBER order N°: 540352		HOSE TYPE: 3" ID		Choke and Kill Hose	
HOSE SERIAL N°: 69915		NOMINAL / ACTUAL LENGTH: 10,67 m / 10,76 m			
W.P. 68,9 MPa 10000 psi		T.P. 103,4 MPa 15000 psi		Duration: 60 min.	
<p>Pressure test with water at ambient temperature</p> <p style="text-align: center;">See attachment. ( 1 page )</p>					
COUPLINGS Type		Serial N°		Quality	
3" coupling with		7563 7565		AISI 4130	
4 1/16" 10K API b.w. Flange end				AISI 4130	
				A0996X	
				036282	
<p><b>NOT DESIGNED FOR WELL TESTING</b></p> <p style="text-align: right;"><b>API Spec 16 C</b></p> <p style="text-align: right;"><b>Temperature rate:"B"</b></p>					
All metal parts are flawless					
WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDER INSPECTED AND PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT.					
STATEMENT OF CONFORMITY: We hereby certify that the above items/equipment supplied by us are in conformity with the terms, conditions and specifications of the above Purchaser Order and that these items/equipment were fabricated inspected and tested in accordance with the referenced standards, codes and specifications and meet the relevant acceptance criteria and design requirements.					
COUNTRY OF ORIGIN HUNGARY/EU					
Date:		Inspector		Quality Control	
18. March 2015.				<p>ContiTech Industrial Kft. Quality Control Dept. (1)</p> <p><i>[Signature]</i></p>	


File Name : 004409\_69913\_-914\_-915.GEV  
 File Message : 69913\_69914\_69915  
 Device Type : GX10  
 Serial No. : SSP606399  
 Data Count : 1426  
 Print Group : Press-Temp  
 Print Range : 2015/03/17 21:57:40.000 - 2015/03/17 23:56:25.000  
 Comment : 69913\_69914\_69915

Sampling Int. : 5.000 sec  
 Start Time : 2015/03/17 21:57:40.000  
 Stop Time : 2015/03/17 23:56:25.000

Date No.	Cursor A	Cursor B	Difference
526	2015/03/17 22:41:30.000	2015/03/17 23:41:30.000	01:00:00.000
Absolute Time	Value A	Value B	Value B-A
Tag Comment	1069.30	1057.33	-11.97
Pressure[bar]	20.28	20.18	-0.11
Ambient Temperature[°C]			

*Yakup Ceylan*  
 Centrifugal Rubber  
 Quality Control and  
 Development

Ambient Temperature[°C]  
 Pressure[bar]

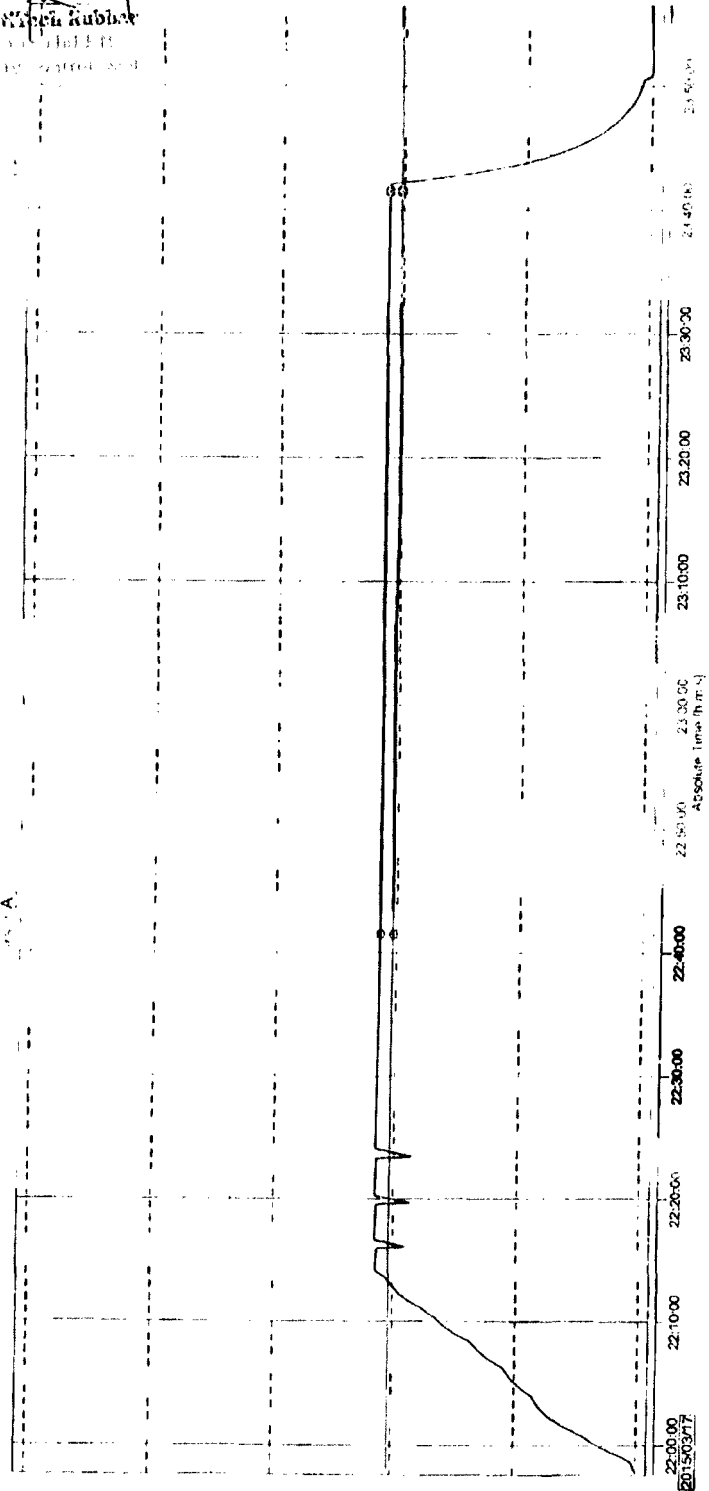

10mm/div