


District I  
1625 N. French Dr.. Hobbs, NM 88240  
District II  
1301 W. Grand Avenue. Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe. NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

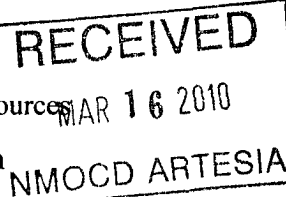

Form C-141  
Revised October 10, 2003

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

### Release Notification and Corrective Action

#### OPERATOR

☒ Initial Report

☐ Final Report

Name of Company BOPCO, L.P. *260737*  
Address 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220  
Facility Name Poker Lake Unit #158  
Contact Tony Savoie  
Telephone No. 432-556-8730  
Facility Type E&P API 30-015-31690

Surface Owner Federal Mineral Owner Federal Lease No.

*30015 31690*  
**LOCATION OF RELEASE**  
Unit Letter A Section 7 Township 24S Range 30E Feet from the North/South Line *660* Feet from the East/West Line *660* County Eddy

Latitude N 32.237400 Longitude W 103.914150

#### NATURE OF RELEASE

Type of Release: Crude oil and produced water  
Volume of Release: 5 Bbls of Produced water and 45 Bbls of Crude oil  
Volume Recovered: 40 Bbls  
Source of Release: Tank overflow  
Date and Hour of Occurrence 3/8/10 Approximately 2:30 p.m.  
Date and Hour of Discovery 3/8/10 4:30 p.m.  
Was Immediate Notice Given? ☒ Yes ☐ No ☐ Not Required  
If YES, To Whom? Randy, emergency NMOCD number  
By Whom? *Tony Savoie*  
Date and Hour 3/9/10 12:04 p.m.  
Was a Watercourse Reached? ☐ Yes ☒ No  
If YES, Volume Impacting the Watercourse.

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\* A valve on the produced water tanks was left open while the operator was tending to other activities, the source of the overflow was corrected and a vacuum truck was dispatched to the area to remove the fluid inside of the earthen containment.

Describe Area Affected and Cleanup Action Taken.\* The entire area of the earthen containment was covered with crude oil, approximately 4500 sq. ft. The free standing oil was removed and the saturated area around the tanks inside the containment was covered with dry to dirt to allow for normal operations to continue. Approximately 30,600 sq. ft. of pasture land was affected by a fine mist of crude oil due to the excessive winds that day. The affected vegetation was washed down with a nutrient and microblaze solution.

The Site remediation for the produced water and crude oil spill will follow the NMOCD guidelines for leaks and spills.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

**OIL CONSERVATION DIVISION**  
Signature: *Tony Savoie*  
Printed Name: Tony Savoie  
Title: Waste Mgmt. & Remediation Specialist  
E-mail Address: TASavoie@BassPet.com  
Date: 3/15/10  
Phone: 432-556-8730  
Approved by District Supervisor: *[Signature]*  
Approval Date: *4-8-10*  
Expiration Date: *6-8-10*  
Conditions of Approval:  
Notify OCD 48 hours prior to obtaining samples where analyses are to be presented to OCD  
Attached ☐  
*APP-400*

\* Attach Additional Sheets If Necessary