


District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

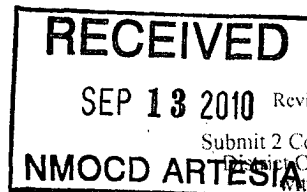

Form C-141

Revised October 10, 2003

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

30-015-36467

Release Notification and Corrective Action

n MCB 1030752888

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company	COG OPERATING LLC 229/37	Contact	Pat Ellis
Address	550 W. Texas, Suite 100, Midland, TX 79701	Telephone No.	432-230-0077
Facility Name	Electra North Federal Tank Battery	Facility Type	Tank Battery
Surface Owner	Federal	Mineral Owner	
		Lease No.	NMNM-0467931

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
B	10	17S	30E					Eddy

Latitude 32 51.201 Longitude 103 57.543

NATURE OF RELEASE

Type of Release	Produced water	Volume of Release	55bbls	Volume Recovered	50bbls
Source of Release	Water transfer pump	Date and Hour of Occurrence	09/01/2010	Date and Hour of Discovery	09/01/2010 8:00a.m.
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Mike Bratcher—OCD		
By Whom?	Josh Russo	Date and Hour	09/01/2010 9:10 p.m.		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\*

The threads on the swedge at the water transfer pump broke off due to corrosion. The old swedge has been replaced with a heavy duty plastic coated swedge.

Describe Area Affected and Cleanup Action Taken.\*

Initially 55bbls of produced water was released from the water transfer pump and all fluid was contained inside the facility dike walls. We were able to recover 50bbls with a vacuum truck. The dimensions of the spill areas were a 20' x 20' area to the north of the pump and a 4' x 40' area to the south of the pump. (The closest well location to the release is the Electra Federal #31, API# 30-015-36467, Unit B, Sec10-T17S-R30E, Eddy County, NM, 1170' FNL 2310' FEL.). Tetra Tech will sample the spill site area to delineate any possible contamination from the release and we will present a remediation work plan to the NMOCd / BLM for approval prior to any significant remediation work.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCd rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCd marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCd acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

OIL CONSERVATION DIVISION

Signature:		Approved by District Supervisor:	
Printed Name:	Josh Russo	Approval Date:	NOV 03 2010
Title:	HSE Coordinator	Expiration Date:	
E-mail Address:	jrusso@conchoresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date:	09/07/2010	Phone:	432-212-2399

REMEDATION per OCD Rules and  
Guidelines. SUBMIT REMEDIATION  
PROPOSAL BY: 12/3/2010

2RP-455

\* Attach Additional Sheets If Necessary