

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other ☐
2. NAME OF OPERATOR
Yates Petroleum Corporation
3. ADDRESS OF OPERATOR
207 South 4th St., Artesia, NM 88210
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980 FSL & 660 FEL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF <input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE <input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES <input type="checkbox"/>	<input type="checkbox"/>
ABANDON* <input type="checkbox"/>	<input type="checkbox"/>
(other) Production Casing <input checked="" type="checkbox"/>	X

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD 4300' Ran 109 joints of 5-1/2" 14# J-55 ST&C casing set at 4300'.
1 float shoe at 4300'. Cemented w/25 sacks 72-25 Poz, 6/10% Flac (D-112),
3/10% Tic (D-65) and 3# KCL/sack. Tailed in w/250 sacks 50-50 Poz, 6/10%
Flac (D-112), 3/10% Tic (D-65) and 3# sack KCL. PD 6:15 PM 12-20-80. WOC.
Ran Temperature Survey and found top of CC at 3075'.

5. LEASE
NM-14755
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Powers OL Federal Corn.
9. WELL NO.
3
10. FIELD OR WILDCAT NAME
Wildcat Und. Abn.
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Unit I, Sec. 14-6S-25E
12. COUNTY OR PARISH
Chaves
13. STATE
New Mexico
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
3622.8' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

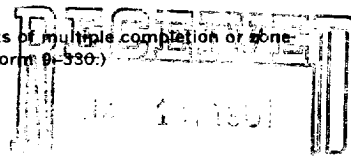

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE Engineering Secretary DATE January 9, 1981

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD
PETER W. CHESTER

JAN 12 1981

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

See Instructions on Reverse Side

UNION OF CHINA
REPUBLIC OF CHINA
1971
YOUTH WORKERS UNION
CHINA WORKERS UNION