

Form 9-331
(May 1963)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-28297

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ RECEIVED

2. NAME OF OPERATOR

Yates Petroleum Corporation

SEP 10 1981

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

O. C. O.

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)

At surface

660' FSL & 660' FEL of Sec. 26-5S-24E

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Everette 00 Federal

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Wildcat Abo

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Unit P

Sec. 26-T5S-R24E

14. PERMIT NO.

15. REMARKS (Show whether DE, RT, OR, etc.)

6924' CR

12. COUNTY OR PARISH

Chaves

13. STATE

NM

16. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PLUG OR ABANDONING

FRACTURE TREAT

MULTIPLE COMPLETION

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

X

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING


ABANDONMENT*

(Other)

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATION. Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.

Spudded a 14-3/4" hole at 1:00 PM 8-30-81. Ran 21 joints of 10-3/4" 40.5# ST&C casing set at 840'. 1-Texas Pattern guide shoe set at 840'. Auto fill float at 800'. Cemented w/415 sacks Class "C" 3% CaCl. Compressive strength of cement at 1875 psi in 12 hours. LD 12:30 AM 9-1-81. Bumped plug to 500 psi, released pressure and float held okay. Cement circulated 15 sacks to pit. WOC 13 hours. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

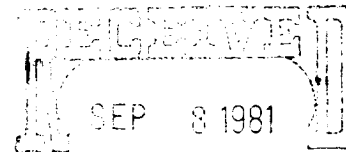

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true

ACCEPTED FOR RECORD

SIGNED ROGER A. CHAPMAN

(This space for Federal or State office use)

SEP 8 1981

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

Engineering Secretary

DATE 9-4-81