

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)


1. oil ☐ well gas ☒ well other
2. NAME OF OPERATOR  
Yates Petroleum Corporation
3. ADDRESS OF OPERATOR  
207 South 4th St., Artesia, NM 88210
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: *27-27S-27E*  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH: *3596.1 GR*
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:


- TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) ☐

SUBSEQUENT REPORT OF:

- ☒  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐

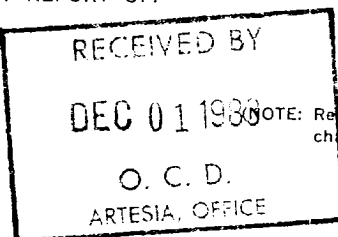

5. LEASE NM 17202
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME  
Short RM Federal
9. WELL NO. 3
10. FIELD OR WILDCAT NAME  
Pecos Slope Abo
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Unit L, Sec. 27-T7S-R25E
12. COUNTY OR PARISH Chaves 13. STATE NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)  
3596.1 GR

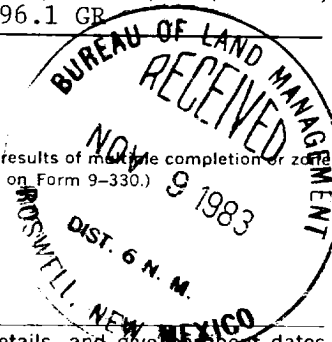

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Spudded 14-3/4" hole 12:00 midnite 10-30-83. Ran 20 joints of 10-3/4" 40.5# J-55 ST&C casing set 800'. 1-Texas Pattern notched guide shoe set 800'. Insert float set 760'. Cemented w/200 sacks Pacesetter Lite, 3% CaCl2. Tailed in w/300 sacks Class "C" 2% CaCl2. PD 9:15 AM 11-1-83. Bumped plug to 1000 psi, released pressure and float held okay. Cement did not circulate. WOC 6 hours. Ran Temperature Survey and found top of cement at 190'. Ran 1". Tagged cement 190'. Spotted 100 sacks Class "C" 3% CaCl2. PD 5:00 PM 11-1-83. Cement circulated 5 sacks to pit. Cement fell back. Ready-Mixed to surface with 3 yards. WOC. Drilled out 5:30 AM 11-2-83. WOC 20 hours and 15 minutes. Nippled up and tested to 1000 psi for 30 minutes, okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct. Production

SIGNED: *David R. Glass* TITLE Supervisor DATE 11-4-83

ACCEPTED FOR RECORD  
(ORIG. SGD.) DAVID R. GLASS

APPROVED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL \_\_\_\_\_

ROSWELL, NEW MEXICO

\*See Instructions on Reverse Side