

BENNETT-CATHEY WIRE LINE SERVICE

P. O. BOX 787

ARTESIA, NEW MEXICO 88210

Phone (505) 746-3281



BOTTOM HOLE PRESSURE SURVEY REPORT


OPERATOR MARALO INC.
LEASE PECOS STATE "15"
WELL NO. #2
POOL FORMATION APO
DATE 4-4-84 **TIME** 1252 HOUR
CO. MAN MARTIN MAIN
STATUS SHUT IN **TEST DEPTH** 3695 FEET
TIME S.I. 1200 HOUR **LAST TEST DATE** 1ST TEST
 4-1-84 **BHP LAST TEST**
TUB. PRES. 922.2# **BHP CHANGE**
CAS. PRES. FLUID TOP
DATUM PLANE WATER TOP
DATUM PSIA 1096.2# **RUN BY** BO FAULKENBERRY
TEMP 104° **CLOCK #** B-3443
PRESSURE RANGE 3500 LBS.
ELEMENT NO. EPG3457382



DEPTH	PSIA PRESSURE	LBS/100FT. GRADIENT
0	968.2	
1000	1017.2	2.9
2000	1045.2	2.8
3000	1074.2	2.9
3545	1091.2	3.1
3695	1096.2	3.3
3952	1105.2	3.5

3952 FEET WAS EXTRAPOLATED.

TIME B.H.P. MEASURED 1252 HOUR.
LENGTH OF TIME WELL SHUT IN 72 HR 52 MIN.

PERFORATIONS FROM 3898 TO 4006 FEET.

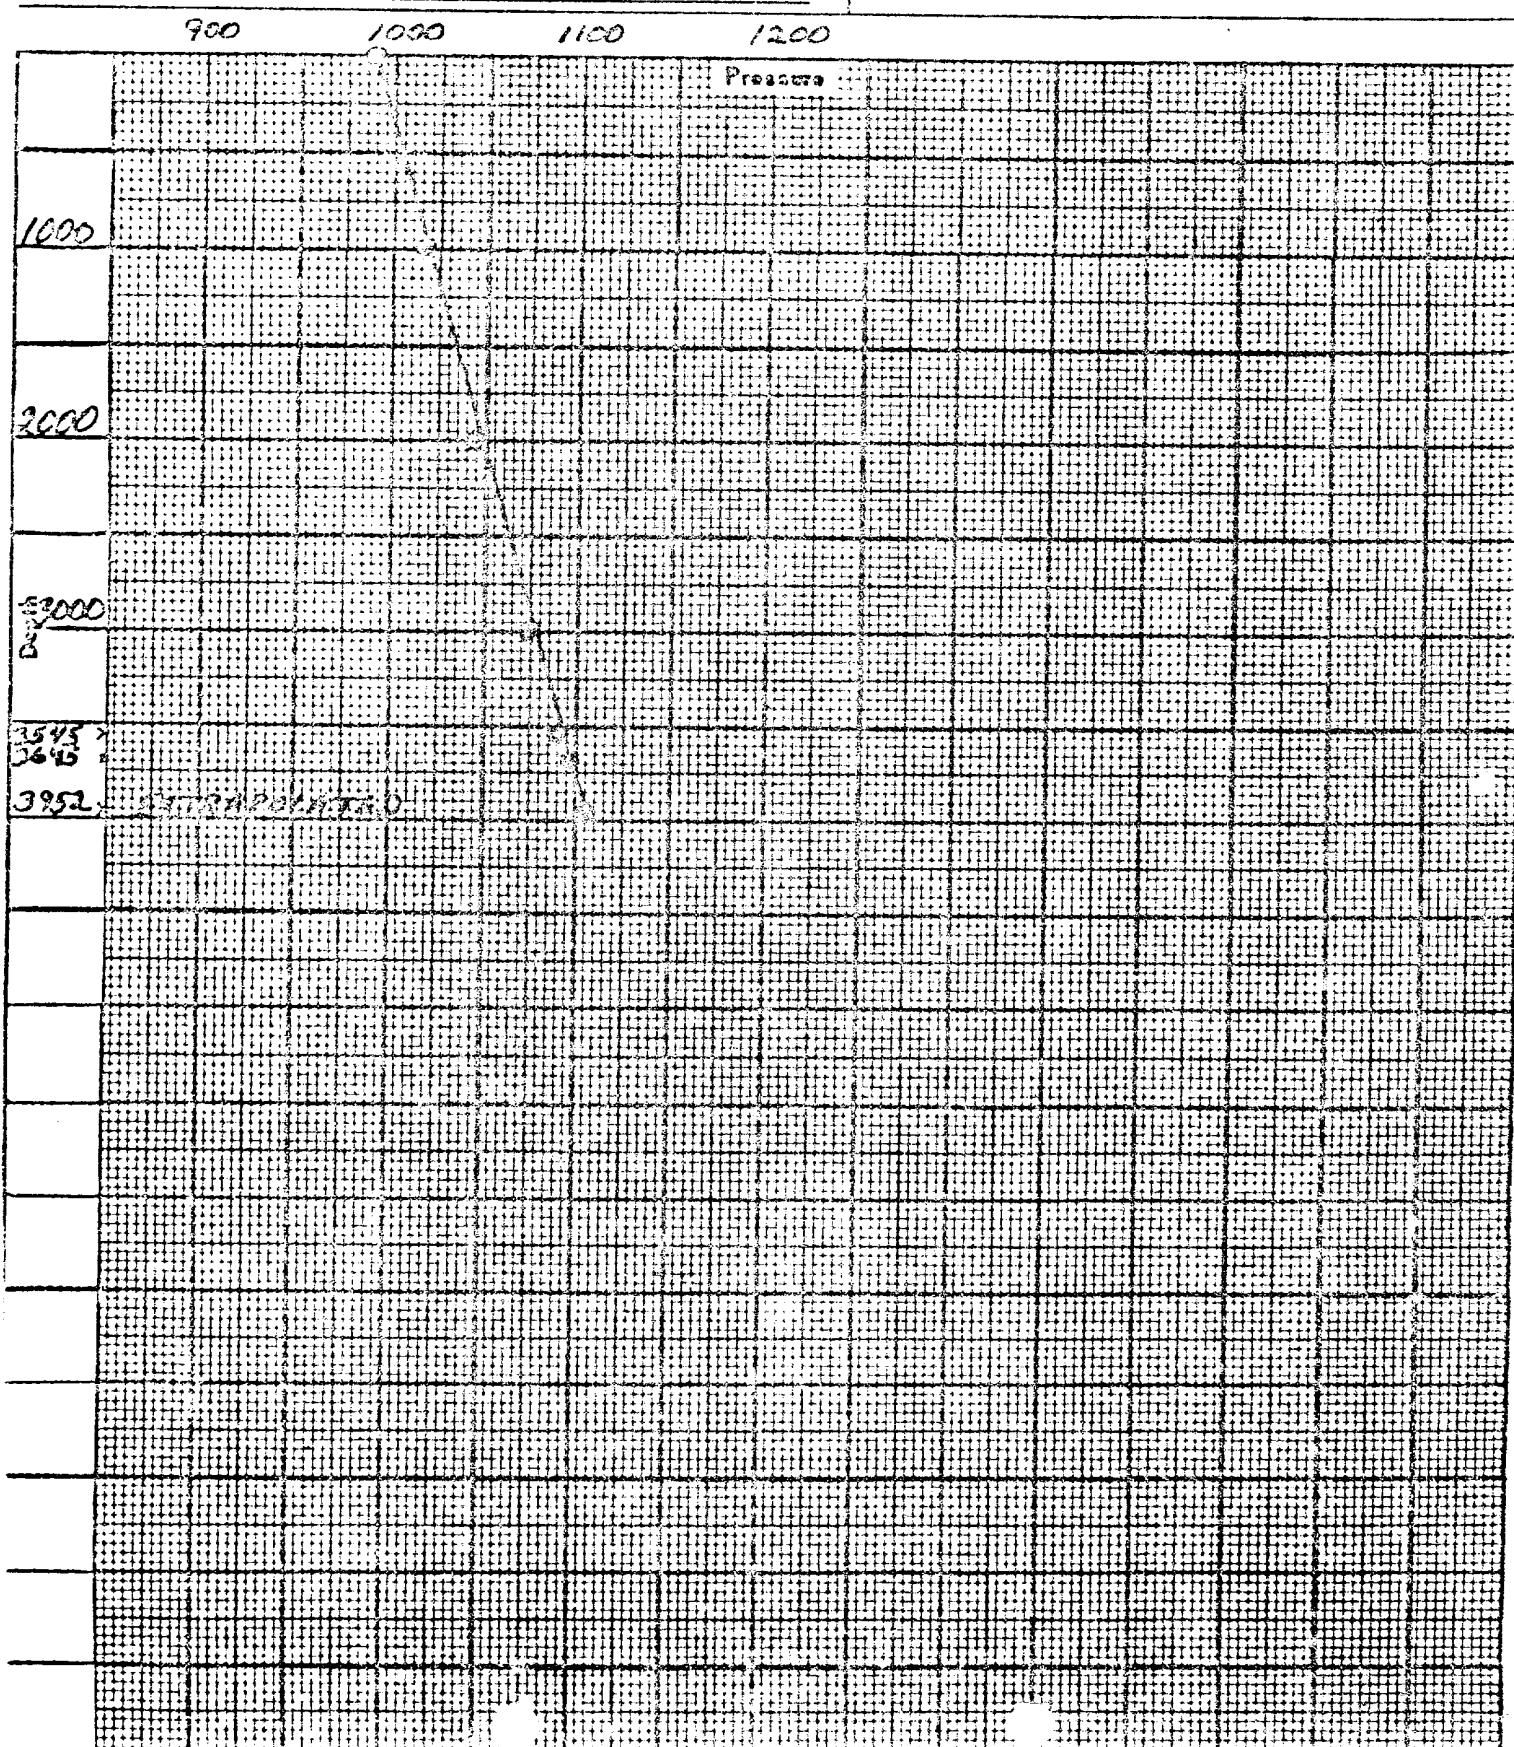


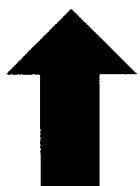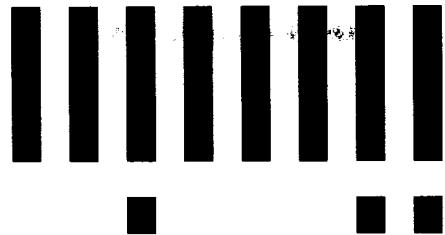

LTR



Job separation sheet



COMPANY: MAPALO INCORPORATED
LEVEL: FEDERAL STATE
FIELD: PETROLEUM EXPLORATION
COUNTRY: UNITED STATES
INDUSTRY: PETROLEUM EXPLORATION

THE COUNCIL OF THE NATIONAL UNION
OF THE CHINESE WORKERS

用於研究的統計方法，其數量為何？

（三）在本行的各項工作，應當遵守本行的規章制度，並接受本行的監督和檢查。

--

卷之三

1940-41 1941-42 1942-43 1943-44
1944-45 1945-46 1946-47 1947-48
1948-49 1949-50 1950-51 1951-52
1952-53 1953-54 1954-55 1955-56
1956-57 1957-58 1958-59 1959-60
1960-61 1961-62 1962-63 1963-64
1964-65 1965-66 1966-67 1967-68
1968-69 1969-70 1970-71 1971-72
1972-73 1973-74 1974-75 1975-76
1976-77 1977-78 1978-79 1979-80
1980-81 1981-82 1982-83 1983-84
1984-85 1985-86 1986-87 1987-88
1988-89 1989-90 1990-91 1991-92
1992-93 1993-94 1994-95 1995-96
1996-97 1997-98 1998-99 1999-2000

100 100 100 100 100
100 100 100 100 100
100 100 100 100 100
100 100 100 100 100
100 100 100 100 100

卷之三