

UNITED STATES DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
NEW MEXICO
ARTESIA, NM 88210Form approved.
Budget Bureau No. 42-R1424.

6. LEASE DESIGNATION AND SERIAL NO.

LC 056302 (b)

8. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> WIW - TA	MAR 22 1983	7. UNIT AGREEMENT NAME	Square Lake Flood (East)
2. NAME OF OPERATOR	Newmont Oil Company	8. FARM OR LEASE NAME	Johnson
3. ADDRESS OF OPERATOR	P. O. Box 1305-----Artesia, New Mexico 88210	9. WELL NO.	12
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface		10. FIELD AND POOL, OR WILDCAT	Square Lake (G. SA)
	990' FSL, 1980' FEL of Sec. 34	11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA	Sec. 34-16S-31E
14. PERMIT NO.		12. COUNTY OR PARISH	Eddy
15. ELEVATIONS (Show whether DF, RT, OR, etc.)	4008' GLM	13. STATE	New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	(Other) <input type="checkbox"/>
(Other) <input type="checkbox"/>		(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

The above well was plugged and abandon as follows.....

7/27/82.....Spotted 50 sack cement plug at 3515'.


7/28/82.....Top of bottom plug at 3160'. Csg leak between 1295' and 1418'. Perf base of salt 1780'. Could not pump in. Perf spot 20 sacks cement @ 1780'. Spotted. 50 sack cement plug at csg leak between 1295 and 1418'. Approved by Meredith Jones.

7/29/82.....Tag plug on csg leak at 1215'. Perf top salt 730'. Squeezed 50 sacks cement.

7/30/82.....Plug at top of salt @ 730'. Did not hold. Squeezed w/100 sacks cement
Squeezed w/600# Pressure

7/31/82.....Tag plug - top of salt at 508'...psi 600#. Put up dry hole marker.

Location ready for inspection.

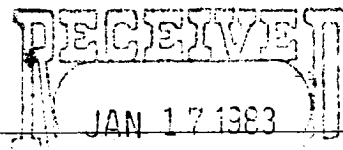

18. I hereby certify that the foregoing is true and correct.

SIGNED

TITLE

Area Manager

DATE

1/13/82

(This space for Federal or State office use)

APPROVED BY

W. CHESTER

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY

MAR 18 1983

FOR

JAMES A. GILLHAM
DISTRICT SUPERVISOR

See Instructions on Reverse Side

Potted #10-7
2-18-83
P&A