

C157
BP

DISTRICT I

P.O. Box 1980, Hobbs NM 88240

DISTRICT II

P.O. Drawer DD, Artesia NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-22893

5. Indicate Type of Lease

State ☒

FEE ☐

6. State Oil & Gas Lease No.

B-1111

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL

GAS

WELL

WELL ☒

OTHER

2. Name of Operator

Yates Petroleum Corporation

3. Address of Operator

105 South 4th., Artesia, NM 88210

4. Well Location

Unit: Letter **G** : **1980** Feet From The **NORTH** Line and **1980** Feet From The **EAST** Line

Section **22** Township **T17S** Range **R28E** NMPM

EDDY COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3592' GR


11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☒ **TEMPORARY ABANDONMENT**

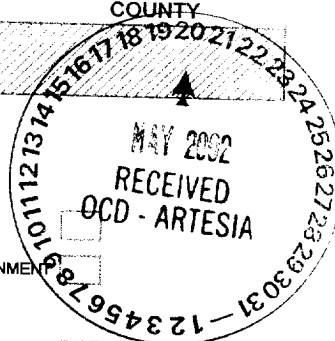

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-2-02- Prep to start T & A procedure. Call Van Barton w/ OCD. MIRU PU, load casing - no tubing in well. NU BOP & unload work string. SD.
5-4-5-6-02- Bled down; loaded casing. TIH w/ bit & scraper to 7000'. TOH; RU wireline. TIH w/ CIBP - set @ 6575'. TOH - TIH w/ bailer. Put 35' cement on top of CIBP. TOH, RD wireline. Put 900 psi on casing, held for 10 mins. TIH w/ tubing. SD. Prep to lay down tubing & test casing. Called Van Barton w/ NMOC-D-Artesia.
5-7-02- TOH laying down tubing. ND BOP; NU wellhead. Loaded casing w/ 2% KCL water - test casing to 500 psi for 30 minutes, test good. Phil Hawkins w/ OCD on location. Well is temporarily abandoned. Final report - chart is attached.

Temporary Abandoned Status approved
until 5-7-03

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Donna Clack

TITLE Operations Technician

DATE 5/14/02

TYPE OR PRINT NAME DONNA CLACK

TELEPHONE NO. 505-748-1471

(This space for State Use)

APPROVED BY

TITLE

DATE

MAY 29 2002

CONDITIONS OF APPROVAL, IF ANY:

