


Land Office Las Cruces

Lease No. 028793 (c)

Unit Burch C

(SUBMIT IN TRIPLICATE)

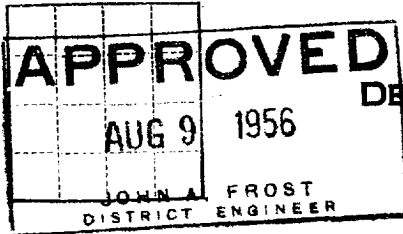

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Loco Hills, New Mexico August 8, 19 56

Well No. 8 is located 660 ft. from (N) line and 660 ft. from (E) line of sec. 23

35/4 35/4 Sec. 23 17-8 29-8 N.H.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Grayburg-Kealy Eddy New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3581 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

WE drilled out plug at 2945' and cleaned out to T. D. 3493' and straight reamed-hole from 5" to 6 1/2" from 3240' to 3295'. On July 25, 1956 we ran 846' of 5 1/2" OD 14# JS & HS new liner hung from 2445' - 3291' on Brown Type C 6-slip liner hanger and type P packer. Cemented with 35 sac Alamo Cement. After allowing to stand 8 hours, ran temperature survey which showed top of cement at 2860'. After allowing to stand cemented for 72 hours, we drilled plug, bailed hole dry and re-ran bailer. As shut-off proved complete operations were resumed. Cementing was done by Denton Oil Well Cementing Company. Temperature survey was done by West Engineering Company.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company General American Oil Company of Texas

Address P. O. Box 416

Loco Hills, New Mexico

By R. J. Heard
R. J. Heard,
Title Field Superintendent