

Form 3160-5
(June 1990)

UNITED STATES Artesia, NM 88210
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

RECEIVED

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other WATER INJECTION WELL

OCT - 6 1993

2. Name of Operator

MERIDIAN OIL INC.

Southland Royalty

3. Address and Telephone No.

P.O. Box 51810 Midland, TX 79710

915-688-6800

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

NE/SW, SEC. 35, T-17-S, R-29-E

1980' FSL & 1980 FWL

5. Lease Designation and Serial No.
LC 028775B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No. RJU TR. 2

17

9. API Well No.

30-015-12724

10. Field and Pool, or Exploratory Area

GRAYBURG JACKSON

11. County or Parish, State
EDDY CO., NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7/27/93: MIRU. ND WH. NU BOP. BACK FLOWED WELL. POOH. FISH @ 2671'.

7/28/93: RIH W/CICR TO 2490'. STUNG OUT OF CICR CURCULATED HOLE W/10 PPG GELLED BRINE MUD. STUNG INTO CICR. SQZD 150 SXS CMT BELOW. STUNG OUT OF CICR. CAPPED W/90 SXS CMT. POOH W/TBG. RU WIRELINE. RIH. PERFORATED @ 900'. POOH W/WIRELINE. RIH W/CICR TO 850'. SQZD 30 SXS CMT BELOW. STUNG OUT. CAPPED W/6 SXS CMT. RU WIRELINE. RIH. PERFORATED @ 550'. PUMPED 150 SXS CMT. DID NOT CIRCULATE. WOC.

7/29/93: RIH. TAGGED CMT @ 163'. RU WIRELINE PERFORATED @ 163'. PMPED 30 SXS CMT. DID NOT CIRCULATE. WOC 4 HOURS. TAGGED CMT @ 163'. PMPED 30 SXS CMT. WOC.

8/1/93: RIH. TAGGED CMT @ 22'. PMPED 5 SXS CMT. FILLED 7" TO SURFACE. PMPED 5 SXS CMT. DOWHOLE BRADENHEAD. FILLED TO SURFACE. CUT WELLHEAD OFF 3' BELOW SURFACE. INSTALLED P & A MARKER.


LOCATION HAS NOT BEEN CLEANED AS OF THIS DATE. WILL FILE SUNDRY UPON COMPLETION OF CLEAN UP

Post ID-2
8-20-93
PFA

RECEIVED
4 10:53 AM '93

14. I hereby certify that the foregoing is true and correct

Signed

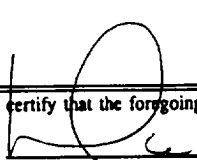

DONNA WILLIAMS

Title PRODUCTION ASSISTANT

Date 8/3/93

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Petroleum Engineer

Date

10/4/93