

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Drawer DD
Artesia, NM 88210

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ well gas ☐ well other ☐

2. NAME OF OPERATOR
BURNETT OIL CO., INC.


3. ADDRESS OF OPERATOR
1500 Interfirst Tower, Ft. Worth, Texas 76102

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: **440' from north and east lines of**
AT TOP PROD. INTERVAL: **Sec. 13-175-308.**
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:
TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other)

SUBSEQUENT REPORT OF:

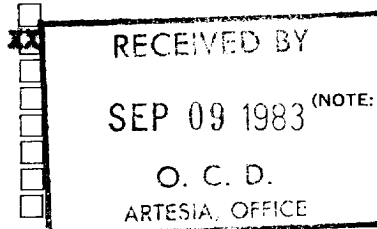

5. LEASE
LC-029339-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME
Grayburg Jackson S. A. Unit

8. FARM OR LEASE NAME

9. WELL NO.
30

10. FIELD OR WILDCAT NAME
Grayburg Jackson, GB-SA

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 13-175-308

12. COUNTY OR PARISH
Hddy

13. STATE
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On Feb. 1, 1983, hole was cleaned out with reverse circulation and drilled out to 3558'. Ran gamma ray-compensated neutron and caliper logs. On Feb. 9, 1983, ran Lynes packer and set at 3293'. Treated below packer with Duo-frac containing 9,500 gals. 20% acid + 18,000 gals. Radi-frac + 14,000# FLA-100 sand in 3 stages, using two blocks of a total of 300# benzoic acid flakes + 600# rock salt. Also included 50 gals. scale inhibitor. Treated at 1600 psi. at 4 BPM but last stage pressure increased to 2600 psi.

On Aug. 15, 1983, well pumped 7 BO + 102 BW per day. Prior to work, well pumped 1 BOPD.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Ralph L. May TITLE Consultant DATE Sept. 2, 1983

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD

SEP 7 1983

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.