

Details of bop test


Midwest Oil Corporation

South Empire Deep Unit #4

12/4/73

Contractor: Warton Drlg. Rig 4

Test by Yellow Jacket Tools and Services, Inc.

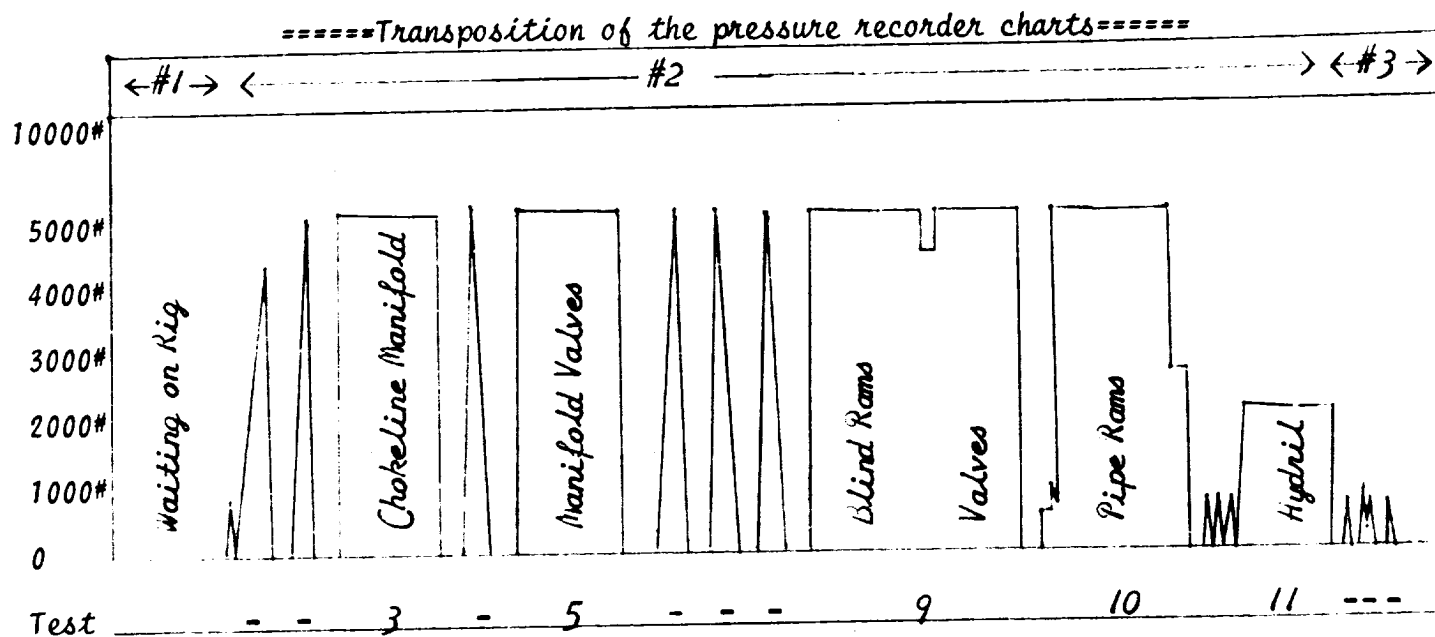

The above is a transposition of the pressure recorder charts covering test to the blowout control equipment in service on your well drilling in the Loco Hills, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig nipping up.

Waiting on rig to finish nipping up.

START CHART #2

TESTING: Chokeline-Manifold with outside valve closed off stack on chokeline and all valves closed off choke-manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 800# and released air; repressured to 4200# with leak to flange at guage connection. Tightened.

Test #2 Repeated test. Pressured to 5000# with same leak. Tightened.

Test #3 Repeated test. Pressured to 5000# with loss of approximately 100# during first eleven minutes then leveling out for remaining