

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE
(Other instruction
reverse side)Form approved
Budget Bureau No. 42 R1424

5. LEASE DESIGNATION AND SERIAL NO.

LC-028784-c

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR General American Oil Company of Texas	8. FARM OR LEASE NAME Keely "C"
3. ADDRESS OF OPERATOR P. O. Box 128 Loco Hills, New Mexico 88255	9. WELL NO. 55
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 330' FSL and 990' FEL	10. FIELD AND POOL, OR WILDCAT Grayburg-Jackson
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 12, T-17S, R-29E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3667.6' KB	12. COUNTY OR PARISH Eddy
	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	FULL OR ALTER CASING
FRACURE TREAT	MULTIPLE COMPLETE
SHOOT OR ACIDIZE	ABANDON*
REPAIR WELL	CHANGE PLANS
(Other)	

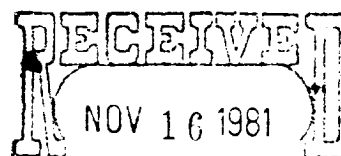
SUBSEQUENT REPORT OF:

WATER SHUT-OFF	REPAIRING WELL
FRACURE TREATMENT	ALTERING CASING
SHOOTING OR ACIDIZING	ABANDONMENT*
(Other)	Production Casing X

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 10-27-81 Ran 72 joints of 5-1/2" 15.5# K-55 ST&C 8rd. casing to 3017'. DV ran @ 2430'. Cemented with 250 sacks Class "H" cement with 10# sand, 5# salt and 1/2% CF-10. Plugged back total depth: 2976'.
- 11-05-81 Pumped 300 sacks Class "H" cement with 10# salt and 2" ClCh through DV tool. Balanced waterflows. After 4 hours, waterflow out 8-5/8" casing shut-off.
- 11-06-81 Pumped 150 sacks Class "H" cement with 3# salt and 2" ClCh through DV tool. Drop plug to close DV tool.
- 11-10-81 Rig up reverse unit and drill out DV tool. Pressure test casing—tool closed.

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED ACCEPTED FOR RECORD
ROGER A. CHAPMANTITLE EngineerDATE November 12, 1981

(This space for Federal or State office use)

APPROVED BY DEC 4 1981
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

*See Instructions on Reverse Side