

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
Artesia, NM 88210

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-0467934

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Maddren Deep Unit "B"

9. WELL NO.

#1

10. FIELD AND POOL, OR WILDCAT

Cedar Lake Morrow

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 27, T-17S, R-30E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

General American Oil Company of Texas

3. ADDRESS OF OPERATOR

P.O. Box 128 Loco Hills, New Mexico 88255

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

660' FSL and 2180' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3589.9 GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

Surface Casing

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Well was spud on April 15, 1982 at 3:00 P.M.

2. Size hole 17-1/2" Casing was 13-3/8" 48# H-40 and was run on April 16, 1982 to a depth of 352' and cemented as follows:

a. Volume of cement: 500 sacks Class "C" cement with 2% Calcium chloride and 1/4# flocele.


b. Brand of cement: Southwestern Portland.

c. Full circulation during cement operations.

d. During last of cement operations cement was noticed at surface but on completion of operation cement fell back. U.S.G.S. was contacted and surface was ready mixed.

e. Waited on cement for 27 hours.

f. Test B.O.P.E. to 1000# for 30 minutes.

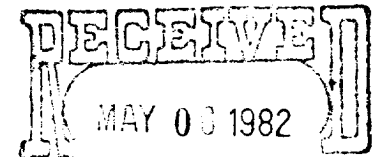

18. I hereby certify that the foregoing is true and correct

SIGNED Rendell M. Hawkins TITLE Field Superintendent

(This space for Federal or State office use)

APPROVED BY [Signature]
CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO
DATE May 5, 1982