

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Mack Energy Corporation

3. Address and Telephone No.

P.O. Box 960, Artesia, NM 88211-0960

4. Location of Well (Footage, Sec., T. R., M. or Survey Description)

2080 FNL 1525 FWL, Sec 21-T17S-R30E

5. Lease Designation and Serial No.

LC-054988-A

6. Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Berry A Federal #8

9. API Well No.

30-015-29565

10. Field and Pool, or Exploratory Area

Loco Hills Paddock

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Completion

☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work)*

12/20/97 RU RIH w/6 4 3/4" drill collars & 4 3/4" bit on workstring. Tag DV Tool @ 4201' & drill out. RIH & tag bottom @ 4921'.
POH & stand back workstring. RU Computalog & perforate 4417-4804' 82 shots. RD Computalog.

12/22/97 Acidized Perfs w/2000 gals 15% NE Acid.


12/29/97 ReAcidized perfs w/32,000 gals 20% HCL & 54,000 gals 40# gel

12/30/97 Release RTTS & RIH clean out balls & block. POH laying down workstring. PU used 2 7/8" J-55 tbg. Land SN @ 4838' w/156 jts TA @ 4374' w/137 jts. RIH w/new 2 1/2x2x20' PAP trash pump. 136-7/8" rods 55-1" used type 97 WCN. 2"x7/8" 4-6-8"x1" ponies.

01/05/98 Move in, rig up 460 pumping unit from Berry A #7. At time of rig up found that saddle bearing was going bad. Pull off, send to machine shop for repairs.

01/06/98 Waiting on repair of saddle bearing from machine shop.

01/07/98 Replace and repair bearing on unit. Put to pumping to battery.

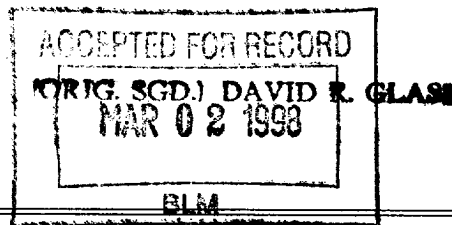

14. I hereby certify that the foregoing is true and correct

Signed Crista D. Carter

Title Production Clerk

Date 2/16/98

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____