

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

FORM APPROVED
Budget Bureau No. 1004-0135
Expires July 31, 1996

45K

Oil Cons.
N.M. DIV-2
1301 W. Grand Avenue
Artesia, NM 88210

Lease Serial No. NMLC029395B
Well Name or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
 Oil Well Gas Well Other

2. Name of Operator
OKY USA WTP Limited Partnership

3a. Address
P.O. Box 50250, Midland, TX 79710-0250

3b. Phone No. (include area code)
915-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1335 FSL 760 FEL NESE(I) Sec 20 T17S R31E

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.
OKY Rocky Road 1
Federal

9. API Well No.
30-015-31818

10. Field and Pool, or Exploratory Area
Undsg Cedar Lake Morrow, N.


11. County or Parish, State
Eddy NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Deepen
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Alter Casing
	<input type="checkbox"/> Fracture Treat
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Change Plans
	<input type="checkbox"/> Plug and Abandon
	<input type="checkbox"/> Convert to Injection
	<input type="checkbox"/> Plug Back
	<input type="checkbox"/> Production (Start/Resume)
	<input type="checkbox"/> Reclamation
	<input type="checkbox"/> Recomplete
	<input type="checkbox"/> Temporarily Abandon
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Well Integrity
	<input checked="" type="checkbox"/> Other <u>Spud</u>
	<u>Set Csg & Cmt</u>

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

SEE OTHER SIDE

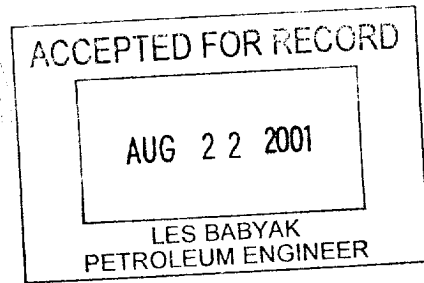

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed) **David Stewart** Title **Sr. Regulatory Analyst**

David Stewart Date **8/17/01**

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by _____ Title _____ Date _____

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office _____

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

ATTACHMENT 3160-5
OXY USA INC.
OXY ROCKY ROAD FEDERAL #1
SEC 20 T17S R31E
EDDY COUNTY, NM

NOTIFIED BLM 7/5/01 OF SPUD. MIRU UTI #514, SPUD WELL @ 0005hrs MDT 7/6/01. DRILL 17-1/2" HOLE TO TD @ 402', 7/6/01, PUMP SWEEP, CIRC. RIH W/ 13-3/8" 48# H40 CSG, SET @ 402'. M&P 150sx CL H W/ 10% A10B + 10# GILSONITE + .25#/sx CELLOFLAKES + 1% CaCl₂ FOLLOWED BY 151sx 65/35 C/POZ W/ 6% BENTONITE + 2% CaCl₂ + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl₂, DISP W/ FW, BUMP PLUG, 7/6/01, CIRC 175sx CMT TO PIT, WOC-5hrs. BLM NOTIFIED BUT DID NOT WITNESS. CUT OFF CASING, WELD ON STARTING HEAD, TEST TO 500#, OK. NU BOP & CHOKE MANIFOLD, TEST BLIND RAMS, PIPE RAMS, & HYDRIL TO 1000#, OK. TOTAL WOC-12hrs, RIH & TAG, DRILL OUT & DRILL AHEAD 7/7/01.

DRILL 12-1/4" HOLE TO TD @ 4510' 7/18/01, PUMP SWEEP, CIRC. RIH W/ 9-5/8" 40/36# HCK55/K55 CSG & SET @ 4510'. M&P 1355sx 65/35 C/POZ W/ 6% BENTONITE + 1% CaCl₂ + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl₂, DISP W/ FW, PLUG DOWN 7/19/01, CIRC 90sx CMT TO PIT, WOC-5hrs. BLM NOTIFIED BUT DID NOT WITNESS. NU. BOP & CHOKE MANIFOLD, TEST BLIND RAMS, PIPE RAMS, CHOKE LINES, CHOKE MANIFOLD AND SAFETY VALVES TO 5000#, OK. TEST HYDRIL, MUD LINES, & CASING TO 2500#, BLM NOTIFIED OF BOP TEST, DID NOT WITNESS. TOTAL WOC-18hrs. RIH & TAG, DO CMT, DRILL AHEAD 7/20/01.

BUREAU OF LAND MGMT
ROSWELL OFFICE
2001 AUG 20 AM 9:27
RECEIVED