


(SUBMIT IN TRIPLICATE)

Land Office **LO 028772 (b)**

Lease No. \_\_\_\_\_

Unit \_\_\_\_\_

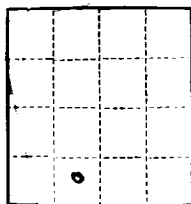

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

**Dunn B** April 29, 19**58**  
Well No. **17** is located **660** ft. from **N** line and **1980** ft. from **E** line of sec. **12**  
**25/4 32/4 sec. 12 18 S 28 E 1021**  
(U.S. Section No.) (Twp.) (Range) (Meridian) **New Mexico**  
(Field) (County or Subdivision) (State or Territory)

**3632**

The elevation of the derrick floor above sea level is \_\_\_\_\_ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cement, etc.)

**We rigged up cable tools and cleaned out to total depth 2683'. We then deepened well to total depth 2878' and ran 4 1/2" O.D. 9.5# per ft. seamless new casing to total depth with back off tool at 2267' and cemented with 100 sax. After plug was pumped down we backed off 4 1/2" at 2267' and reversed out cement above 2267'. We then tied back into 4 1/2" at 2267' and let cement set 48 hrs. Tested pipe with 1000# for 48 hrs. Pressure test indicated cement job. O.K. We then moved off cable tools and rigged up reverse circulation rig and ran Gamma Ray Neutron survey to total depth. Now preparing to perforate and frac.**

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

**Western - Yates**

Company \_\_\_\_\_

Address \_\_\_\_\_

**rtasia, New Mexico**

By **Chairman of Operating Committee**

Title \_\_\_\_\_