


U. S. LAND OFFICE Las Cruces
SERIAL NUMBER 062491
LEASE OR PERMIT TO PROSPECT _____

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

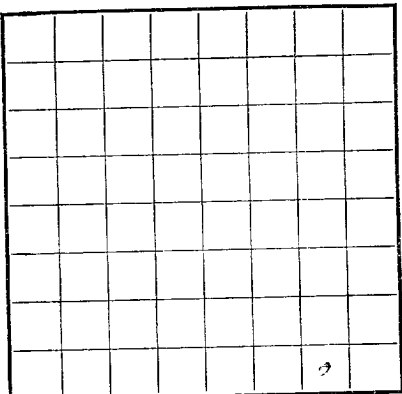

LOCATE WELL CORRECTLY

LOG OF OIL OR GAS WELL

Company Robert L. McKee, Gen. Contr., Inc. Address Box 246, Artesia, New Mexico
Lessor or Tract P. McKee - L. McKee Field Turkey Track State New Mexico
Well No. 1 Sec. 27 T. 18 R. 29 Meridian N.M.P.M. County Eddy
Location 330 ft. N. of N. Line and 990 ft. E. of W. Line of Section 27 Elevation 3439
(Derrick floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.
Signed _____

Date July 1, 1958 Title Manager of Oil Division

The summary on this page is for the condition of the well at above date.

Commenced drilling May 5, 1958 Finished drilling June 20, 1958

OIL OR GAS SANDS OR ZONES
(Denote gas by G)

No. 1, from 1660 to 1670 No. 4, from _____ to _____
No. 2, from 2094 1/2 to 2104 No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____

IMPORTANT WATER SANDS

No. 1, from 210 to 225 No. 3, from _____ to _____
No. 2, from _____ to _____ No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From—	To—	
<u>8 5/8</u>	<u>24</u>	<u>8 re.</u>	<u>New</u>	<u>365 ft.</u>	<u>Regular</u>				<u>Surface string</u>

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
<u>8 5/8</u>	<u>365'</u>	<u>25</u>	<u>Denton</u>		

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out

TOOLS USED

Rotary tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet
Cable tools were used from Surface feet to 2207 feet, and from _____ feet to _____ feet

DATES

_____, 19____ Put to production Temporarily abandoned, 19____

The production for the first 24 hours was _____ barrels of fluid of which _____% was oil; _____% emulsion; _____% water; and _____% sediment. Gravity, °Bé. _____

If gas well, cu. ft. per 24 hours _____ Gallons gasoline per 1,000 cu. ft. of gas _____

Rock pressure, lbs. per sq. in. _____

EMPLOYEES

_____, Driller _____, Driller
H. S. Guinan, Driller _____, Driller
L. Schoonover, Driller _____, Driller

FORMATION RECORD

FROM—	TO—	TOTAL FEET	FORMATION
0	15	15	Sand
15	30	15	Caliche
30	170	140	Red Beds
170	215	45	Anhy. - broken
215	245	30	Sand and Shale
245	255	10	Gravel
255	300	45	Shale and Anhy.
300	355	55	Red Beds
355	365	10	Broken Salt
365	368	3	Salt
368	410	42	Salt and Anhy.
410	660	250	Salt
660	670	10	Anhy. - hard
670	690	20	Salt
690	770	80	Salt and Anhy.
770	942	172	Salt
942	955	13	Anhy.
955	1065	110	Anhy. - broken
1065	1110	45	Anhy. - solid
1110	1150	40	Anhy. - broken
1150	1185	35	Anhy.
1185	1275	90	Anhy. - broken
1275	1315	40	Anhy. - solid
1315	1400	85	Anhy. - broken
1400	1480	80	Anhy.

FORMATION RECORD—Continued

FROM—	TO—	TOTAL FEET	FORMATION
1700	1700	60	Lime and Arny.
1740	1860	20	Lime, gray, hard
1860	1890	30	Lime
1890	1944	54	Lime - broken
1944	2104	160	Lime
2104	2107	3	Red sand
2107	2119	12	Sand
2119	2124	5	Red sand
2124	2138	14	Lime
2138	2141	3	Lime - grey
2141	2207	66	Lime

This well as named back to lease owners, Featherstone Corporation, Harvey E. Roelofs, Trustee for Glen R. Featherstone II, who have temporarily abandoned it leaving the 8 5/8" pipe in the hole.

HISTORY OF OIL OR GAS WELL

It is of the greatest importance to have a complete history of the well. Please state in detail the dates of redrilling, together with the reasons for the work and its results. If there were any changes made in the casing, state fully, and if any casing was "sidetracked" or left in the well, give its size and location. If the well has been dynamited, give date, size, position, and number of shots. If plugs or bridges were put in to test for water, state kind of material used, position, and results of pumping or bailing.