

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY


NM OIL CONS. CO. 88210
SANTA FE DISTRICT
Artesia, NM 88210

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.
NM-02426

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> WIW - TA	7. UNIT AGREEMENT NAME W. I. H. U. GRB #4 SD UT
2. NAME OF OPERATOR NEWMONT OIL COMPANY	8. FARM OR LEASE NAME TRACT 19B
3. ADDRESS OF OPERATOR P.O. BOX 1305 Artesia, N.M.	9. WELL NO. 7
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.) See also space 17 below. At surface 10' FNL & 1400' FEL Sec. 9-18-29	10. FIELD AND POOL, OR WILDCAT Loco Hills (O.G. SA)
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 9-18S-29E
15. ELEVATIONS (Show whether D., RT, GR, ARTESIA, OFFICE) 3508.60	12. COUNTY OR PARISH 13. STATE

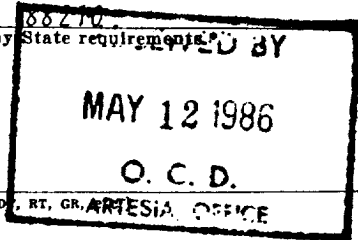

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

The above well was plugged and abandoned as follows:

11/27/82...Spotted 50 sacks cement at 2490'. Tagged plug at 1900'. Perf. base of salt at 860' and squeezed w/50 sacks cement. WOC.

11/28/82...Tagged at 700' - perf top of salt 395'. Squeezed w/50 sacks. WOC.

11/30/82...Tagged plug at 304'. Pressured up to 600 psi. Okay. Dug cellar down to 14" conductor pipe and cut 9 5/8", 7" and 4 1/2" csg. Set 28 sack cement plug. Tying all csg. Dry hole marker at surface.

Location ready for inspection.

RECEIVED

MAR 30 1983

MINERAL & LAND DIVISION
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct.

SIGNED

[Signature]

TITLE

Area Manager

DATE

3/28/83

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

5-586

CONDITIONS OF APPROVAL, IF ANY: